

## LEAN SIGMA CORPORATION

Lean Six Sigma Black Belt Training Featuring Examples from JMP 13



2

## 1.0 Define Phase



## 1.1 Overview of Six Sigma



#### Black Belt Training: Define Phase

#### 1.1 Six Sigma Overview

- 1.1.1 What is Six Sigma
  1.1.2 Six Sigma History
  1.1.3 Six Sigma Approach Y = f(x)
  1.1.4 Six Sigma Methodology
  1.1.5 Roles and Responsibilities
- 1.2 Six Sigma Fundamentals
  1.2.1 Defining a Process
  1.2.2 VOC and CTQs
  1.2.3 QFD
  1.2.4 Cost of Poor Quality (COPQ)
  1.2.5 Pareto Analysis (80 : 20 rule)

- 1.3 Lean Six Sigma Projects

  1.3.1 Six Sigma Metrics
  1.3.2 Business Case and Charter
  1.3.3 Project Team Selection
  1.3.4 Project Risk Management
  1.3.5 Project Planning
  - 1.4 Lean Fundamentals
    1.4.1 Lean and Six Sigma
    1.4.2 History of Lean
    1.4.3 The Seven Deadly Muda
    1.4.4 Five-S (5S)




# 1.1.1 What is Six Sigma



#### What is Six Sigma?


- What is "sigma"?
  - In statistics, **sigma** ( $\sigma$ ) refers to "standard deviation," which is a measure of variation.
  - You will come to learn that variation is the enemy of any quality process. We need to understand, manage, and minimize process variation.
- What is "Six Sigma"?
  - Six Sigma is an aspiration or goal of process performance.
  - A Six Sigma "goal" is for a process average to operate approximately 6<sub>σ</sub> away from customer's high and low specification limits.

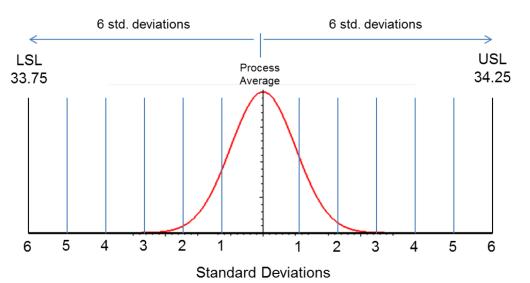



#### What is Six Sigma?


- A process whose average is about 6σ away from the customer's high and low specification limits has abundant room to "float" before approaching the customer's specification limits.
- A Six Sigma process only yields 3.4 defects for every million opportunities! In other words, 99.9997% of the products are defectfree!
   6 std deviations
   6 std deviations

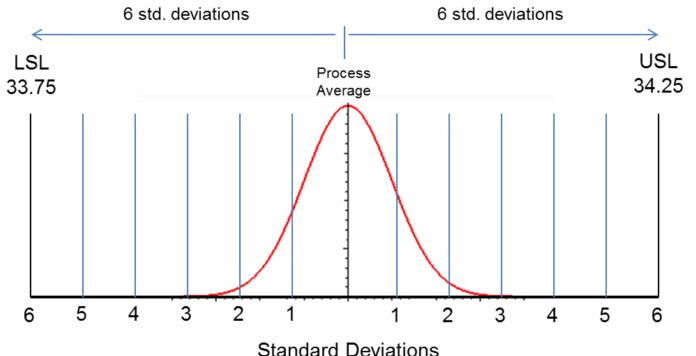



www.LeanSigmaCorporation.com

- **Sigma level** measures how many "sigma" there are between your process average and the nearest customer specification.
- Let us assume that your customers upper and lower specifications limits (USL & LSL) were narrower than the width of your process spread.
- The USL & LSL below stay about 1 standard deviation away from the process average. Therefore, this process operates at **1 sigma**.

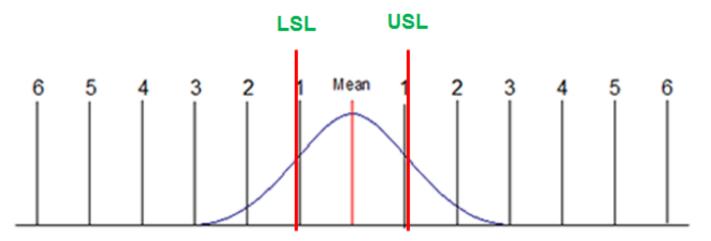



• A process operating at 1 sigma has a defect rate of approximately 70%.



- This means that the process will generate defect-free products only 30% of the time.
- What about processes with more than 1 sigma level?
- A higher sigma level means a lower defect rate.
- Let us take a look at the defect rates of processes at different sigma levels.



- This table shows each sigma level's corresponding defect rate and DPMO (defects per million opportunities).
- The higher the sigma level, the lower the defective rate and DPMO.

Sigma Level	Defect Rate	DPMO
1	69.76%	697612
2	30.87%	308770
3	6.68%	66810
4	0.62%	6209
5	0.023%	232
6	0.00034%	3.4

These Defect Rates Assume a 1.5 sigma shift

• How does this translate into things you might easily relate to?



- Let us take a look at processes operating at 3 sigma.
- 3 sigma processes have a defect rate of approximately 7%. What would happen if processes operated at 3 sigma?
  - Virtually no modern computer would function\*.
  - 10,800,000 health care claims would be mishandled each year.
  - 18,900 US savings bonds would be lost every month.
  - 54,000 checks would be lost each night by a single large bank.
  - 4,050 invoices would be sent out incorrectly each month by a modest-sized telecommunications company.
  - 540,000 erroneous call details would be recorded each day from a regional telecommunications company.
  - 270 million erroneous credit card transactions would be recorded each year in the United States.



(\*http://www.qualityamerica.com)

- What if processes operated with 1% defect rate?
  - 20,000 lost articles of mail per hour\*.
  - Unsafe drinking water almost 15 minutes per day.
  - 5,000 incorrect surgical operations per week.
  - Short or long landings at most major airports each day.
  - 200,000 wrong drug prescriptions each year.
  - No electricity for almost 7 hours per month.
- Even at 1% defect rate, some processes would be unacceptable to you and many others.

#### So what is Six Sigma?

- Sigma level is the measure!
- Six is the goal!



### What is Six Sigma: The Methodology

- Six Sigma itself is the **goal**, not the method.
- In order to achieve Six Sigma, you need to improve your process performance by:
  - Minimizing the process variation so that your process has enough room to fluctuate within customer's spec limits
  - Shifting your process average so that it is centered between your customer's spec limits.
- Accomplishing these two process improvements (along with stabilization and control), you can achieve Six Sigma.
- DMAIC is the systematic methodology prescribed to achieve Six Sigma.


### What is Six Sigma: The Methodology

- DMAIC is a systematic and rigorous methodology that can be applied to <u>any</u> process in order to achieve Six Sigma.
- It consists of 5 phases of a project:
  - Define
  - Measure
  - Analyze
  - Improve
  - Control.
- You will be heavily exposed to many concepts, tools, and examples of the DMAIC methodology through this training.
- You will be capable of applying the DMAIC methodology to improve the performance of <u>any</u> process at the completion of the curriculum.



# 1.1.2 Six Sigma History



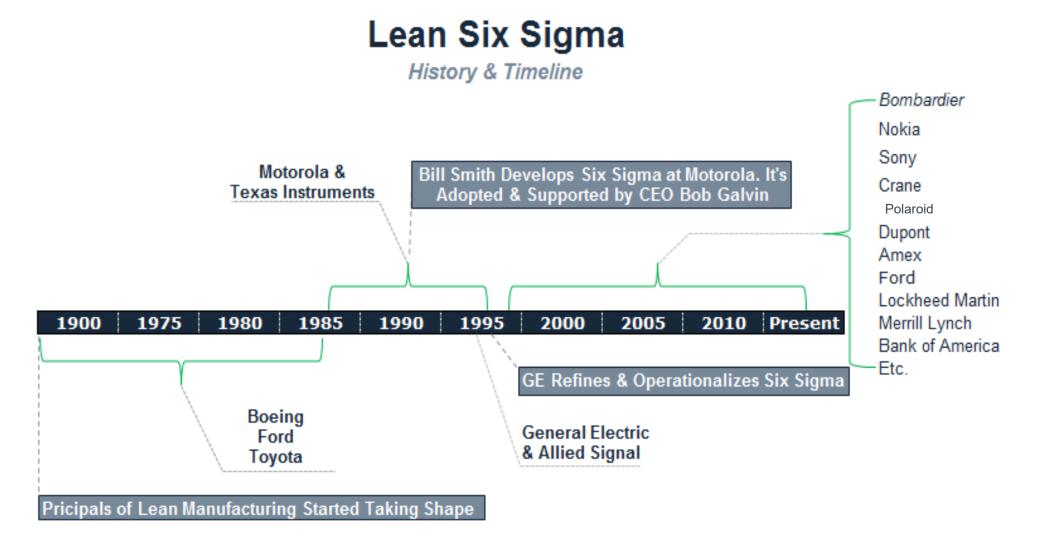

- The "Six Sigma" terminology was originally adopted by Bill Smith at Motorola in the late 1980s as a quality management methodology.
- As the "Father of Six Sigma," Bill forged the path for Six Sigma through Motorola's CEO Bob Galvin who strongly supported Bill's passion and efforts.
- Starting from the late 1980s, Motorola extensively applied Six Sigma as a process management discipline throughout the company, leveraging Motorola University.
- In 1988, Motorola was recognized with the prestigious Malcolm Baldrige National Quality Award for its achievements in quality improvement.




- Six Sigma has been widely adopted by companies as an efficient way of improving the business performance since General Electric implemented the methodology under the leadership of Jack Welch in the 1990s.
- As GE connected Six Sigma results to its executive compensation and published the financial benefits of Six Sigma implementation in their annual report, Six Sigma became a highly sought-after discipline of quality.



- Most Six Sigma programs cover the aspects, tools, and topics of Lean or Lean Manufacturing.
- The two work hand in hand, benefitting each other.
  - Six Sigma focuses on minimizing process variability, shifting the process average, and delivering within customer's specification limits.
  - Lean focuses on eliminating waste and increasing efficiency.
- Lean and its popularity began to form and gain significant traction in the mid 1960s with the Toyota initiative "TPS" or Toyota Production System.
- The concepts and methodology of Lean, however, were fundamentally applied much earlier by both Ford and Boeing in the early 1900s.



• Despite the criticism and immaturity of Six Sigma in many aspects, its history continues to be written with every company and organization striving to improve its business performance.

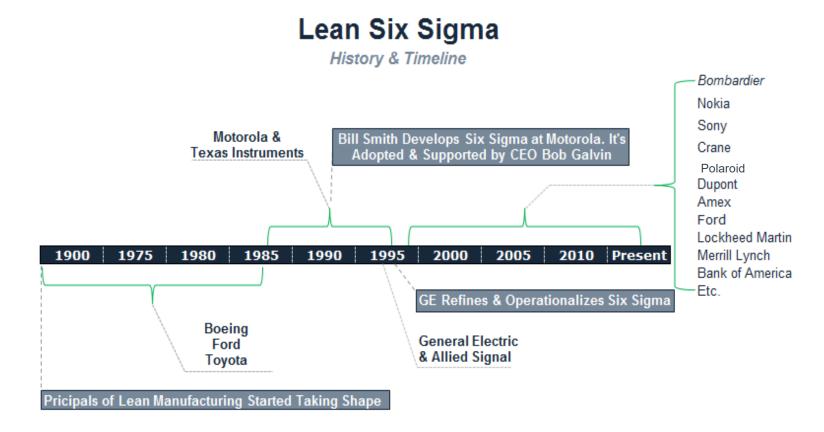



20

 $\odot$ 

# 1.1.3 Six Sigma Approach





- The Six Sigma approach to problem solving uses a transfer function.
- A transfer function is a mathematical expression of the relationship between the inputs and outputs of a system.
- Y = f(x) is the relational transfer function that is used by all Six Sigma practitioners.
- It is absolutely critical that you understand and embrace this concept.




- "Y" refers to the measure or output of a process.
  - Y is usually your primary metric
  - Y is the measure of process performance that you are trying to improve.
- f(x) means "function of x."
  - x's are factors or inputs that affect the Y
- Combined, the Y = f(x) statement reads "Y is a function of x."
- In simple terms: "My process performance is dependent on certain x's."
- The objective in a Six Sigma project is to identify the critical x's that have the most influence on the output (Y) and adjust them so that the Y improves.



- Let us look at a simple example of a pizza delivery company that desires to meet customer expectations of on-time delivery.
  - Measure = on-time pizza deliveries
    - Y = percent of on-time deliveries
  - f(x) would be the x's or factors that heavily influence timely deliveries
    - x1: might be traffic
    - x2: might be the number of deliveries per driver dispatch
    - x3: might be the accuracy of directions provided to the driver
    - x4: might be the reliability of the delivery vehicle
    - etc.
- The statement Y = f(x) in this example will refer to the proven x's determined through the steps of a Six Sigma project.



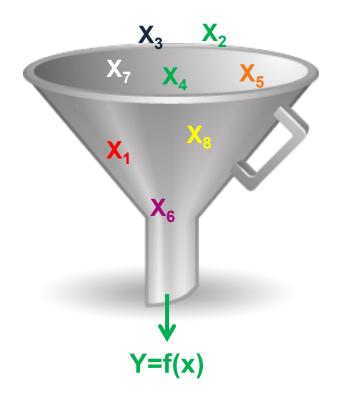

- With this approach, all potential x's are evaluated throughout the DMAIC methodology.
- The x's should be narrowed down until the vital few x's that significantly influence "on-time pizza deliveries" are identified!



- This approach to problem solving will take you through the process of determining all potential x's that **might** influence on-time deliveries and then determining through measurements and analysis which x's **do** influence on-time deliveries.
- Those significant x's become the ones used in the Y = f(x) equation.
- The Y = f(x) equation is a very powerful concept and requires the ability to measure your output and quantify your inputs.
- Measuring process inputs and outputs is crucial to effectively determining the significant influences to any process.



# 1.1.4 Six Sigma Methodology




### Six Sigma Methodology

- Six Sigma follows a methodology that is conceptually rooted in the principles of a five-phase project.
- Each phase has a specific purpose and specific tools and techniques that aid in achieving the phase objectives.
- The 5 phases of DMAIC:
  - 1. Define
  - 2. Measure
  - 3. Analyze
  - 4. Improve
  - 5. Control



## Six Sigma Methodology

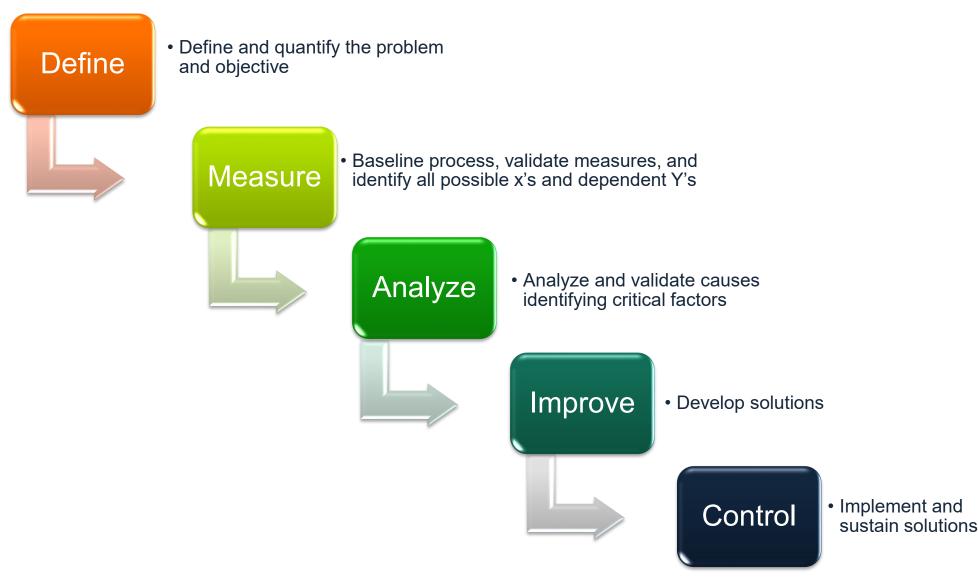


29

 $\odot$ 

#### Six Sigma Methodology: Define Phase

- The goal of the **Define** phase is to establish a solid foundation and business case for a Six Sigma project.
- Define is arguably the most important aspect of any Six Sigma project.
- All successful projects start with a current state challenge or problem that can be articulated in a quantifiable manner.
  - It is not enough to just know the problem, you must quantify it and also determine the goal.
- Once problems and goals are identified and quantified, the rest of the define phase will be about valuation, team, scope, project planning, timeline, stakeholders, Voice Of the Customer (VOC), and Voice Of the Business (VOB).

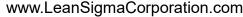

#### Six Sigma Methodology: Define Phase

#### Define Phase Tools and Deliverables

- Project Charter Establish the:
  - Business Case
  - Problem Statement
  - Project Objective
  - Project Scope
  - Project Timeline
  - Project Team.
- Stakeholder Assessment
- High-Level Pareto Chart Analysis
- High-Level Process Map
- VOC/VOB and CTQs Identified and Defined
- Financial Assessment



#### www.LeanSigmaCorporation.com

32

#### Six Sigma Methodology: Measure Phase

- The goal of the **Measure** phase is to gather baseline information about the process (process performance, inputs, measurements, customer expectations etc.).
- Throughout the Measure phase you will seek to achieve a few important objectives:
  - Gather All Possible x's
  - Assess Measurement System and Data Collection Requirements
  - Validate Assumptions
  - Validate Improvement Goals
  - Determine COPQ (Cost of Poor Quality)
  - Refine Process Understanding
  - Determine Process Stability
  - Determine Process Capability.



#### Six Sigma Methodology: Measure Phase

#### Measure Phase Tools and Deliverables

- Process Maps, SIPOC, Value Stream Maps
- Failure Modes and Effects Analysis (FMEA)
- Cause-and-Effect Diagram
- XY Matrix
- Six Sigma Statistics
  - Basic Statistics
  - Descriptive Statistics
- Measurement Systems Analysis
  - Variable and/or Attribute Gage R&R
  - Gage Linearity and Accuracy or Stability
- Basic Control Charts
- Process Capability (Cpk, Ppk) and Sigma Levels
- Data Collection Plan



#### Six Sigma Methodology: Analyze Phase

- The **Analyze** phase is all about establishing verified drivers.
- In the DMAIC methodology, the Analyze phase uses statistics and higher-order analytics to discover relationships between process performance and process inputs (in other words, what are the root causes or drivers of the improvement effort).
- Ultimately, the Analyze phase establishes a reliable hypothesis for improvement solutions.
  - Establish the Transfer Function Y = f(x)
  - Validate the List of Critical x's and Impacts
  - Create a Beta Improvement Plan (e.g., pilot plan).



#### Six Sigma Methodology: Analyze Phase

#### Analyze Phase Tools and Deliverables

- The Analyze phase is about proving and validating critical x's using the appropriate and necessary analysis techniques. Examples include:
  - Hypothesis Testing
    - Parametric and Non-Parametric
  - Regression
    - Simple Linear Regression
    - Multiple Linear Regression
- The Analyze phase is also about establishing a set of solution hypotheses to be tested and further validated in the Improve phase.



### Six Sigma Methodology: Improve Phase

- The goal of the **Improve** phase is. . .you guessed it! "make the improvement." Improve is about designing, testing, and implementing your solution.
- To this point you have defined the problem and objective of the project, brainstormed possible x's, analyzed and verified critical x's. Now it's time to make it real!
  - Statistically Proven Results from Active Study/Pilot
  - Improvement/Implementation Plan
  - Updated Stakeholder Assessment
  - Revised Business Case with Return on Investment (ROI)
  - Risk Assessment/Updated FMEA
  - New Process Capability and Sigma.



## Six Sigma Methodology: Improve Phase

#### Improve Phase Tools and Deliverables

- Any Appropriate Tool from Previous Phases
- Design of Experiment (DOE)
  - Full Factorial
  - Fractional Factorial
- Pilot or Planned Study Using:
  - Hypothesis Testing
  - Valid Measurement Systems
- Implementation Plan



# Six Sigma Methodology: Control Phase

- The last of the 5 core phases of the DMAIC methodology is the **Control** phase.
- The goal of the Control phase is to establish automated and managed mechanisms to maintain and sustain your improvement.
- A successful control plan also establishes a reaction and mitigation plan as well as an accountability structure.



# Six Sigma Methodology: Control Phase

#### Control Phase Tools and Deliverables

- Statistical Process Control (SPC/Control Charts)
  - IMR, XbarS, XbarR, P, NP, U, C etc.
- Control Plan Documents
  - Control Plan
  - Training Plan
  - Communication Plan
  - Audit Checklist
- Lean Control Methods
  - Poka-Yoke
  - Five-S




• Kanban

39

 $\bigcirc$ 

## Six Sigma Methodology

#### Six Sigma DMAIC Roadmap

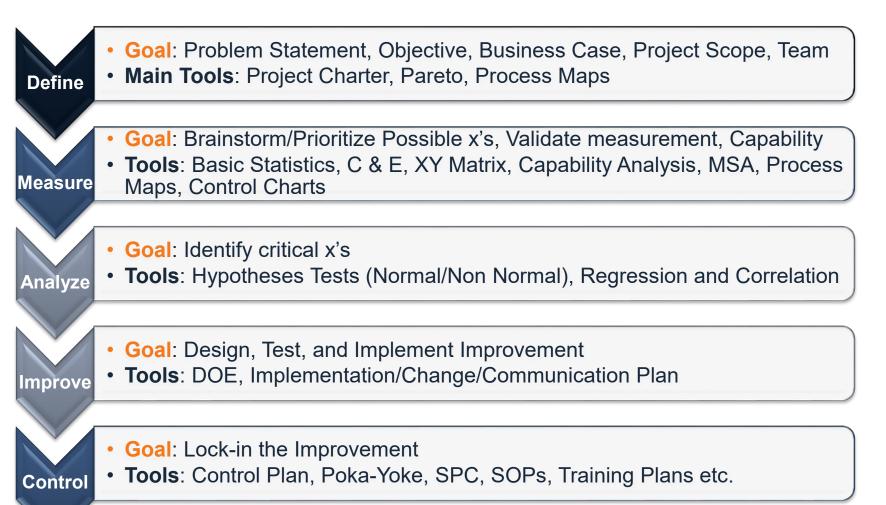



# 1.1.5 Roles and Responsibilities






#### **Roles and Responsibilities**

- The various roles in a Six Sigma program are commonly referred to as "Belts."
- In addition to Belts, there are also other key roles with specific responsibilities.
- Let us explore the different roles and their corresponding responsibilities in a Six Sigma program.



#### **Roles and Responsibilities**

- Each of the four Six Sigma belts represents a different level of expertise in the field of Six Sigma.
  - Six Sigma Master Black Belt (MBB)
  - Six Sigma Black Belt (BB)
  - Six Sigma Green Belt (GB)
  - Six Sigma Yellow Belt (YB)

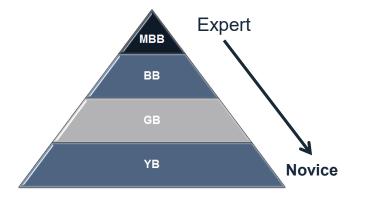

- In addition to Belts, there are other critical and complementary roles:
  - Champions
  - Sponsors
  - Stakeholders
  - Subject Matter Experts (SMEs).



#### Roles and Responsibilities: MBB

- The **Master Black Belt** (MBB) is the most experienced, educated, and capable Six Sigma expert.
- A typical MBB has managed dozens of Black Belt level projects.
- The MBB can simultaneously lead multiple Six Sigma Belt projects while mentoring and certifying Black Belt and Green Belt candidates.
- The MBB typically works with high-level operations directors, senior executives, and business managers to help with assessing and planning business strategies and tactics.



#### Roles and Responsibilities: MBB

 MBB commonly advises management team on the cost of poor quality of an operation and consults on methods to improve business performance.

#### Typical Responsibilities of a MBB

- Identifies and defines the portfolio of projects required to support a business strategy
- Establishes scope, goals, timelines, and milestones
- Assigns and marshals resources
- Trains and mentors Green Belts and Black Belts
- Facilitates tollgates or checkpoints for Belt candidates
- Reports-out/updates stakeholders and executives
- Establishes organization's Six Sigma strategy/roadmap
- Leads the implementation of Six Sigma.



#### Roles and Responsibilities: BB

- The **Black Belt** (BB) is the most active and valuable experienced Six Sigma professional among all the Six Sigma Belts.
- A typical BB has
  - led multiple projects
  - trained and mentored various Green Belts candidates
  - understood how to define a problem and drive effective solution.
- The BB is well rounded in terms of project management, statistical analysis, financial analysis, meeting facilitation, prioritization, and a range of other value-added capabilities, which makes a BB highly valuable asset in the business world.



### Roles and Responsibilities: BB

- BBs commonly serve as the dedicated resource continuing their line management role while simultaneously achieving a BB certification.
- Typical Responsibilities of a BB
  - Project Management
    - Defines projects, scope, teams etc.
    - Marshals resources
    - Establishes goals, timelines, and milestones
    - Provides reports and/or updates to stakeholders and executives.



### Roles and Responsibilities: BB

- Typical Responsibilities of a BB (continued)
  - Task Management
    - Establishes the team's Lean Sigma roadmap
    - Plans and implements the use of Lean Sigma tools
    - Facilitates project meetings
    - Does project management of the team's work
    - Manages progress toward objectives.
  - Team Management
    - Chooses or recommend team members
    - Defines ground rules for the project team
    - Coaches, mentors, and directs project team
    - Coaches other Six Sigma Belts
    - Manages the team's organizational interfaces.



#### Roles and Responsibilities: GB

- The **Green Belt** (GB) is considered as a less intense version of Six Sigma professional than the Black Belt (BB).
- A GB is exposed to all the comprehensive aspects of Six Sigma with less focus on the statistical theories and some other advanced analytical methodologies such as Design of Experiment (DOE).
- When it comes to project management, a GB has almost the same responsibilities as a BB.
- In general, the GB works on less complicated and challenging business problems than a BB.



## Roles and Responsibilities: GB

#### Typical Responsibilities of a Green Belt

- Project Management
  - Defines the project, scope, team etc.
  - Marshals resources
  - Sets goals, timelines, and milestones
  - Reports-out/updates stakeholders and executives.
- Task Management
  - Establishes the team's Lean Sigma Roadmap
  - Plans and implements the use of Lean Sigma tools
  - Facilitates project meetings
  - Does Project Management of the team's work
  - Manages progress toward objectives.
- Team Management
  - Chooses or recommends team members
  - Defines ground rules for the project team
  - Coaches, mentors, and directs project team
  - Coaches other Six Sigma Belts
  - Manages the team's organizational interfaces.

50

 $\odot$ 

#### Roles and Responsibilities: YB

- The **Yellow Belt** (YB) understands the basic objectives and methods of a Six Sigma project.
- YB has an elementary understanding about what other Six Sigma Belts (GB, BB, MBB) are doing to help them succeed.
- In a Six Sigma project, YB usually serves as a subject matter expert regarding some aspects of the process or project.
- Supervisors, managers, directors, and sometimes executives are usually trained at the YB level.



### Roles and Responsibilities: YB

- Typical Responsibilities of a Yellow Belt
  - Helps define process scope and parameters
  - Contributes to team selection process
  - Assists in information and data collection
  - Participates in experiential analysis sessions (FMEA, Process Mapping, Cause and Effect etc.)
  - Assists in assessing and developing solutions
  - Delivers solution implementations.



### Roles and Responsibilities: Champions & Sponsors

- Champions and sponsors are those individuals (directors, executives, managers etc.) chartering, funding, or driving the Six Sigma projects that BBs and GBs are conducting.
- Champions and sponsors need to have a basic understanding of the concepts, tools, and techniques involved in the DMAIC methodology so that they can provide proper support and direction.



#### Roles and Responsibilities: Champions & Sponsors

- Champions and sponsors play critical roles in the successful deployment of Six Sigma.
- Strong endorsement of Six Sigma from the leadership team is critical for success.
- Typical Responsibilities of a Champion/Sponsor
  - Maintains a strategic oversight
  - Establishes strategy and direction for a portfolio of projects
  - Clearly defines success
  - Provides resolution for issues such as resources or politics
  - Establishes routine tollgates or project reviews
  - Clears the path for solution implementation
  - Assists in project team formation.




#### Roles and Responsibilities: Stakeholders

- **Stakeholders** are usually the recipients or beneficiaries of the success of a Six Sigma project.
- Stakeholders are individuals owning the process, function, or production/service line that a Six Sigma Belt focuses on improving the performance of.
- BBs and GBs need to keep strong working relationships with stakeholders because without their support, it would be extremely difficult to make the Six Sigma project a success.



#### Roles and Responsibilities: SMEs

- Subject Matter Experts (SMEs) are commonly known as the experts of the process or subject matter.
- Six Sigma Belts should proactively look to key SMEs to round out their working project team.
- SMEs play critical roles to the success of a project.
  - Based on SMEs' extensive knowledge about the process, they have the experience to identify which solutions can work and which cannot work.
  - SMEs who simply do not speak up can hurt the chances of the process' success.
  - SMEs are also the same people who prefer to keep the status quo. Six Sigma Belts may find many of them unwilling to help implement the changes.

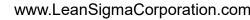

#### **Roles and Responsibilities**

- Throughout this module we have reviewed the various common roles and corresponding responsibilities in any Six Sigma program:
  - Six Sigma Master Black Belt
  - Six Sigma Black Belt
  - Six Sigma Green Belt
  - Six Sigma Yellow Belt
  - Champion and Sponsors
  - Stakeholders
  - Subject Matter Experts (SMEs)
- These Six Sigma belts and other roles are designed to deliver value to the business effectively and successfully.



www.LeanSigmaCorporation.com

# 1.2. Six Sigma Fundamentals



## Black Belt Training: Define Phase

#### 1.1 Six Sigma Overview

- 1.1.1 What is Six Sigma
- 1.1.2 Six Sigma History
- 1.1.3 Six Sigma Approach Y = f(x)
- 1.1.4 Six Sigma Methodology
- 1.1.5 Roles and Responsibilities

#### **1.2 Six Sigma Fundamentals**

1.2.1 Defining a Process1.2.2 VOC & CTQs1.2.3 QFD1.2.4 Cost of Poor Quality (COPQ)1.2.5 Pareto Analysis (80:20 rule)

1.3 Lean Six Sigma Projects

1.3.1 Six Sigma Metrics
1.3.2 Business Case and Charter
1.3.3 Project Team Selection
1.3.4 Project Risk Management
1.3.5 Project Planning

#### 1.4 Lean Fundamentals

1.4.1 Lean and Six Sigma1.4.2 History of Lean1.4.3 The Seven Deadly Muda1.4.4 Five-S (5S)



# 1.2.1 Defining a Process



## Defining a Process

- The basic method of defining and understanding a process is the **process map**.
- Process maps help determine where and how a process begins as well as all the steps and decisions in between.
- By learning the various types and methods of process maps, you can become adept at setting project scopes, identifying value-added and non-value-added steps, identifying problems in a process, etc.
- This module covers:
  - High-level process maps
  - Detailed process maps
  - Functional maps.
- In the Measure section we will touch on several other types and methods of process mapping.



#### What is a Process Map?

- A process map is a graphical representation of a process flow.
- It illustrates how the business process is accomplished step by step.
- It describes how the materials or information sequentially flow from one business entity to the next.
- It illustrates who is responsible for what between the process boundaries.
- It depicts the inputs and outputs of each individual process step.
- Always encourage your project team to map the current state of the process instead of the ideal state. Be honest with each other!



#### **Process Map Basic Symbols**

• The following four symbols are the most commonly used symbols in a process map.




*Terminator (Oval):* Shows the start and end points in the process.



*Process (Rectangle):* Indicates a single process step.



*Decision (Diamond):* Indicates a question with two choices (e.g. Yes/No)

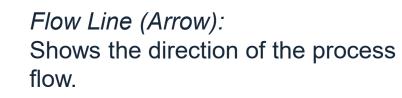



### **Additional Process Symbols**

• Additional Process Symbols:



#### Alternative Process:

Indicates a process step as an alternate of a normal step.



#### Predefined Process:

Indicates a formally-defined process step. Other documentation or instruction is needed to support further details of the step.



*Manual Operation:* Indicates a process step conducted manually.



*Preparation:* Indicates a preparation step.



*Delay:* Indicates a waiting period in the process.



## **Additional Process Symbols**


• Additional File and Information Related Symbols:



*Data (I/O):* Shows the inputs and outputs of a process.



*Document:* Indicates a process step that results in a document.

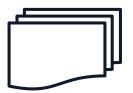

*Multi-Document:* Indicates a process step that results in multiple documents.



*Stored Data:* Indicates a process step that stores data.



*Magnetic Disk:* Indicates a database.

### **Additional Process Symbols**

• Additional Control of Flow Symbols:

*Off-Page Connector:* Indicates the process flow continues onto another page.



*Merge:* Indicates multiple processes merge into one.



*Extract:* Indicates a process splits into multiple parallel processes.



*Or:* Indicates a single data processing flow diverges to multiple branches with different criteria requirements.



Summing Junction: Indicates multiple data processing flows converge into one.



- Step 1: Define the boundaries of the process you want to map.
  - A process map can depict the flow of an entire process or a segment of it.
  - You need to identify and define the beginning and ending points of the process before starting to plot.
  - Use operational definitions where possible.




- Step 2: Define and sort the process steps with the flow.
  - Consult with process owners and SMEs or observe the process in action to understand how the process is actually performed.
  - Record the process steps and sort them according to the order of their occurrence.



- Step 3: Fill the step information into the appropriate process symbols and plot the diagram.
  - In the team meeting of process mapping, place the sticky notes with different colors on a white board so you can move them around while the map is under-construction.
  - The flow lines can be plotted directly on the white board.
  - Decision steps. Rotate the sticky note 45 degrees.
  - When the map is completed on the white board, record the map using Excel, PowerPoint, Visio, Quality Companion, or other preferred software.



- Step 3:
  - To illustrate the responsibility of different organizations involved in the process, use a Swim Lane Process Map.

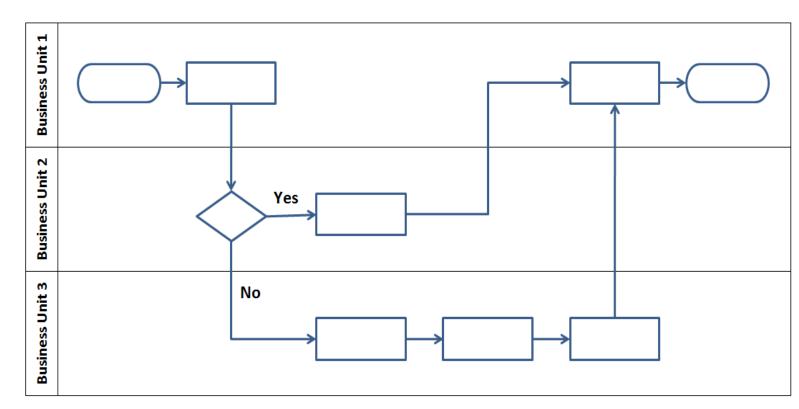



- Step 4: Identify and record inputs/outputs and their corresponding specifications for each process step.
  - The process map helps in understanding and documenting Y = f(x) of a process, where Y represents the outputs and x represents the inputs.
  - The inputs of each process step can be controllable or non-controllable, standardized operational procedures, or noise.
  - Inputs are the source of variation in the process and need to be analyzed qualitatively and quantitatively.
  - The outputs of each process step can be products, information, services, etc. They are the little Y's within the process.




- Step 5: Evaluate the process map and adjust if needed.
  - If the process is too complicated to be covered in one single process map, you may create additional detailed sub-process maps for further information.
  - Number the process steps in the order of their occurrence for clarity.



# High Level Process Map

- Most high-level process maps are also referred to as flow charts.
- The key to a high-level process map is to over-simplify the process being depicted so that it can be understood in its most generic form.
- As a general rule, high-level process maps should be no more than 4– 6 steps.
- Below is an oversimplified version of a high-level process map for cooking a 10lb prime rib for a dozen holiday guests.

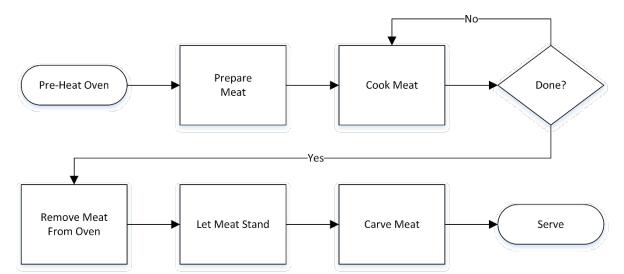




#### **Detailed Process Map**

- Detailed process maps or multi-level maps take the high-level map much further.
- Detailed maps can be 2–4 levels deeper than your high-level process map.
- A good guideline used to help create the second level is to take each step in the high level map and break it down into 2–4 steps (no more).
- Repeat this process (level 3, level 4 etc.) until reaching the desired level of detail.
- Some detailed maps are 2 or 3 levels deep, others can be 5–6 levels deep. Obviously, the deeper the levels, the more complex and the more burdensome.



### **Detailed Process Map**

- At right is our prime rib cooking example at level 2 detail.
- This process map has a few more decision points and process steps.
- You can see that going only one more level deep adds a fair amount of information to the process map.

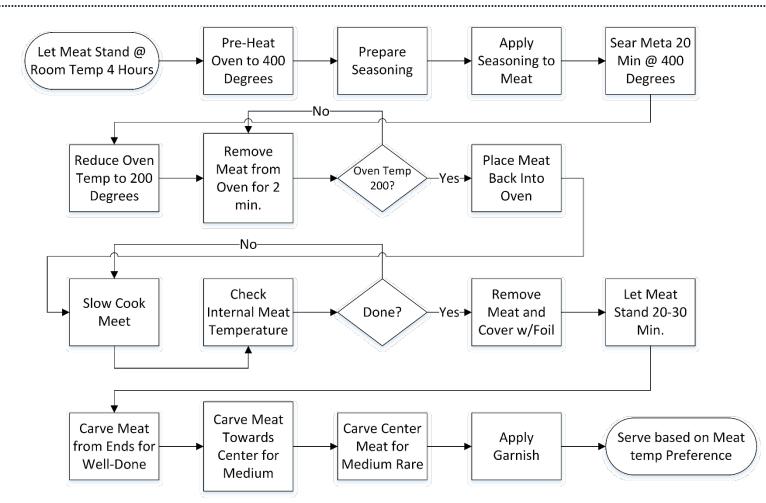




 $\bigcirc$ 

#### **Functional Process Map**


- The functional map adds dimension to the high-level or detailed map.
- The dimension added is identifying which function or job performs the step or makes the decision.
- Below is a generic example of a functional map. Note that functions are identified in horizontal lanes and each process step is placed in the appropriate lane based on which function performs the step.

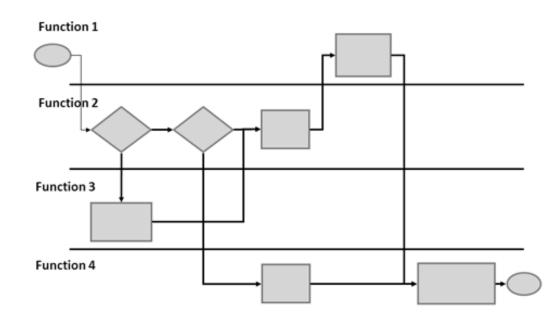







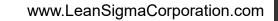

#### Voice of the Customer

- VOC stands for "Voice of the Customer."
- Voice of the customer is a term used for a data-driven plan to discover customer wants and needs.
- VOC is an important component to a successful Six Sigma project.
- There are also other "Voices" that need to be heard when conducting projects. The 3 primary forms are:
  - VOC: Voice of the Customer
  - VOB: Voice of the Business
  - VOA: Voice of the Associate.





# Gathering VOC

- Gathering VOC should be performed methodically.
- The two most popular methods of collecting VOC are
  - 1. Indirect
  - 2. Direct.
- Indirect data collection for VOC involves passive information exchange:
  - Warranty claims
  - Customer complaints/compliments
  - Service calls
  - Sales reports.
- 2. Indirect methods are less effective, sometimes dated, require heavy interpretation, and are also more difficult to confirm.






# Gathering VOC

- Direct data collection methods for VOC are active and planned customer engagements:
  - Conducting interviews
  - Conducting customer surveys
  - Conducting market research
  - Hosting focus groups.
- Direct methods are typically more effective for several reasons:
  - Less need to interpret meaning
  - Researchers can go a little deeper when interacting with customers
  - Customers are aware of their participation and will respond better upon follow-up
  - Researchers can properly plan engagements (questions, sample size, information collection techniques etc.).



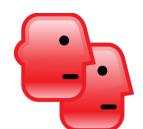

# Gathering VOC

- Gathering VOC requires consideration of many factors such as product or services types, customer segments, manufacturing methods or facilities etc.
- All this information will influence the sampling strategy.
- Consider which factors are important and build a sample size plan around them.
- Also, consider response rates and adjust the initial sample strategy to ensure adequate input is received.
- Once a sampling plan is in place, collect data via the direct and indirect methods discussed earlier.
- After gathering VOC it will be necessary to translate it into something meaningful: CTQs.



# Critical to Quality: CTQ


- **CTQ** stands for Critical to Quality.
- CTQs are translated from VOC or "voice of the customer" feedback.
- VOC is often vague, emotional, or simply a generalization about products or services.
- CTQs are the quantifiable, measureable, and meaningful translations of VOC.
- Organizing VOC helps to identify CTQs.
- One effective way to organize VOC is to group or bucket it using an affinity diagram.
- Affinity diagrams are ideal for large amounts of soft data resulting from brainstorming sessions or surveys.



- Steps for conducting an Affinity Diagram exercise:
  - Step 1: Clearly define the question or focus of the exercise ("Why are associates late for work?").
  - Step 2: Record all participant responses on note cards or sticky notes (this is the sloppy part, record everything!).
  - Step 3: Lay out all note cards or post the sticky notes onto a wall.
  - Step 4: Look for and identify common themes.
  - Step 5: Begin moving the note cards or sticky notes into the themes until all responses are allocated.
  - Step 6: Re-evaluate and make adjustments.




- Define the question or focus
- Record responses on note cards or sticky notes
- Display all note cards or sticky notes on a wall if necessary.

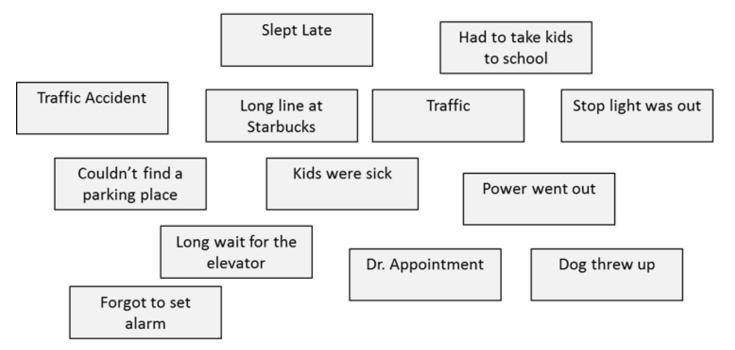

Why are Associates late to work?



• Look for and identify common themes within the responses.

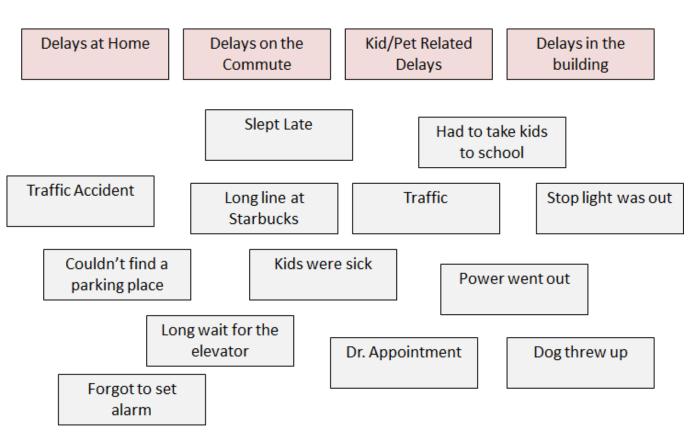


#### Why are Associates late to work?




- Group note cards or sticky notes into themes until all responses are allocated.
- Re-evaluate and make final adjustments.

Why are Associates late to work?

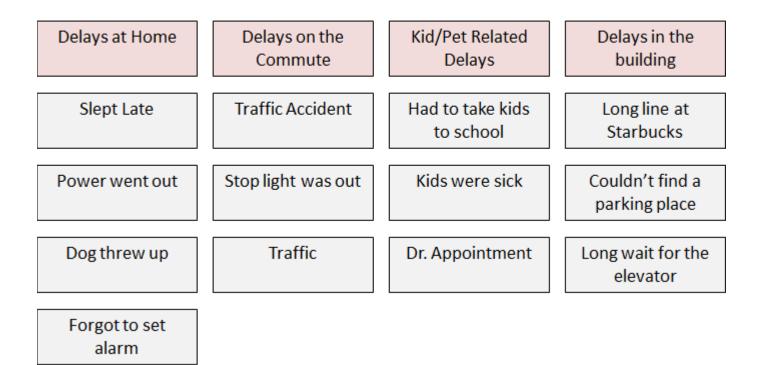




• Example of a generic CTQ tree transposed from a white board to a software package.

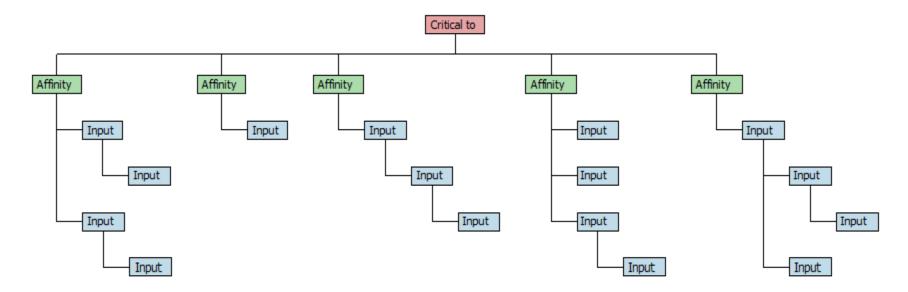



 $\odot$ 

- Another VOC categorization technique is the Kano.
- The Kano model was developed by Noriaki Kano in the 1980s.
- The Kano model is a graphic tool that further categorizes VOC and CTQs into 3 distinct groups:
  - Must Haves
  - Performance Attributes
  - Delighters.

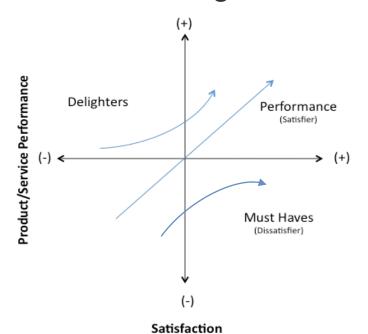

• The Kano helps to identify CTQs that add incremental value vs. those that are simply requirements and having more is not necessarily better.



# Validating VOC and CTQs


- After determining all CTQs, confirm them with the customer.
- Confirming can be accomplished by conducting surveys through one or more of the following methods:
  - Group sessions
  - One-on-one meetings
  - Phone interviews
  - Electronic means (chat, email, social media etc.)
  - Physical mail.
- Consider your confirming audience and try to avoid factors that may influence or bias responses such as inconvenience or overly burdensome time commitments.





# Translating CTQs to Requirements

- Lastly, CTQs must be transformed into **specifics** that can be built upon in a process.
- A **requirements tree** translates CTQs to meaningful and measureable requirements for production processes and products.

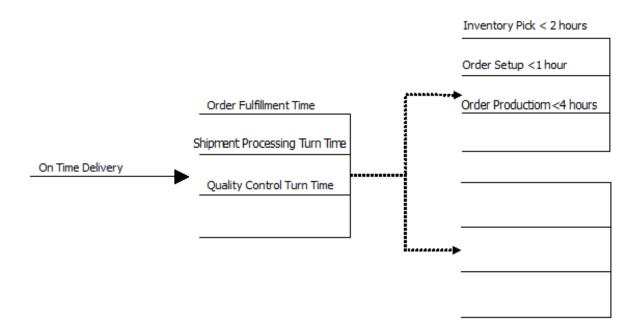



91

# 1.2.3 Quality Function Deployment



# History of QFD

- Developed by Shigeru Mizuno (1910–1989) and Yoji Akao (b. 1928) in Japan. Quality Function Deployment (QFD) aims to design products that assure customer satisfaction and value – the first time and every time.
- The QFD framework can be used for translating actual customer statements and needs ("The voice of the customer") into actions and designs to build and deliver a quality product.



# What is QFD?

- Quality Function Deployment (QFD) is a construction methodology and quantification tool used to identify and measure customer's requirements and transform them into meaningful and measureable parameters.
- QFD helps to prioritize actions to advance process or product to meet customer's anticipations.
- QFD is an excellent tool for contact between cross-functional groups.



# Purpose of QFD

The quality function deployment has many purposes. Among the most important are:

- Market analysis to establish needs and expectations
- Examination of competitors' abilities
- Identification of key factors for success
- Translation of key factors into product and process characteristics.



#### Phases of QFD

Four Key Phases of QFD

- Phase I: Product Planning Including the "House of Quality" (Requirements Engineering Life Cycle)
- Phase II: Product Design (Design Life Cycles)
- Phase III: Process Planning (Implementation Life Cycle)
- Phase IV: Process Control (Testing Life Cycle)



# How to build a House of Quality

- Determine Customer Requirements (What's from VOC/CTQ)
- Technical Specifications/Design Requirements (How's)
- Develop Relationship Matrix (What's and How's)
- Prioritize Customer Requirements
- Conduct Competitive Assessments
- Develop Interrelationship (How's)
- Prioritize Design Requirements



#### House of Quality


	Correlation Matrix [How's vs. How's]		
	Technical Specifications [How's]	Why's	
Customer Requirements [What's]	Relationship Matrix [What's vs. How's]	Customer Importance Rating	Customer Market Evaluation [What's vs. Why's]
How Much's	Degree of Technical Difficulty Overall Importance Ratings Technical Competitive Evaluations Target Goals		



# Step 1: Determine Customer Requirements

- Identify the important customer requirements. These are the "What's" and are typically determined through the VOC/CTQ process.
- Use the results from your requirements tree diagram as inputs for the customer requirements in your HOQ.




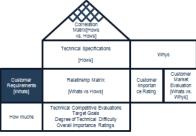




# Step 2: Technical Specification

- Potential choices for product features
- Voice of Designers or Engineers
- Each "What" item must be refined to "How's"

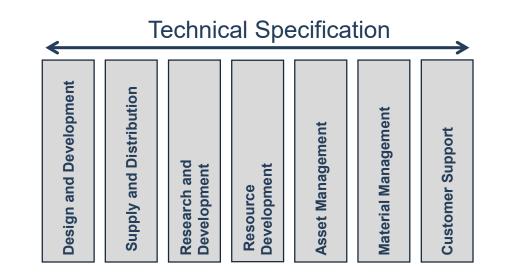


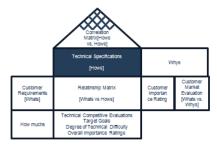




#### Step 3: Develop Relationship Matrix (What's & How's)

• This is the center portion of the house. Each cell represents how each technical specification relates to each customer requirement.

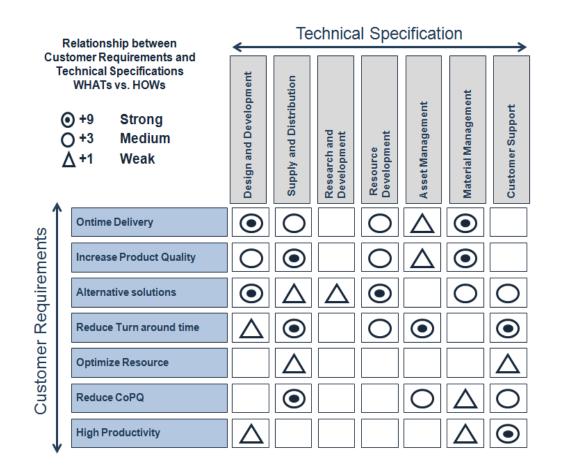


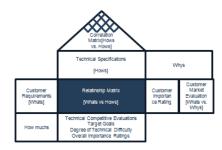



# Step 4: Prioritize Customer Requirements

 This is the right portion of the house. Each cell represents customer requirements based on relative importance to customers and perceptions of competitive performance.

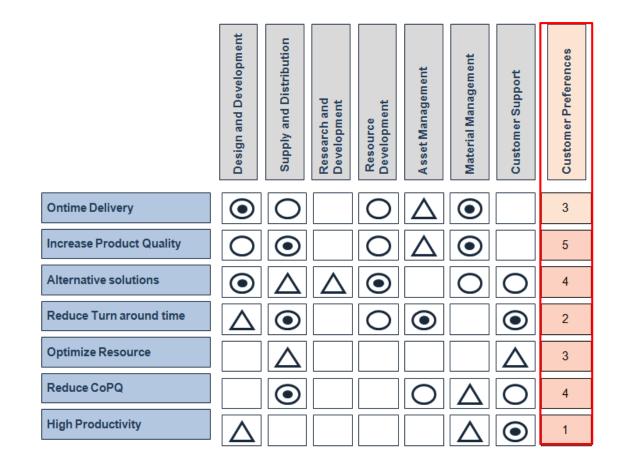







#### Step 5: Competitive Assessments

• This is the extreme right portion of the house. Comparison of the organization's product to competitors' products.

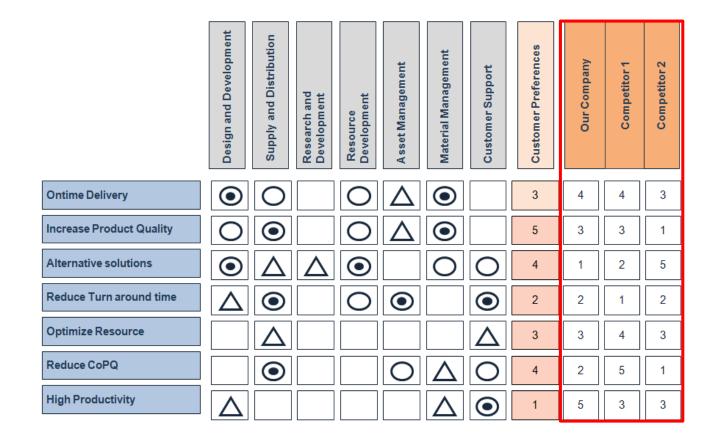


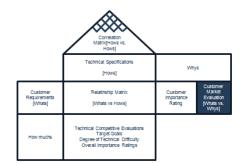



# **Step 6: Correlation Matrix**

• This is the top portion of the house. It identifies the way "how" items either support (positive) or conflict (negative) with one another.

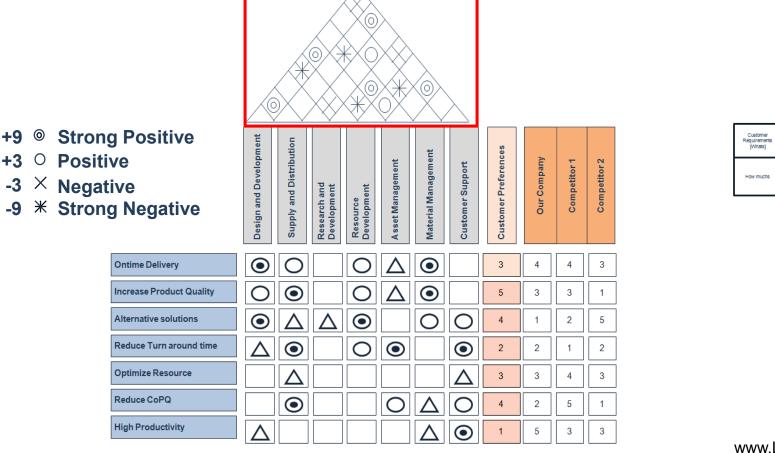



103

Technical Specifications

[Hows]

Relatinship Matri:

Whats vs Hows'

echnical Competitive Evaluation Target Goals Degree of Technical Difficulty

Overall Importance Ratings

Whys


Customer Importance Rating Market


Evaluation

[Whats vs. Whys]

# Step 7: Prioritize Design Requirements

- Overall Importance Ratings
- Function of relationship ratings and customer prioritization ratings
- Technical Difficulty Assessment
- Similar to customer market competitive evaluations but conducted by the technical team

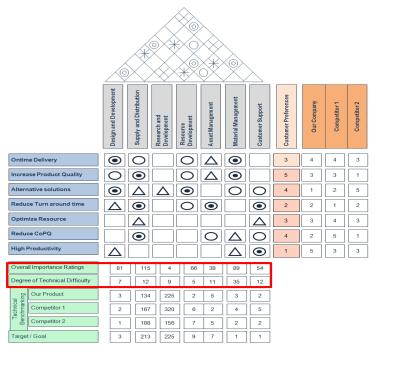


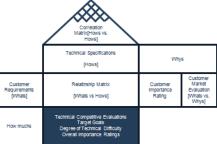




# Step 7: Prioritize Design Requirements

- Technical Specification Competitive Evaluation
- Helps to establish the feasibility and realization of each "how" item
- Target Goals
- How much is good enough to satisfy the customer

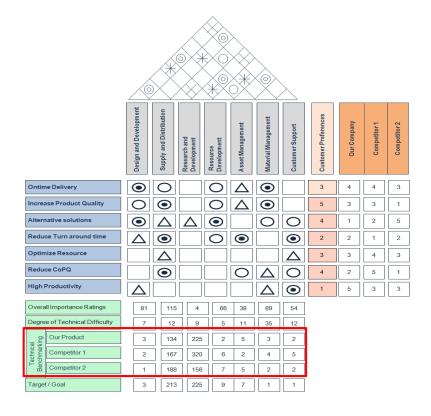


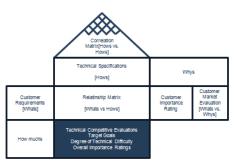



www.LeanSigmaCorporation.com

#### House of Quality

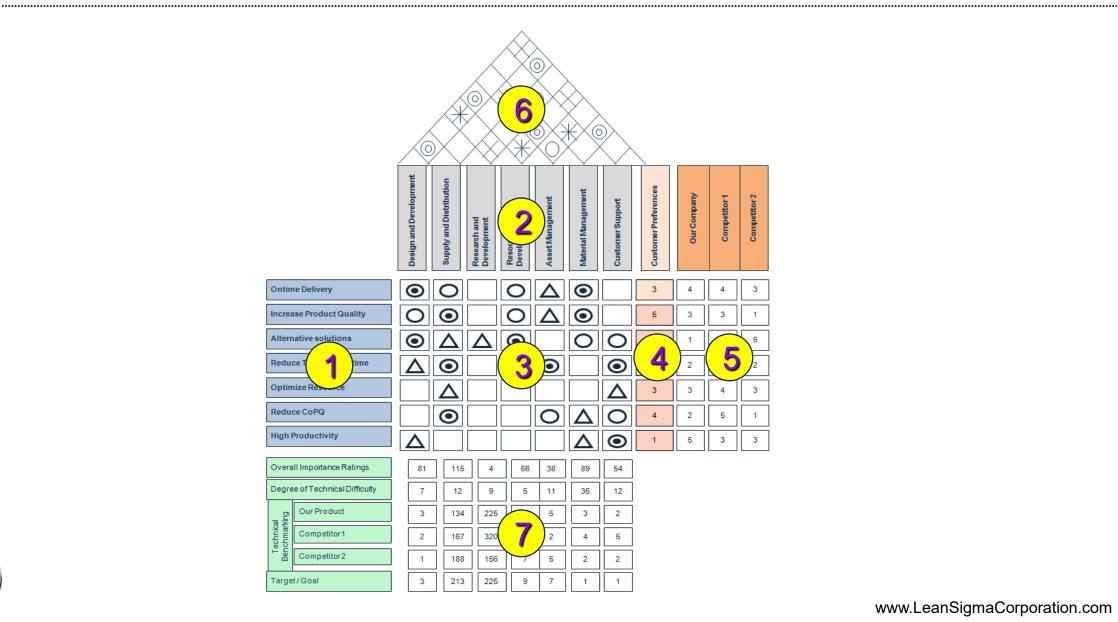



Lean Sigma Corporation Lean Six Sigma Training - JMP

 $\bigcirc$ 

# Pros of QFD

- Focuses the design of the product or process on satisfying customer's needs and wants.
- Improves the contact channels between customers, advertising, research and improvement, quality and production departments, which sustains better decision making.
- Reduces the new product development project period and cost.





- The relationship matrix can be too obscure with many process inputs and/or many customer constraints.
- It can be very complicated and difficult to implement without experience.
- If throughout the process new ideas, specifications, or requirements are not discovered, you run the risk of losing team members' trust in the process.



## **QFD** Summary

When used properly, the quality function deployment is an extremely valuable approach to product/process design.

There are many benefits of QFD that can only be realized when each step of the process is completed thoroughly:

- Logical way of obtaining information and presenting it
- Smallest product development cycle
- Considerably condensed start-up costs
- Fewer engineering alterations
- Reduced chance of supervision during design process
- Collaborating environment
- Preserving everything in characters.



110

# 1.2.4 Cost of Poor Quality



#### **Cost of Poor Quality**



- **Cost of Poor Quality** (COPQ) is the expense incurred due to waste, inefficiencies, and defects.
- The COPQ has been proven to range from 5% to 30% of gross sales for most companies.
- The COPQ can be staggering when considering process inefficiencies, hidden factories, defective products, rework, scrap, etc.
- Understanding COPQ and where to look for it will help uncover process inefficiencies, defects, and hidden factories within your business.



## Cost of Poor Quality

- There are 7 common forms of waste that are often referred to as the "7 deadly muda."
- Technically, there are more than 7 forms of waste but if you can remember these you will capture over 90% of your waste.
  - 1. Defects
  - 2. Overproduction
  - 3. Over-Processing
  - 4. Inventory
  - 5. Motion
  - 6. Transportation
  - 7. Waiting





## Cost of Poor Quality

- The "7 deadly muda" are very important to understand. They are the best way to identify the COPQ.
- The presence of any muda causes many other forms of inefficiencies and hidden factories to manifest themselves.
- There are four key categories of costs related to muda:
  - 1. Costs Related to Production
  - 2. Costs Related to Prevention
  - 3. Costs Related to Detection
  - 4. Costs Related to Obligation





#### **COPQ: Costs Related to Production**

- Costs related to production are the direct costs of the presence of muda. These forms of COPQ are usually understood and easily observable. They are in fact the "7 deadly muda" themselves.
  - 1. Defects
  - 2. Overproduction
  - 3. Over-Processing
  - 4. Inventory
  - 5. Motion
  - 6. Transportation
  - 7. Waiting



## **COPQ: Costs Related to Prevention**

- Costs related to the prevention of muda are those associated with trying to reduce or eliminate any of the "7 deadly muda."
  - Costs for error proofing methods or devices
  - Costs for process improvement and quality programs
  - Costs for training and certifications
  - etc.
- *Any costs* directly associated with the prevention of waste and defects should be included in the COPQ calculation.



115

#### **COPQ: Costs Related to Detection**

- Costs related to the detection of muda are those associated with trying to find or observe any of the "7 deadly muda."
  - Costs for sampling
  - Costs for quality control check points
  - Costs for inspection costs
  - Costs for cycle counts or inventory accuracy inspections
  - etc.
- Any costs directly associated with the detection of waste and defects should be included in the COPQ calculation.



## **COPQ: Costs Related to Obligation**

- Costs related to **obligation** are those associated with addressing the muda that reaches a customer.
  - Repair costs
  - Warranty costs
  - Replacement costs
  - Customer returns and customer service overhead
  - etc.
- Any costs directly associated with customer obligations should be included in the COPQ calculation.



www.LeanSigmaCorporation.com

## **COPQ:** Types of Cost

- There are two types of costs to be considered when determining COPQ
  - 1. Hard Costs
    - Tangible costs that can be traced to the income statement
  - 2. Soft Costs
    - Intangible costs: avoidance, opportunity costs, lost revenue etc.
- Calculating the COPQ
  - 1. Determine the types of waste that are present in your process
  - 2. Estimate the frequency of waste that occurs
  - 3. Estimate the cost per event, item, or time frame
  - 4. Do the math.



# 1.2.5 Pareto Charts and Analysis



#### Pareto Principle

- The **Pareto principle** is commonly known as the "law of the vital few" or "80:20 rule."
- It means that the majority (approximately 80%) of effects come from a few (approximately 20%) of the causes.
- This principle was first introduced in early 1900s and has been applied as a rule of thumb in various areas.
- Example of applying the Pareto principle:
  - 80% of the defects of a process come from 20% of the causes.
  - 80% of sales come from 20% of customers.



#### Pareto Principle

- The Pareto principle helps us to focus on the vital few items that have the most significant impact.
- In concept, it also helps us to prioritize potential improvement efforts.
- Since this 80:20 rule was originally based upon the works of Wilfried Fritz Pareto (or Vilfredo Pareto), the Pareto principle and references to it should be capitalized because Pareto refers to a person (proper noun).
  - Mr. Pareto is also credited for many works associated with the 80:20, some more loosely than others:
    - Pareto's Law
    - Pareto efficiency
    - Pareto distribution etc.



#### **Pareto Charts**

• A **Pareto chart** is a chart of descending bars with an ascending cumulative line on the top.

#### • Sum or Count:

The descending bars on a Pareto chart may be set on a scale that represents the total of all bars or relative to the biggest bucket, depending on the software you are using.

- **Percent to Total**: A Pareto chart shows the percentage to the total for individual bars.
- **Cumulative Percentage**: A Pareto chart also shows the cumulative percentage of each additional bar. The data points of all cumulative percentages are connected into an ascending line on the top of all bars.



#### Pareto Charts


- Case study time!
  - Next we will use JMP to run Pareto charts on exactly the same data set.
  - Open the JMP data file labeled Pareto and follow the instructions over the next few pages to run Pareto charts in JMP.



#### Create a Pareto Chart in JMP

- Steps to generate a Pareto chart using JMP:
  - 1. Open the data file "Pareto.jmp"
  - 2. Click Analyze  $\rightarrow$  Quality & Process  $\rightarrow$  Pareto Plot.
  - 3. In the new window, select "Count" as "Frequency"
  - 4. Select "Category" as "Y, cause.
  - 5. "Click "OK."
  - 6. The Pareto chart is created in a newly-generated window.



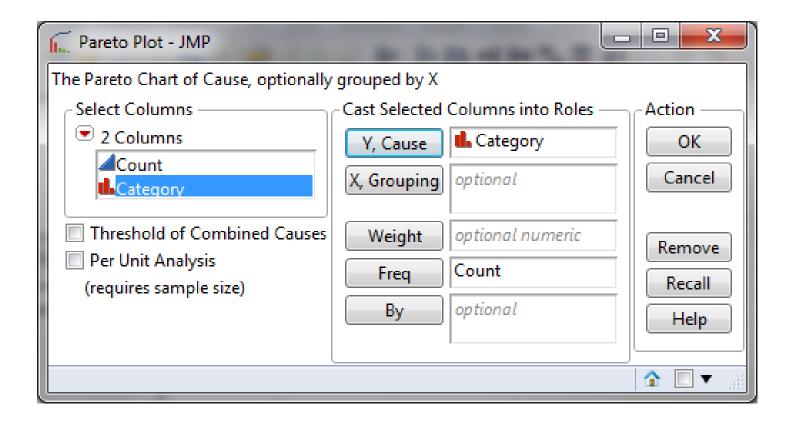




 $\odot$ 

www.LeanSigmaCorporation.com

#### Create a Pareto Chart in JMP

- The Pareto chart generated in JMP presents the count of defective products by team.
- The bars are descending on a scale with the peak at 45, which is approximately the total count of all defective products for all teams.
- The cumulative percentages are the red data points driving the red line that spans across the graphic.

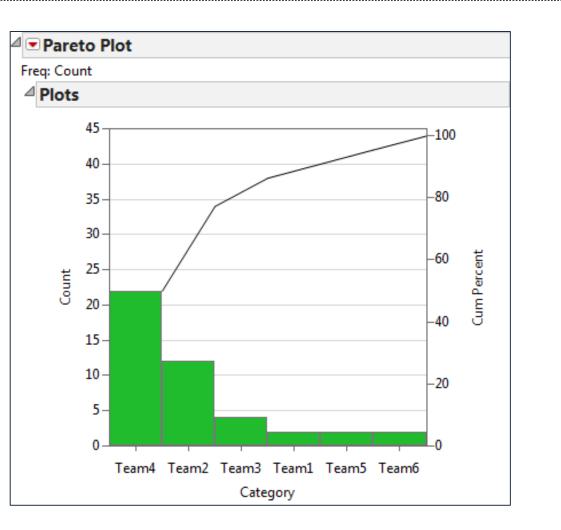




#### Pareto Analysis

- The **Pareto analysis** is used to identify the root causes by using multiple Pareto charts.
- In Pareto analysis, we drill down into the bigger buckets of defects and identify the root causes of defects that contribute heavily to total defects.
- This "drill down" approach effectively solves a significant portion of the problem.
- Next you will see an example of three-level Pareto analysis.
  - The second-level Pareto is a Pareto chart that is a subset of the tallest bar on the first Pareto.
  - The third-level Pareto is a subset of the tallest bar of the second-level Pareto.



#### Pareto Analysis: First Level


- First-level Pareto
- Shows the count of defective items by team
- Next level will only show the defective items of team 4

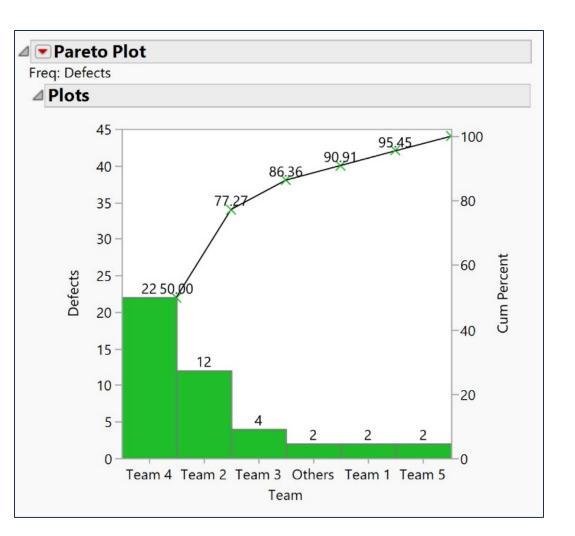



#### Pareto Analysis: Second Level


- Second-level Pareto
- Shows the count of the defective items by section for only team 4
- Next level will only show the defective items of section 3

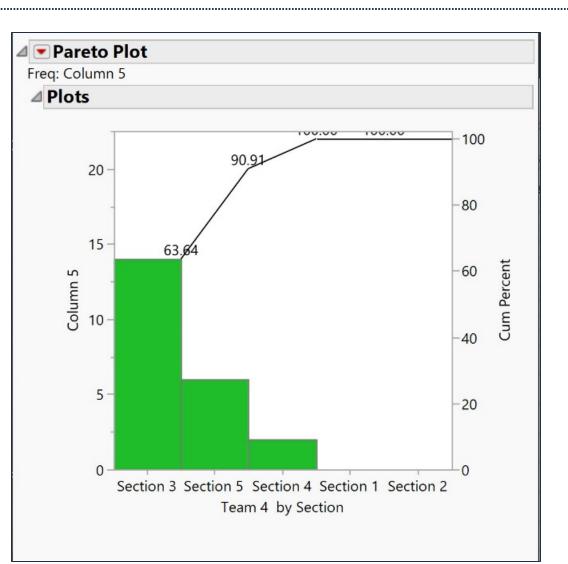



## Pareto Analysis: Third Level

- Third-level Pareto
- Shows the count of defective items by associate for only section 3 of team 4
- Next level will only show the defective items of Dave

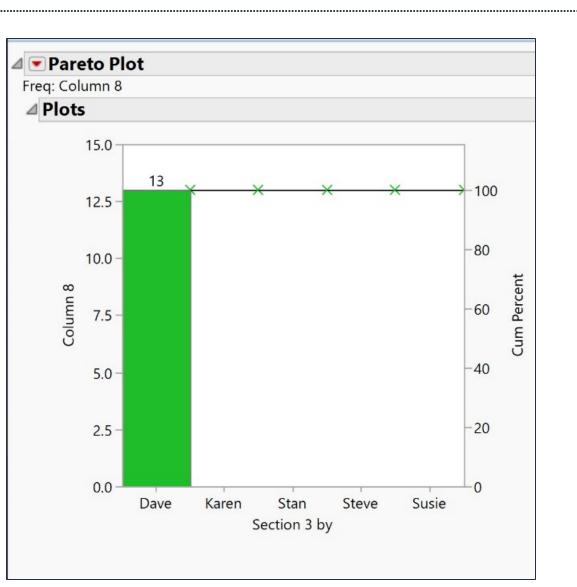




Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

#### Pareto Analysis: Conclusion

- After drilling down three levels we find that most of the defective products are from Dave who is in Section 3 of Team 4.
- Determining what Dave might be doing differently and solving that problem can potentially fix about 30% of the entire defective products (13/44).

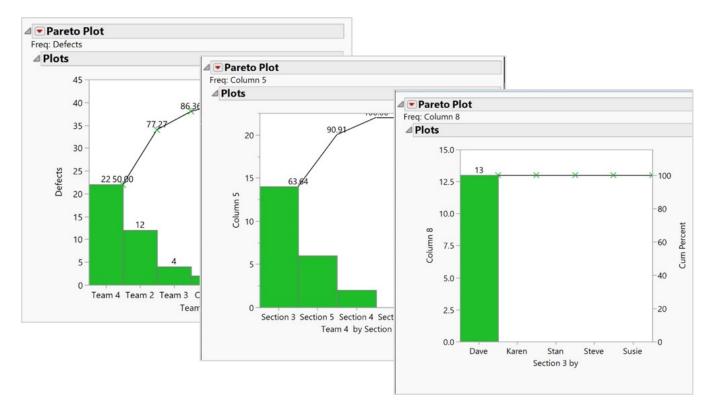



# 1.3 Six Sigma Projects



## Black Belt Training: Define Phase

#### 1.1 Six Sigma Overview

- 1.1.1 What is Six Sigma
- 1.1.2 Six Sigma History
- 1.1.3 Six Sigma Approach Y = f(x)
- 1.1.4 Six Sigma Methodology
- 1.1.5 Roles and Responsibilities

#### **1.2 Six Sigma Fundamentals**

- 1.2.1 Defining a Process1.2.2 VOC and CTQs1.2.3 QFD1.2.4 Cost of Poor Quality (COPQ)
- 1.2.5 Pareto Analysis (80:20 rule)

#### 1.3 Lean Six Sigma Projects

- 1.3.1 Six Sigma Metrics1.3.2 Business Case and Charter1.3.3 Project Team Selection1.3.4 Project Risk Management1.3.5 Project Planning
- 1.4 Lean Fundamentals1.4.1 Lean and Six Sigma1.4.2 History of Lean1.4.3 The Seven Deadly Muda1.4.4 Five-S (5S)



# 1.3.1 Six Sigma Metrics



#### Six Sigma Metrics

- There are many Six Sigma metrics and/or measures of performance used by Six Sigma practitioners.
- In addition to the ones we will cover here, several others (Sigma level, Cp, Cpk, Pp, Ppk, takt time, cycle time, utilization etc.) will be covered in other modules throughout this training.
- The Six Sigma metrics of interest here in the **define phase** are:
  - Defects per Unit (DPU)
  - Defects per Million Opportunities (DPMO)
  - Yield (Y)
  - Rolled Throughput Yield (RTY).



#### Defects per Unit: DPU

- DPU stands for "Defects per Unit"
- DPU is the basis for calculating DPMO and RTY, which we will cover in the next few pages.
- DPU is found by dividing total defects by total units.

• *DPU* = *D/U* 

• For example, if you have a process step that produces an average of 65 defects for every 598 units, then your DPU = 65/598 = 0.109.



- **DPMO** is one of the few important Six Sigma metrics that you should get comfortable with if you are associated with Six Sigma.
- In order to understand DPMO it is best if you first understand both the nomenclature and the nuances such as the difference between defect and defective.
- Nomenclature
  - Defects = D
  - Unit = U
  - Opportunity to have a defect = O



- In order to properly discuss DPMO, we must first explore the differences between "defects" and "defective."
  - Defective
    - Defective suggests that the value or function of the entire unit or product has been compromised.
    - Defective items will always have at least one defect. Typically, however, it takes multiple defects and/or critical defects to cause an item to be defective.

#### Defect

- A defect is an error, mistake, flaw, fault, or some type of imperfection that reduces the value of a product or unit.
- A single defect may or may not render the product or unit "defective" depending on the specifications of the customer.

#### Summary

- Defect means that part of a unit is bad.
- Defective means that the whole unit is bad.



• Now let us turn our attention to defining "opportunities" so that we can fully understand Defects per Million Opportunities (DPMO).

#### Opportunities

- Opportunities are the total number of possible defects.
- Therefore, if a unit has 6 possible defects, then each unit produced is equal to 6 defect opportunities.
- If we produce 100 units, then there are 600 defect opportunities.



- Calculating Defects per Million Opportunities
- The equation is DPMO = (D/(U × O)) × 1,000,000
- Example: Let us assume:
  - There are 6 defect opportunities per unit
  - There are an average of 4 defects every 100 units.
  - Opportunities = 6 × 100 = 600
  - Defect rate = 4/600
  - DPMO = 4/600 × 1,000,000 = 6,667



- What is the reason or significance of 1,000,000?
- Converting defect rates to a per million value becomes necessary when the performance of your process approaches Six Sigma.
- When this happens, the number of defects shrinks to virtually nothing. In fact, if you recall from the "What is Six Sigma" module, sigma is 3.4 defects per million opportunities.
- By using 1,000,000 opportunities as the barometer we have the resolution in the measurement to count defects all the way up to Six Sigma.



142

#### RTY: Rolled Throughput Yield

- Rolled Throughput Yield (RTY) is a process performance measure that provides insight into the cumulative effects of an entire process.
- RTY measures the yield for each of several process steps and provides the probability that a unit will come through that process defect-free.
- RTY allows us to expose the "hidden factory" by providing visibility into the yield of each process step.
- This helps us identify the poorest performing process steps and gives us clues into where to look to find the most impactful process improvement opportunities.



#### RTY: Rolled Throughput Yield

- Calculating RTY:
- RTY is found by multiplying the yields of each process step.
- Let us take the 5-step process below and calculate the RTY using the multiplication method mentioned above.

$$Y_1 = 0.90 \longrightarrow Y_2 = 0.91 \longrightarrow Y_3 = 0.99 \longrightarrow Y_4 = 0.98 \longrightarrow Y_5 = 0.97$$

- The calculation is: RTY = 0.90 × 0.91 × 0.99 × 0.98 × 0.97 = 0.77
- Therefore, RTY = 77%.



### RTY: Rolled Throughput Yield

- You may have noticed that in order to calculate RTY we must determine the yield for each process step.
- Before we get into calculating yield, there are a few abbreviations that need to be declared.
  - Abbreviations
    - Defects = D
    - Unit = **U**
    - Defects per Unit = DPU
    - Yield =  $\mathbf{Y}$
    - e = 2.71828 (mathematical constant)



## RTY: Rolled Throughput Yield

- Calculating Yield
- The **Yield** of a process step is the success rate of that step or the probability that the process step produces no defects.
- In order to calculate the yield, we need to know the DPU and then we can apply it to the yield equation below.


$$Yield = e^{-dpu}$$

- Example
  - Let us assume a process step has a DPU of 0.109 (65/598)



• Yield = 2.718 ^ -0.109 = 0.8967. Rounded, Yield = 90%.

### RTY: Rolled Throughput Yield

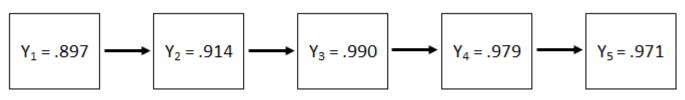

- Below is a table using the above process yield data that we used in the earlier RTY calculation.
- This table allows us to see the DPU and yield of each step as well as the RTY for the whole process.

Process Step	Defects	Units	DPU	Yield	RTY
1	65	598	0.109	0.897	90%
2	48	533	0.090	0.914	82%
3	5	485	0.010	0.990	81%
4	10	480	0.021	0.979	79%
5	14	471	0.030	0.971	77%



### RTY: Using an Estimate of Yield

- Calculating RTY using Yield estimation
  - It is possible to "estimate" yield by taking the inverse of DPU or simply subtracting DPU from 1.
  - Yield Estimation = 1 DPU
    - Example Yield Estimate for process step 1: 1 0.10870 = 0.90
  - RTY using the Yield Estimation Method
    - RTY = 0.891 × 0.91 × 0.99 × 0.979 × 0.97 = 0.76 = 76%

Process Step	Defects	Units	DPU	<b>Yield</b> estimate	<b>RTY</b> <sub>estimate</sub>
1	65	598	0.109	0.891	89%
2	48	533	0.090	0.910	81%
3	5	485	0.010	0.990	80%
4	10	480	0.021	0.979	79%
5	14	471	0.030	0.970	76%

**NOTE**: This method assumes max DPU is 1. Although this is not technically true, in practice its extremely rare to find processes with DPU greater than 1. If it is the case this method will not work.



147

# RTY: Using First Time Yield (FTY)

- In the previous discussion we calculated RTY using Yields calculated based on "**Defects**" per unit. What if we're counting "**Defectives**"?
  - First Time Yield (FTY) is the probability of producing a product or service defect free before rework

• FTY = # Non-Defective Units Produced Before Rework

# Units Inspected

- FTY is also a good measure of process performance. It accounts for the hidden factory or rework in the process. Its simply based on defective units instead of defects per unit.
  - You can still calculate RTY using First Time Yield:
  - RTY=  $FTY_1 * FTY_2 * FTY_3 * FTY_4 * FTY_5$



# 1.3.2 Business Case and Charter



### **Business Case and Project Charter**

- Earlier we stated that DMAIC is a structured and rigorous methodology designed to be repeatedly applied to <u>any</u> process in order to achieve Six Sigma.
- We also stated that DMAIC was a methodology that refers to 5 phases of a project.
  - Define, Measure, Analyze, Improve, and Control
- Given that the premise of the DMAIC methodology is project-based, we must take the necessary steps to define and initiate a project, hence the need for. . .
  - Project Charters



### **Project Charter**


- The purpose of a **project charter** is to provide vital information about a project in a quick and easy-to-comprehend manner.
- Project charters are used to get approval and buy-in for projects and initiatives as well as declaring:
  - The scope of work
  - Project teams
  - Decision authorities
  - Project lead
  - Success measures



### **Project Charter Template**

				Project Title:			
				Black Belt	Project Champion	Executive Sponsor	MBB/Mentor
Primary	Metric				Secondary Metric		
Problem	Statement				Business Case		
High Lev	el Project 1	imeline	Constraint	s & Dependencies	Project Risks	Other Dia	anostics
Phase	Start	Finish					
Define							
Measure							
Analyze							
-							
Improve							
Improve Control				Stakeholders & Adv	isors	Project Team & SME	s
Control	/Steering (	Committe <u>e</u>					
Control	/Steering (	Committee Organizat	tion	Name	Organization	Name	Organization
Control Approval	/Steering (		tion		Organization	Name	Organization
Control Approval	Steering		tion		Organization	Name	Organization



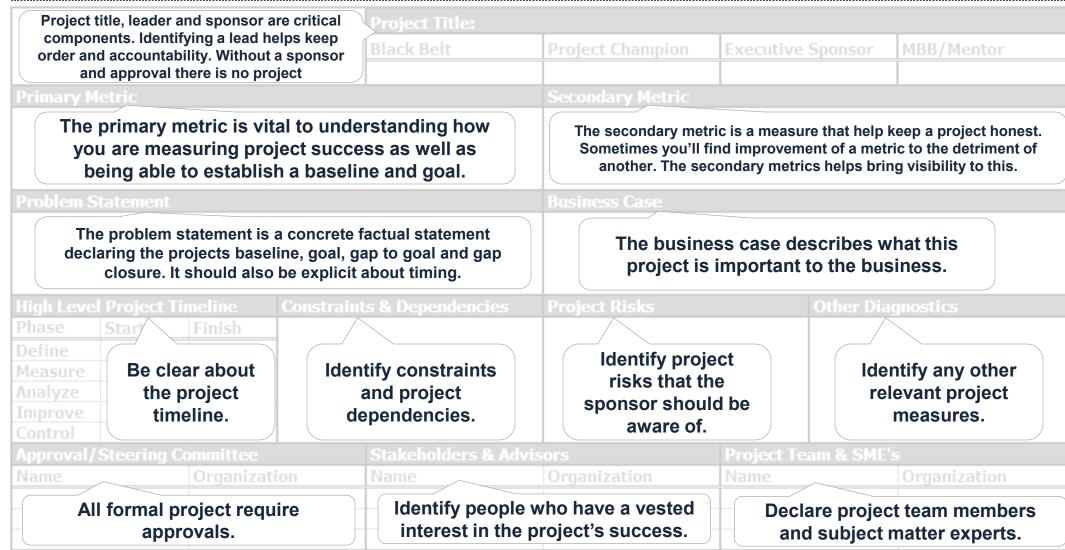



153

- Title
  - Projects should have a name, title, or some reference that identifies them.
  - Branding can be an important ingredient in the success of a project so be sure your project has a reference name or title.
- Leader
  - Any projects needs a declared leader or someone who is responsible for project's execution and success.
  - You may hear references to RACI throughout in your Six Sigma journey.
  - **RACI** stands for **R**esponsible, **A**ccountable, **C**onsulted, **I**nformed and identifies the people that play those roles.
  - Every project must have declared leaders indicating who is responsible and who is accountable.



- Business Case
  - A **business case** is the quantifiable reason why the project is important.
  - Business cases help shed light on problems. They explain why a business should care.
  - Business cases must be quantified and stated succinctly.
  - COPQ is a key method of quantification for any business case.



- Problem Statement and Objective
  - A properly written problem statement has an objective statement woven into it.
  - There should be no question as to the current state or the goal.
  - A gap should be declared, the gap being the difference between the present state and the goal state.
  - The project objective should be to close the gap or reduce the gap by some reasonable amount.
  - Valuation or COPQ is the monetary value assigned to the gap.
  - Lastly, a well-written problem statement refers to a timeline expected to be met.



### Project Charter: Problem Statement Examples

- Currently, process defect rates are 17% with a goal of 2%. This represents a gap of 15%, costing the business \$7.4 million dollars. The goal of this project is to reduce this gap by 50% before Nov 2010 putting process defect rates at 9.5% and saving \$3.7MM.
- Process cycle time has averaged 64 minutes since Q1 2009. However, production requirements put the cycle time goals at 48 min. This 16-min gap is estimated to cost the business \$296,000. The goal of this project is reduce cycle time by 16 min. by Q4 2010 and capture all \$296,000 cost savings.



- Metrics
  - A measure of success is an absolute for any project.
  - Metrics give clarity to the purpose of the work.
  - Metrics establish how the initiative will be judged.
  - Metrics establish a baseline or "starting point."
  - For Six Sigma projects...metrics are mandatory!



- Primary Metric
  - The primary metric is a generic term for a Six Sigma project's most important measure of success. The primary metric is defined by the Black Belt, GB, MBB, or Champion.
  - A primary metric is an absolute MUST for any project and it should not be taken lightly. Here are a few characteristics of good primary metrics.
  - Primary metrics should be:
    - tied to the problem statement
    - measureable
    - expressed with an equation
    - aligned to business objectives
    - tracked at the proper frequency (hourly, daily, weekly, monthly etc.)
    - expressed pictorially over time with a run chart, time series, or control chart
    - validated with an MSA.



- The primary metric is the reason for your work.
- It is the success indicator.
- It is your beacon.
- The primary metric is of utmost importance and should be improved, **but** not at the expense of your secondary metric.



- Secondary Metric
  - The secondary metric is the thing you do not want sacrificed on behalf of a primary improvement.
  - A secondary metric is one that makes sure problems are not just "changing forms" or "moving around."
  - The secondary metric keeps us honest and ensures we are not sacrificing too much for our primary metric.
  - If your primary metric is a cost or speed metric, then your secondary metric should probably be some quality measure.
    - Example: If you were accountable for saving energy in an office building and your primary metric was energy consumption then you *could* shut off all the lights and the HVAC system and save tons of energy. . .except that your secondary metrics are probably comfort and functionality of the work environment.



- Elements of a Good Project Charters (continued)
  - Scope Statement defined by high-level process map
  - Stakeholders Identified who is affected by the project
  - Approval Authorities Identified who makes the final call
  - Review Committees Defined who is on the review team
  - Risks and Dependencies Highlighted identify risks and critical path items
  - Project Team Declared declare team members
  - Project Timeline Estimated set high-level timeline expectations.



163

# 1.3.3 Project Team Selection



- Six Sigma project team selection is the cornerstone of a successful Six Sigma project.
- Teams and Team Success
  - A **team** is a group of people who share complementary skills and experience.
  - A team will be dedicated to consistent objectives.
  - Winning teams share similar and coordinated goals.
  - Teams often execute common methods or approaches.
  - Team members hold each other accountable for achieving shared goals.



- What makes a team successful?
  - Shared goals
  - Commitment
  - Leadership
  - Respect
  - Effective communication
  - Autonomy
  - Diversity (capabilities, knowledge, skills, experience etc.)
  - Adequate resources.





- Keys to Team Success
  - Agreed focus on the goal or the problem at hand
    - Focus on problems that have meaning to the business
    - Focus on solvable problems within the scope of influence; a successful team does not seek unattainable solutions.
  - Team Selection
    - Selected teammates have proper skills and knowledge
    - Adequately engaged management
    - Appropriate support and guidance from their direct leader
  - Successful teams use reliable methods
    - Follow the prescribed DMAIC methodology
    - Manage data, information, and statistical evidence
  - Successful teams always have exceeds players
    - Winning teams typically
      - Have unusually high standards.
      - Have greater expectations of themselves and each other.
      - Do not settle for average or even above average results.



- Principles of Team Selection:
  - Select team members based on
    - Skills required to achieve the objective
    - Experience (Subject Matter Expertise)
    - Availability and willingness to participate
    - Team size (usually 4–8 members)
      - Don't go at it alone!
      - Don't get too many cooks in the kitchen!
    - Members' ability to navigate
      - The process
      - The company
      - The political landscape
  - Be sure to consider the inputs of others
    - Heed advice
    - Seek guidance



- All teams experience the following four stages of development. It is helpful to understand these phases so that you can anticipate what your team is going to experience.
- The four stages of team development process:
  - Forming
  - Storming
  - Norming
  - Performing
- Teammates seek something different at each stage:
  - In the forming stage they seek inclusion
  - In the storming stage they seek direction and guidance
  - In the norming stage they seek agreement
  - In the performing stage they seek results.



- Patterns of a team in the Forming stage:
  - Roles and responsibilities are unclear
  - Process and procedures are ignored
  - Scope and parameter setting is loosely attempted
  - Discussions are vague and frustrating
  - There is a high dependence on leadership for guidance
- Patterns of a team in the **Storming** stage:
  - Attempts to skip the research and jump to solutions
  - Impatience for some team members regarding lack of progress
  - Arguments about decisions and actions of the team
  - Team members establish their position
  - Subgroups or small teams form
  - Power struggles exist and resistance is present



- Patterns of a team in the Norming stage:
  - Agreement and consensus start to form
  - Roles and responsibilities are accepted
  - Team members' engagement increases
  - Social relationships begin to form
  - The leader becomes more enabling and shares authority
- Patterns of a team in the **Performing** stage:
  - Team is directionally aware and agrees on objectives
  - Team is autonomous
  - Disagreements are resolved within the team
  - Team forms above average expectations of performance



- Well-structured and energized project teams are the essential components of any successful Six Sigma project.
- To have better chances of executing the project successfully, you will need to understand and effectively manage the team development process.



71





Risk is defined as a future event that can impact the task/project if it occurs.





### What is Project Risk Management?

- The main purpose of **risk management** is to foresee potential risks that may inhibit the project deliverables from being delivered on time, within budget, and at the appropriate level of quality, and then to mitigate these risks by creating, implementing, and monitoring *contingency plans*.
- Risk management is concerned with identifying, assessing, and monitoring project risks before they develop into issues and impact the project.
- **Risk analysis** helps to identify and manage potential problems that could impact key business initiatives or project goals.



## Three Basic Parameters of Risk Analysis

- Risk Assessment:
  - The process of identifying and evaluating risks, whether in absolute or relative terms.
- Risk Management:
  - Project risk management is the effort of responding to risks throughout the life of a project and in the interest of meeting project goals and objectives.
- Risk Communication:
  - Communication plays a vital role in the risk analysis process because it leads to a good understanding of risk assessment and management decisions.



## Why is Risk Analysis Necessary?

What can happen if you omit the risk analysis?

- Vulnerabilities cannot be detected
- Mitigation plans are introduced without proper justification
- Customer dissatisfaction
- Not meeting project goals
- Remake the whole system
- Huge cost and time loss





#### **Project Risk Analysis Steps**

The project risk analysis process consists of the following steps that evolve through the life cycle of a project.

- Risk Identification:
  - Identify risks and risk categories, group risks, and define ownership.
- Risk Assessment:
  - Evaluate and estimate the possible impacts and interactions of risks.
- Response Planning:
  - Define mitigation and reaction plans.
- Mitigation Actions:
  - Implement action plans and integrate them into the project.
- Tracking and Reporting:
  - Provide visibility to all risks.
- Closing:
  - Close the identified risk.



The first action of risk management is the identification of individual events that the project may encounter during its lifecycle.

The identification step comprises:

- Identify the risks
- Categorize the risks
- Match the identified risks to categories
- Define ownership for managing the risks.





 $\odot$ 

#### **Risk Identification**

- Source of Risk:
- Identification of risk sources provides a basis for systematically examining changing situations over time to uncover circumstances that impact the ability of the project to meet its objectives.



179

### **Risk Identification**

.....

Source of Risk	Description			
Human Resources	The risks originated from human resources (e.g., availability, skill etc.)			
Physical Resources	The risks originated from physical resources (e.g., hardware or software, availability of the required number at the right time etc.)			
Technology	The risks originated from technology (e.g., development environment, new or complex technologies, performance requirements, tools etc.)			
Suppliers	The risks are associated with a supplier (e.g., delays in supplies, capability of suppliers etc.)			
Customer	The risks derived from the customer (e.g., unclear requirements, requirement volatility, change in project scope, delays in response etc.)			
Security	The risks are associated with information security, security of personnel, security of assets, and security of intellectual property			
Legal	The risks are associated with legal issues that may impact the project			
Project management	The risks are associated with project management processes, organizational maturity, and ability			

## **Risk Identification**

## **Risk Parameters:**

Parameters for evaluating, categorizing, and prioritizing risks include the following:

- Risk likelihood (i.e., probability of risk occurrence)
- Risk consequence (i.e., impact and severity of risk occurrence)
- Thresholds to trigger management activities.



The risk assessment consists of evaluating the range of possible impacts should the risk occur.

Follow these steps when assessing risks:

- 1. Define the various impacts of each risk
- 2. Rate each impact based on a logical severity level
- 3. Sort and evaluate risks by severity level
- 4. Determine if any controls already exist
- 5. Define potential mitigation actions.



# **Risk Mitigation Planning**

The risk owners are responsible for planning and implementing mitigation actions with support from the project team.

- All team members, inclusive of partners and suppliers, may be requested to identify and develop mitigation measures for identified risks.
- The project core team members are responsible for identifying an appropriate action owner for each identified risk.
- After mitigation actions are defined, the project core team will review the actions.
- The risk owner must track all mitigation actions and expected completion dates.
- The risk owner and the project core team members must hold all action owners accountable for the risk mitigation planning.



## **Risk Mitigation Action Implementation**

- The action implementation is the responsibility of the risk owner.
- The action owners are responsible for the execution of the tasks or activities necessary to complete the mitigation action and eliminate or minimize the risk.
- The risk owner or the project manager will monitor completion dates of the mitigation action implementation.



## **Risk Occurrence and Contingency Plans**

- Whenever any risk occurs, the project team should implement **contingency plans** to ensure that project deliverables can be met.
- The details of each occurrence should be recorded in the risk register or other tracking tool.
- The **risk register** or **risk management plan** (see next slide) will be maintained by the project manager and reviewed on a regular basis.



## **Risk Tracking and Reporting**

- Risk tracking and reporting provides critical visibility to all risks.
- Risk owners must report on the status of their mitigation actions.
- Depending on the risk severity, project managers need to report the risk status of each category of risk to senior management.

	<u>Company</u>	Project/Program Name	I	roject Lead Project Sponsor/Champion Last U		Project Sponsor/Champion		<u>Updated</u>
Risk ID	Risk Category	Risk Description		Risk Impact	Impact Rating		Responsit	ole Status

#### **Risk Management Plan**



186



- The risk owners are responsible for recommending the risk closure to the project manager.
- A risk is *closed* only when the item is not considered a risk to the project anymore.
- When a risk is closed, the project manager needs to update the risk status in the lessons learned document.



## **Risk Analysis Features**

The risk analysis should be:

- Systematic
- Comprehensive
- Data driven
- Adherent to evidence
- Logically sound
- Practically acceptable
- Open to critique
- Easy to understand.



188

# Project Risk Analysis Advantages

- Helps strategic and business planning
- Meets customer requirements
- Reduces schedule slips and cost overruns
- Promotes an effective usage of resources
- Promotes continuous improvement
- Helps to achieve project goals
- Minimizes surprises from customers and stakeholders
- Allows a quick grasp of new opportunities
- Enhances communication
- Reassures stakeholders that the project stays on track.



# 1.3.5 Project Planning



## What is Project Management?

- **Project management** is the process of defining, planning, organizing, managing, leading, securing, and optimizing the resources to achieve a set of planned goals and objectives.
- It is the application of knowledge, skills, tools, and techniques to project activities in order to meet project requirements.



91

## What is a Project Plan?

- A **project plan** is a crucial step in project management for achieving a project's goals.
- A project plan is a formal approved document used to guide and execute project tasks.
- It provides an overall framework for managing project tasks, schedules, and costs.
- A project plan is a coordinating tool and communication device that helps teams, contractors, customers, and organizations define the crucial aspects of a project or program.



## **Project Planning Stages**

- **1. Determine project scope and objectives**: Explore opportunities, identify and prioritize needs, consider project solutions.
- 2. Plan the project: Identify input and resources requirements such as human resources, materials, software, hardware, and budgets.
- **3.** Prepare the project proposal: Based on stakeholder feedback, plan the necessary resources, timeline, budget etc.
- **4. Implement the project:** Implement the project by engaging responsible resources and parties. Ensure execution and compliance of the defined plans.
- **5. Evaluate the project:** Regularly review progress and results. Measure the project's effectiveness against *quantifiable* requirements.



# Planning and Scheduling Objectives

- To optimize the use of resources (both human and other resources).
- To increase productivity.
- To achieve desired schedules and deliverables.
- To establish an approach to minimize long-term maintenance costs.
- To minimize the chaos and productivity losses resulting from planned production schedules, priority changes, and non-availability of resources.
- To assess current needs and future challenges.



- Statement of work (SOW)
- Work breakdown structure (WBS)
- Resource estimation plan
- Project schedule
- Budget or financial plan
- Communication plan
- Risk management plan



**Statement of Work (SOW)** is a formal document often accompanying a contract that outlines specific expectations, limitations, resources and work guidelines intended to define the work or project.

## <u>SOW's</u>:

- Define the scope of the project.
- Establish expectations and parameters of the project.
- Identify technical requirements for the project
- Provide guidance on materials to be used.
- Establish timeline expectations.
- Etc.






Work Breakdown Structure (WBS) is a decomposition of project components into small and logical bodies of work or tasks.

Work Breakdown Structures:

- Identify all required components of a project.
- Cascades components into sub-components and tasks.
- WBS's are not by themselves project plans or schedules but they are a necessary step to help establish project plans and timelines.
- WBS's also enable logical reporting and summarizations of project progress

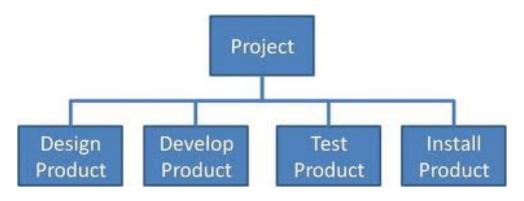



**Work Breakdown Structure Example:** below is an example of a WBS for the assembly of a bicycle.

Level 1	Level 2	Level 3		
1.0 Bicycle	1.1 Frame	1.1.1 Set Body Frame		
		1.1.2 Assemble Handlebars		
		1.1.3 Install Seat & Seat Post		
		1.1.4 Assemble Wheel Bearings & Axle		
		1.1.5 Install Wheels		
		1.1.6 Attach Brake System to Frame Set		
	1.2 Wheels	1.2.1 Stage Rims		
		1.2.2 Install Spokes		
		1.2.3 Insert Tubes in Tires		
		1.2.4 Assemble Tires on Rims		
		1.2.5 Install Reflectors		
	1.3 Brake System	1.3.1 Connect Brake Cables To Hand Levers		
		1.3.2 Connect Brake Cables to Brake Harness		
		1.3.3 Attach Brake Pads to Brake Harness		
		1.3.4 Adjust/Calibrate Brake System		



www.LeanSigmaCorporation.com

# Project Planning Activities: Resource Planning

### **Resource Estimation Plan**

- Estimate Resource Requirements (Use Your WBS)
  - Parts, Hardware, Software, Human Resources etc.
- Plan resources
  - Establish who is responsible for what and when.
  - Determine quantity requirements and delivery dates etc.

Level 3	Parts Required	Quantity	Cost	Part Inventory	Responsible
1.1.1 Set Body Frame	Body Frame	1	\$9.00	4	John
1.1.2 Assemble Handlebars	Handlebars	1	\$4.00	4	John
1.1.3 Install Seat & Seat Post	Seat & Post	1 Each	\$3.00	4 Each	John
1.1.4 Assemble Wheel Bearings & Axle	Bearing & Axle	2 Each	\$1.00	8 Each	John
1.1.5 Install Wheels	Wheels	2	\$0.50	8	John
1.1.6 Attach Brake System to Frame Set					John
1.2.1 Stage Rims	Wheel Rim	2	\$0.30	12	Cathy
1.2.2 Install Spokes	Spokes	48	\$0.03	72	Cathy
1.2.3 Insert Tubes in Tires	Tubes & Tires	2 Each	\$0.33	0 Tubes 8 Tires	Cathy
1.2.4 Assemble Tires on Rims					Cathy
1.2.5 Install Reflectors	Reflectors	4	\$0.10	18	Cathy
1.3.1 Connect Brake Cables To Hand Levers	Cables & Levers	2 Each	\$0.90	12 Each	Lisa
1.3.2 Connect Brake Cables to Brake Harness	Brake Harness	2	\$0.40	8	Lisa
1.3.3 Attach Brake Pads to Brake Harness	Brake Pads	4	\$0.15	12	Lisa
1.3.4 Adjust/Calibrate Brake System					Lisa



# Project Planning Activities: Project Scheduling

## **Project Scheduling:**

- Assign beginning times to each activity in the WBS (days are used for start and durations times in example below).
- Assign duration times to each activity in the WBS.
- Identify People Responsible and set completion dates.
- Represent schedules as Gantt charts or network diagrams.
- Identify critical dependencies between tasks.


Level 2	Level 3	Task Start	Task Duration	Responsible
1.1 Frame	1.1.1 Set Body Frame	0	2	John
	1.1.2 Assemble Handlebars	2	2	John
	1.1.3 Install Seat & Seat Post	4	2	John
	1.1.4 Assemble Wheel Bearings & Axle	6	4	John
	1.1.5 Install Wheels	14	4	John
	1.1.6 Attach Brake System to Frame Set	18	3	John
1.2 Wheels	1.2.1 Stage Rims	0	1	Cathy
	1.2.2 Install Spokes	1	7	Cathy
	1.2.3 Insert Tubes in Tires	10	2	Cathy
	1.2.4 Assemble Tires on Rims	12	2	Cathy
	1.2.5 Install Reflectors	8	2	Cathy
1.3 Brake System	1.3.1 Connect Brake Cables To Hand Levers	0	8	Lisa
-	1.3.2 Connect Brake Cables to Brake Harness	8	8	Lisa
	1.3.3 Attach Brake Pads to Brake Harness	16	2	Lisa
	1.3.4 Adjust/Calibrate Brake System	21	2	Lisa



## Project Planning Activities: Project Scheduling

#### **Project Schedule – Gantt Chart:**

- The advantage of a Gantt chart is its ability to display the status of each task/activity at a glance.
- Because it is a graphic representation, it is easy to demonstrate the schedule of tasks and timelines to all the stakeholders.

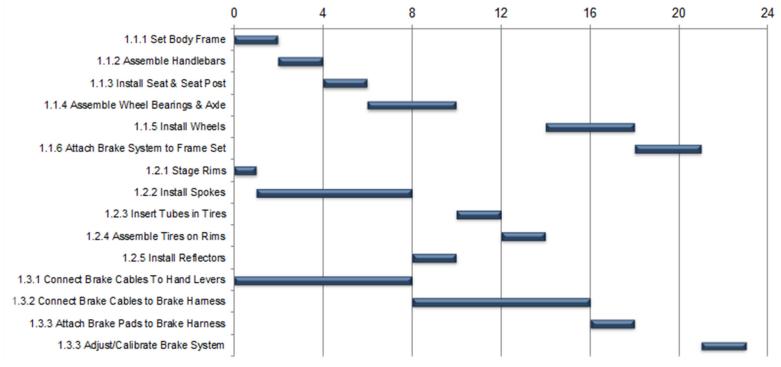

#### Gantt Chart Example




There are many tools available to create Gantt charts. Some of the most common and compatible for businesses are: Microsoft Project, Visio and Excel. In Microsoft Excel we use the bicycle example:

1. Select rows & columns of your tasks, start times and durations.

Fil	Home Inser	rt Page Layout Form	nulas Data	Review View Ac	robat SigmaXi	ooki - Micro L	osoft Excel	
Past	<ul> <li>→ Cut</li> <li>→ Copy ~</li> <li>→ Format Painter</li> <li>Clipboard □</li> <li>D2 ~</li> </ul>	B I U → Font				General \$ - % • Numbe		Conditional For Formatting v as Ta Styles
A		C C		D		E	F	К
2	Level 1	Level 2	Level 3		1	Fask Start	Task Dura	tion Responsib
3	1.0 Bicycle	1.1 Frame	1.1.1 Set B	ody Frame		0	2	John
4	,		8	mble Handlebars		2	2	John
5			8	Seat & Seat Post		4	2	John
6			1.1.4 Asser	1.1.4 Assemble Wheel Bearings & Axle		6	4	John
7			1.1.5 Instal			10	4	John
8			1.1.6 Attacl	n Brake System to Fran	ne Set	14	3	John
9 10		1.2 Wheels	1.2.1 Stage			0	1	Cathy
10			1.2.2 Instal			2	7	Cathy
11			1.2.3 Insert	Tubes in Tires		10	2	Cathy
12			1.2.4 Asser	mble Tires on Rims		12	2	Cathy
13			1.2.5 Instal	Reflectors		8	2	Cathy
14		1.3 Brake System	1.3.1 Conn	ect Brake Cables To Ha	and Levers	0	8	Lisa
11 12 13 14 15 16			1.3.2 Conn	ect Brake Cables to Bra	ake Harness	8	8	Lisa
16			1.3.3 Attacl	n Brake Pads to Brake H	Harness	16	2	Lisa
17			1.3.3 Adjus	t/Calibrate Brake Syste	m	18	2	Lisa




- 2. On the Insert tab select Bar > Stacked Bar.
- 3. On the Design tab choose a design style from the style dropdown.

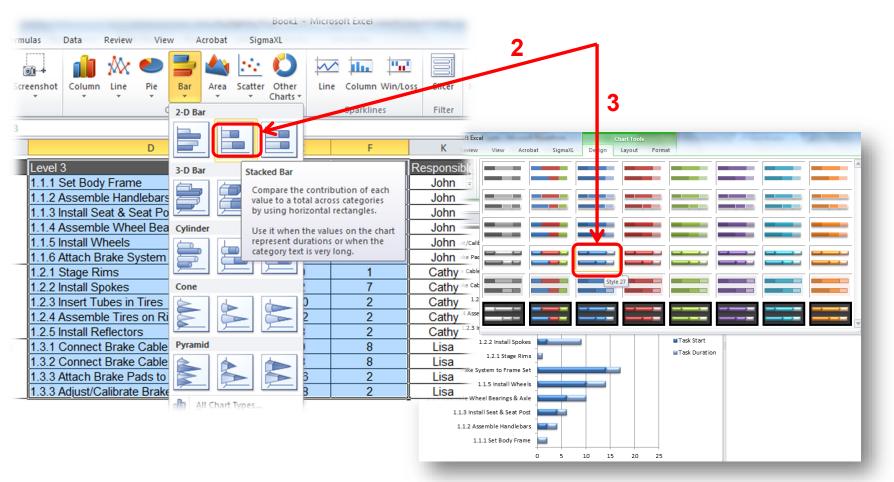




- 4. Activate the "start tasks" on your graph.
- 5. From the format tab select "format selection".

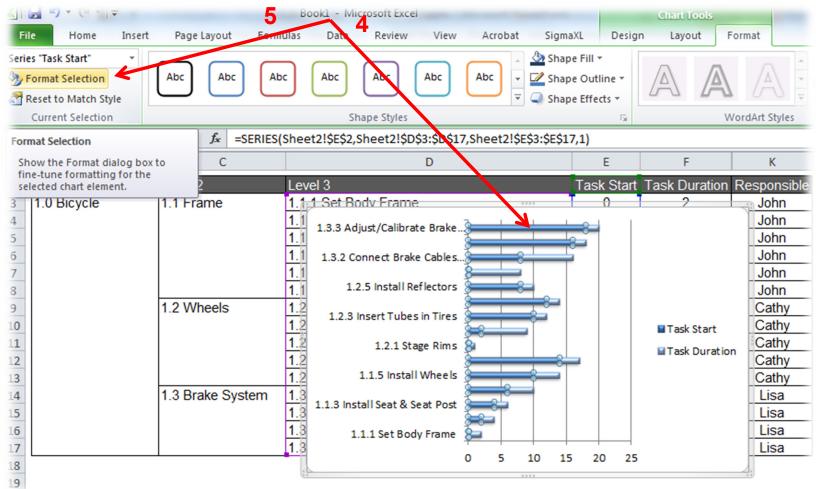



- 6. Select Fill > No Fill.
- 7. Select Shadow > Presets > No Shadow > Close.

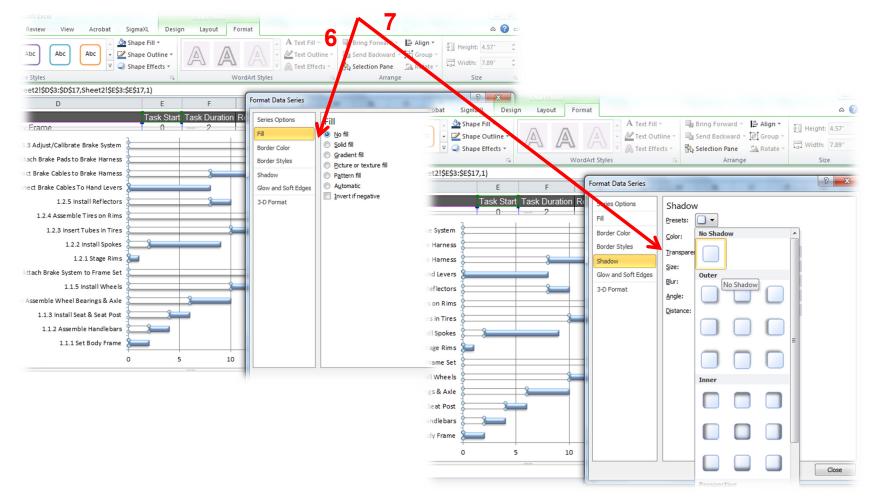




# $\odot$ Lean Sigma Corporation Lean Six Sigma Training - JMP

# Project Scheduling: Preparing a Gantt Chart in Excel

8. Format your new Gantt chart to your own preferences.

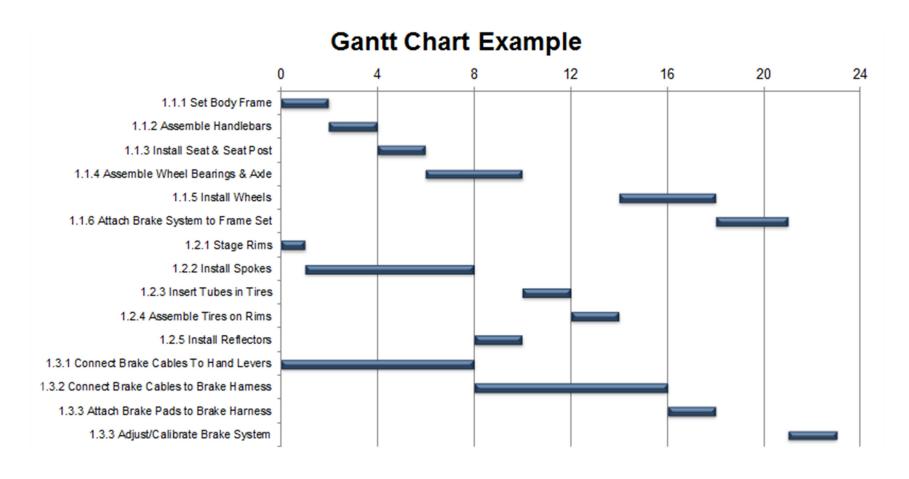



www.LeanSigmaCorporation.com

- **Critical Path Method (CPM)** is a project modeling technique used to identify the set of activities that are most influential to a projects completion timeline.
  - Critical Path tasks are those that others are dependent upon.
  - Project timelines cannot be shortened without shortening the tasks or activities that are identified as critical path items.

## Steps To Using The Critical Path Method

- 1. List all activities necessary to complete the project.
- 2. Determine the time or duration of each activity.
- 3. Identify the dependencies between the activities.

Use Your Work Breakdown Structure (WBS).



**Critical Path Method Example:** Let's continue with our bicycle example. Note that the tasks in the WBS are already set to start based on their dependencies.

Level 2	Level 3	Task Start	Task Duration	Responsible
1.1 Frame	1.1.1 Set Body Frame	0	2	John
	1.1.2 Assemble Handlebars	2	2	John
	1.1.3 Install Seat & Seat Post	4	2	John
	1.1.4 Assemble Wheel Bearings & Axle	6	4	John
	1.1.5 Install Wheels	14	4	John
	1.1.6 Attach Brake System to Frame Set	18	3	John
1.2 Wheels	1.2 Wheels 1.2.1 Stage Rims		1	Cathy
	1.2.2 Install Spokes	1	7	Cathy
	1.2.3 Insert Tubes in Tires	10	2	Cathy
	1.2.4 Assemble Tires on Rims	12	2	Cathy
	1.2.5 Install Reflectors	8	2	Cathy
1.3 Brake System	1.3.1 Connect Brake Cables To Hand Levers	0	8	Lisa
	1.3.2 Connect Brake Cables to Brake Harness	8	8	Lisa
	1.3.3 Attach Brake Pads to Brake Harness	16	2	Lisa
	1.3.4 Adjust/Calibrate Brake System	21	2	Lisa

 For example, Installing the wheels in step 1.1.5 requires the whole set of steps in 1.2 to be completed so 1.1.5 starts on day 14 when the wheels are ready.




Continuing this example; the last task, 1.3.4 Adjusting the Brake System, completes on day 23 and can't begin until day 21 because the brake system must be attached to the bike frame before being calibrated.

	Level 3	Task Start	Task Duration	Responsible
	1.1.1 Set Body Frame	0	2	John
1.6 etes	1.1.2 Assemble Handlebars	2	2	John
mpley 21	1.1.3 Install Seat & Seat Post	4	2	John
1.1.6 completes completes	1.1.4 Assemble Wheel Bearings & Axle	6	4	John
h h	1.1.5 Install Wheels	14	4	John
$\chi$ , $\gamma$	1.1.6 Attach Brake System to Frame Set	18	3	John
1.z Wheels	1.2.1 Stage Rims	0	1	Cathy
	1.2.2 Install Spokes	1	7	Cathy
	1.2.3 Insert Tubes in Tires	10	2	Cathy
	1.2.4 Assemble Tires on Rims	12	2	Cathy
2.4 or ~	1.2.5 Install Reflectors	8	2	Cathy
Starts 21	1.3.1 Connect Brake Cables To Hand Levers	0	8	Lisa
staday r	1.3.2 Connect Brake Cables to Brake Harness	8	8	Lisa
	1.3.3 Attach Brake Pads to Brake Harness	16	2	Lisa
	1.3.4 Adjust/Calibrate Brake System	21	2	Lisa



Earlier if you noticed when we conducted our resource plan that we were out of tire tubes then you might have managed your resources differently.

Let's assume the tubes take 21 days to receive from the supplier. Below is the adjustment to our Gantt chart. Notice that the project timeline is pushed out by 8 days, finishing on day 31 instead of day 23.

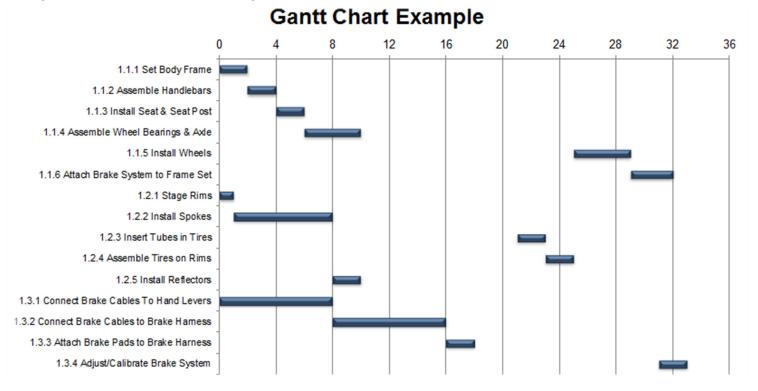



## **Project Scheduling: PERT**

**Program Evaluation & Review Technique (PERT):** is a method of evaluation that can be applied to time or cost.

- PERT provides a weighted assessment of time or cost
- PERT uses 3 parameters for estimation:
  - Optimistic or Best Case Scenario represented by 'O'.
  - Pessimistic or Worst Case Scenario represented by 'P'.
  - Most Likely Scenario represented by 'ML'.
- PERT Equation:

## (O + (4\*ML) + P) / 6

• The PERT equation provides for heavier weighting of the most likely scenario but also considers the best and worst cases. In the event that a best or worst case scenario is an extreme situation, the PERT will account for it in a weighted manner.




www.LeanSigmaCorporation.com

Let's apply the PERT formula to our estimates of receiving our needed tire tubes from the supplier and then change our schedule based on the result.

- Your experience with this supplier tells you that they typically over estimate the time required to deliver. Therefore, their 21 day lead time on the tubes should be considered a "worst case scenario".
- Procurement has indicated that tubes have arrived in as few as 6 days from this supplier. So, your best case scenario is 6 days.
- The most likely scenario you decide will be the median of this suppliers delivery time which is 10 days.
- Therefore:



Using 11 days in your project plan instead of 21 gives you a more confident estimate of time and actually removes tire tubes as the primary detracting critical path item.

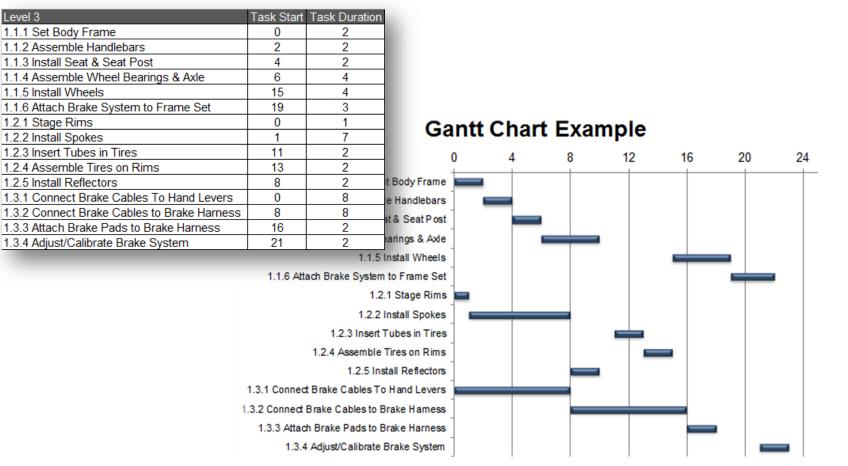



www.LeanSigmaCorporation.com


Lean Six Sigma Training - JMP

 $\bigcirc$ 

Lean Sigma Corporation

## **Budget or Financial Plan**

- Planned expenses
- Planned revenues
- Budget forecast

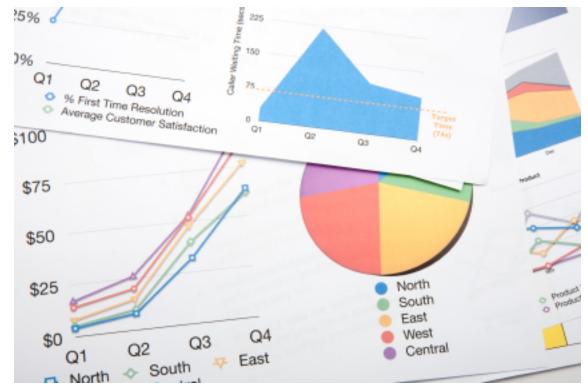




214

## **Communication Plan**

- Establish communication procedures among management, team members, and relevant stakeholders.
- Determine the communication schedule.
- Define the acceptable modes of communication.

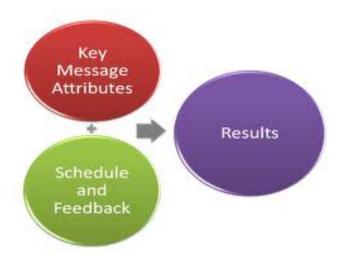



## **Risk Management Plan**

- Identify the sources of project risks and estimate the effects of those risks.
- Risks might arise from new technology, availability of resources, lack of inputs from customers, business risks etc.
- Assess the impact of risk to the customers/stakeholders.
- Calculate the probability of risk occurrence based on previous similar projects or industry benchmarks
- Initiate mitigation and contingency plans
- Review risks on a periodic basis





216

### Project Planning Tools Advantages

- Project planning tools are very useful to organize and communicate project plans, status, and projections.
- They help link tasks and sub-tasks or other work elements to get a whole view of what needs to be accomplished.
- They allow a more objective comparison of alternative solutions and provide consistent coverage of responsibilities.
- They allow for effective scope control and change management.
- They facilitate effective communication with all project participants and stakeholders.
- They help define management reviews.
- They act as an effective monitoring mechanism for the project.
- They establish project baselines for progress reviews and control points.



# 1.4 Lean Fundamentals



### Black Belt Training: Define Phase

### 1.1 Six Sigma Overview

- 1.1.1 What is Six Sigma
- 1.1.2 Six Sigma History
- 1.1.3 Six Sigma Approach Y = f(x)
- 1.1.4 Six Sigma Methodology
- 1.1.5 Roles and Responsibilities

### **1.2 Six Sigma Fundamentals**

- 1.2.1 Defining a Process 1.2.2 VOC and CTQs 1.2.3 QFD
- 1.2.4 Cost of Poor Quality (COPQ)
- 1.2.5 Pareto Analysis (80:20 rule)

1.3 Lean Six Sigma Projects

1.3.1 Six Sigma Metrics
1.3.2 Business Case and Charter
1.3.3 Project Team Selection
1.3.4 Project Risk Management
1.3.5 Project Planning

### 1.4 Lean Fundamentals

1.4.1 Lean and Six Sigma1.4.2 History of Lean1.4.3 The Seven Deadly Muda1.4.4 Five-S (5S)



# 1.4.1 Lean and Six Sigma



### What is Lean?

- A lean enterprise intends to eliminate waste and allow only value to be pulled through its system.
- Lean manufacturing is characterized by:
  - Identifying and driving value
  - Establishing flow and pull systems
  - Creating production availability and flexibility
  - Zero waste
- Waste Elimination
  - Waste identification and elimination is critical to any successful lean enterprise.
  - Elimination of waste enables flow, drives value, cuts cost, and provides flexible and available production.






### The 5 Lean Principles

- The following 5 principles of lean are taken from the book *Lean Thinking* (1996) by James P. Womack and Daniel T. Jones.
  - 1. Specify value desired by customers.
  - 2. Identify the value stream.
  - 3. Make the product flow continuous.
  - 4. Introduce pull systems where continuous flow is possible.
  - 5. Manage toward perfection so that the number of steps and the amount of time and information needed to serve the customer continually falls.




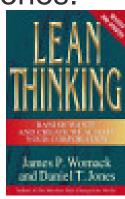

222

### Lean & Six Sigma


- Lean and Six Sigma both have the objectives of producing high value (quality) at lower costs (efficiency).
- They approach these objectives in somewhat different manners but in the end, both Lean and Six Sigma drive out waste, reduce defects, improve processes, and stabilize the production environment.
- Lean and Six Sigma are a perfect combination of tools for improving quality and efficiency.

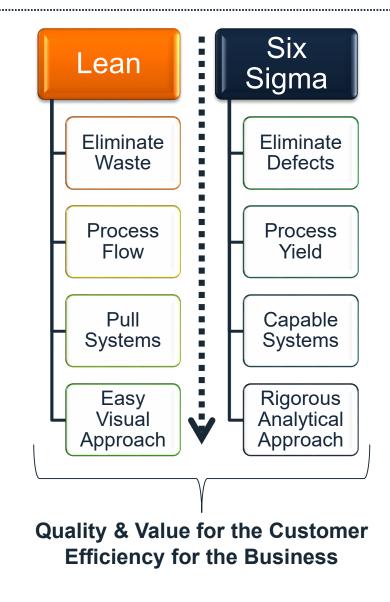







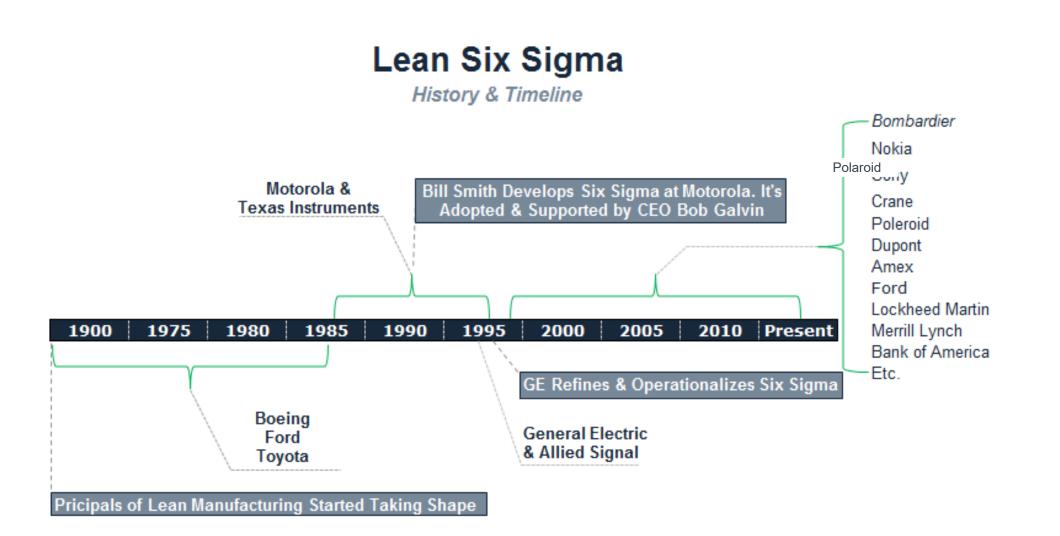



 $\odot$ 

#### www.LeanSigmaCorporation.com

### History of Lean

- Lean thinking originated, as far as is known, the 1400s.
- Henry Ford established the first mass production system in 1913 by combining standard parts, conveyors, and work flow.
- Decades later, Kiichiro Toyoda and Taiichi Ohno at Toyota improved and implemented various new concepts and tools (e.g., value stream, takt time, kanban etc.) based on Ford's effort.
- Toyota developed what is known today as the Toyota Production System (TPS) based on lean principles.



### History of Lean

- Starting in the mid 1990s, Lean became extensively recognized and implemented when more and more Fortune 100 companies began to adopt Lean and Six Sigma.
- The term "Lean manufacturing" was introduced by James Womack in the 1990s.
- Lean and Six Sigma share similar objectives, work hand in hand, and have benefited from one another in the past 30 years.



# 1.4.3 Seven Deadly Muda



### The 7 Deadly Muda

- The Japanese word for waste is "muda."
- There are 7 commonly recognized forms of waste, often referred to as the "7 deadly muda."
  - 1. Defects
  - 2. Overproduction
  - 3. Over-Processing
  - 4. Inventory
  - 5. Motion
  - 6. Transportation
  - 7. Waiting






igmaCorporation.com

 $\odot$ 

## The 7 Deadly Muda: Defects

- Defects or defectives are an obvious waste for any working environment or production system.
- Defects require rework during production and/or after the product is returned from an unhappy customer.
- Some defects are difficult to solve and they create "workarounds" and hidden factories.
- Eliminating defects is a sure way to improve product quality, customer satisfaction, and production costs.



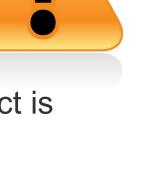

## The 7 Deadly Muda: Overproduction

 Overproduction is wasteful because your system expends energy and resources to produce more materials than the customer or next function requires.



- Overproduction is one of the most detrimental of the seven deadly muda because it leads to many others:
- Inventory
- Transportation
- Waiting etc.

### The 7 Deadly Muda: Over-processing



**Over-processing** occurs any time more work is done than is required by the next process step, operation, or consumer.

- Over-processing also includes being over capacity (scheduling more workers than required or having more machines than necessary).
- Another form of over processing can be buying tools or software that are overkill (more precise, complex, or expensive than required).



### The 7 Deadly Muda: Inventory



- **Inventory** is an often overlooked waste. Look at the picture above and imagine all the time, materials, and logistics that went into establishing such an abundance of inventory.
- If this were your personal business, and inventory velocity was not matched with production, how upset would you be?



Lean Sigma Corporation Lean Six Sigma Training - JMP

 $\odot$ 

### The 7 Deadly Muda: Motion



- Motion is another form of waste often occurring as a result of poor setup, configuration, or operating procedures.
- Wasted motion can be experienced by machines or humans.
- Wasted motion is very common with workers who are unaware of the impact of small unnecessary movements in repetitive tasks.
- Wasted motion is exaggerated by repetition or recurring tasks.



## The 7 Deadly Muda: Transportation



- **Transportation** is considered wasteful because it does *nothing* to add value or transform the product.
- Imagine for a moment driving to and from work twice before getting out of your car to go into work...
- That is waste in the form of transportation.
- The less driving you have to do, the better.
- In a similar way, the less transportation a product has to endure, the better. There would be fewer opportunities for delay, destruction, loss, damage etc.



## The 7 Deadly Muda: Waiting



- Waiting is an obvious form of waste and is typically a symptom of an upstream problem.
- Waiting is usually caused by inefficiency, bottlenecks, or poorlydesigned work flows within the value stream.
- Waiting can also be caused by inefficient administration.
- Reduction in waiting time will require thoughtful applications of lean and process improvement.



 $\odot$ 

# 1.4.4 Five-S (5S)



237

### What is 5S?


- **5S** is systematic method to organize, order, clean, and standardize a workplace...and to keep it that way!
  - 5S is a methodology of organizing and improving the work environment.
- 5S is summarized in five Japanese words all starting with the letter S:
  - Seiri (sorting)
  - Seiton (straightening)
  - Seiso (shining)
  - Seiketsu (standardizing)
  - Shisuke (sustaining)
- 5S was originally developed in Japan and is widely used to optimize the workplace to increase productivity and efficiency.



www.LeanSigmaCorporation.com





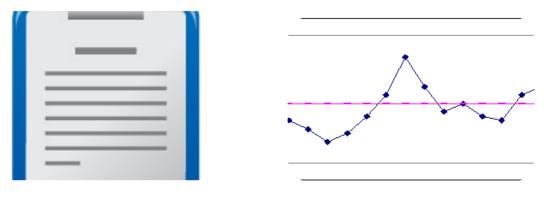

Standardize





## Goals of 5S

- Reduced waste
- Reduced cost
- Establish a work environment that is:
  - self-explaining
  - self-ordering
  - self-regulating
  - self-improving.
  - Where there is/are **no more:** 
    - Wandering and/or searching
    - Waiting or delaying
    - Secret hiding spots for tools
    - Obstacles or detours
    - Extra pieces, parts, materials etc.
    - Injuries



• Waste.

## **Benefits of 5S Systems**

- Reduced changeovers
- Reduced defects
- Reduced waste
- Reduced delays
- Reduced injuries
- Reduced breakdowns
- Reduced complaints
- Reduced red ink
- Higher quality
- Lower costs
- Safer work environment
- Greater associate and equipment capacity.



### Reported Results of 5S Systems

<ul> <li>Cut in floor space:</li> </ul>	60%
<ul> <li>Cut in flow distance:</li> </ul>	80%
<ul> <li>Cut in accidents:</li> </ul>	70%
<ul> <li>Cut in rack storage:</li> </ul>	68%
<ul> <li>Cut in number of forklifts:</li> </ul>	45%
<ul> <li>Cut in machine changeover time:</li> </ul>	62%
<ul> <li>Cut in annual physical inventory time:</li> </ul>	50%
<ul> <li>Cut in classroom training requirements:</li> </ul>	55%
<ul> <li>Cut in nonconformance in assembly:</li> </ul>	96%
<ul> <li>Increase in test yields:</li> </ul>	50%
<ul> <li>Late deliveries:</li> </ul>	0%
<ul> <li>Increase in throughput:</li> </ul>	15%



242

## Sorting (Seiri)



- Go through all the tools, parts, equipment, supply, and material in the workplace.
- Categorize them into two major groups: needed and unneeded.
- Eliminate the unneeded items from the workplace. Dispose of or recycle those items.
- Keep the needed items and sort them in the order of priority. When in doubt...throw it out!



## Straightening (Seiton)



- Straightening in 5S is also called setting in order.
- Label each needed item.
- Store items at their best locations so that the workers can find them easily whenever they needed any item.
- Reduce the motion and time required to locate and obtain any item whenever it is needed.
- Promote an efficient work flow path.
- Use visual aids like the tool board image on this page.



## Shining (Seiso)



• Clean the workplace thoroughly.



- Maintain the tidiness of the workplace.
- Make sure every item is located at the specific location where it should be.
- Create the ownership in the team to keep the work area clean and organized.



### Standardizing (Seiketsu)

- Standardize the workstation and the layout of tools, equipment and parts.
- Create identical workstations with a consistent way of storing the items at their specific locations so that workers can be moved around to any workstation any time and perform the same task.



246

### Sustaining (Shisuke)

- Sustaining in 5S is also called self-discipline.
- Create the culture in the team to follow the first four S's consistently.
- Avoid falling back to the old ways of cluttered and unorganized work environment.
- Keep the momentum of optimizing the workplace.
- Promote innovations of workplace improvement.
- Sustain the first fours S's using:
  - 5S Maps
  - 5S Schedules
  - 5S Job cycle charts
  - Integration of regular work duties
  - 5S Blitz schedules
  - Daily workplace scans.



### Simplified Summary of 5S

- 1. Sort "when in doubt, move it out."
- **2.** Set in Order Organize all necessary tools, parts, and components of production. Use visual ordering techniques wherever possible.
- **3.** Shine Clean machines and/or work areas. Set regular cleaning schedules and responsibilities.
- **4. Standardize** Solidify previous three steps, make 5S a regular part of the work environment and everyday life.
- **5. Sustain** Audit, manage, and comply with established 5S guidelines for your business or facility.



## Five-S (5S)

- A few words about 5S and the Lean Enterprise
  - As a method, 5S generates immediate improvements.
  - 5S is one of many effective lean methods that create observable results.
  - It is tempting to implement 5S alone without considering the entire value stream.
  - However, it is advisable to consider a well-planned lean manufacturing approach to the entire production system.



## 2.0 Measure Phase



### Black Belt Training: Measure Phase

### **2.1 Process Definition**

2.1.1 Cause and Effect Diagrams2.1.2 Cause and Effects Matrix2.1.3 Process Mapping2.1.4 FMEA: Failure Modes & Effects Analysis2.1.5 Theory of Constraints

### 2.2 Six Sigma Statistics

2.2.1 Basic Statistics

- 2.2.2 Descriptive Statistics
- 2.2.3 Distributions and Normality
- 2.2.4 Graphical Analysis

### 2.3 Measurement System Analysis

2.3.1 Precision and Accuracy2.3.2 Bias, Linearity, and Stability2.3.3 Gage R&R2.3.4 Variable and Attribute MSA

### 2.4 Process Capability

2.4.1 Capability Analysis2.4.2 Concept of Stability2.4.3 Attribute and Discrete Capability2.4.4 Monitoring Techniques



252

# 2.1 Process Definition



#### Black Belt Training: Measure Phase

#### **2.1 Process Definition**

2.1.1 Cause and Effect Diagrams2.1.2 Cause and Effects Matrix2.1.3 Process Mapping2.1.4 FMEA: Failure Modes & Effects Analysis2.1.5 Theory of Constraints

#### 2.2 Six Sigma Statistics

2.2.1 Basic Statistics

- 2.2.2 Descriptive Statistics
- 2.2.3 Distributions and Normality
- 2.2.4 Graphical Analysis

2.3 Measurement System Analysis
2.3.1 Precision and Accuracy
2.3.2 Bias, Linearity, and Stability
2.3.3 Gage R&R
2.3.4 Variable and Attribute MSA

# 2.4 Process Capability2.4.1 Capability Analysis2.4.2 Concept of Stability

- 2.4.3 Attribute and Discrete Capability
- 2.4.4 Monitoring Techniques




# 2.1.1 Cause and Effect Diagram



#### What is a Cause and Effect Diagram?

- A cause and effect diagram is also called a *Fishbone Diagram* or *Ishikawa Diagram*. It was created by Kaoru Ishikawa and is used to identify, organize, and display the potential causes of a specific effect or event in a graphical way similar to a fishbone.
- It illustrates the relationship between one specified event (output) and its categorized potential causes (inputs) in a visual and systematic way.

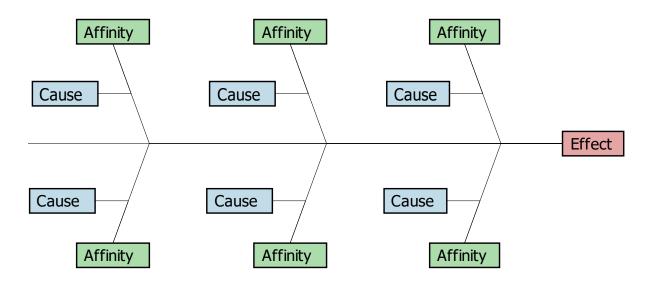



#### **Major Categories of Potential Causes**

- P4ME
  - **People**: People who are involved in the process
  - **Methods**: How the process is completed (e.g., procedures, policies, regulations, laws)
  - Machines: Equipment or tools needed to perform the process
  - Materials: Raw materials or information needed to do the job
  - Measurements: Data collected from the process for inspection or evaluation
  - Environment: Surroundings of the process (e.g., location, time, culture).



- Step 1: Identify and define the effect/event being analyzed.
  - Clearly state the operational definition of the effect/event of interest.
  - The event can be the positive outcome desired or negative problem targeted to solve.
  - Enter the effect/event in the end box of the Fishbone diagram and draw a spine pointed to it.



• Step 1






- Step 2: Brainstorm the potential causes or factors of the effect/event occurring.
  - Identify any factors with a potential impact on the effect/event and include them in this step.
  - Put all the identified potential causes aside for use later.



• Step 2

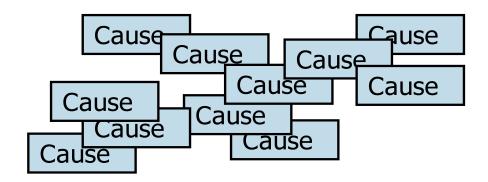




 $\odot$ 

- Step 3: Identify the main categories of causes and group the potential causes accordingly.
  - Besides P4ME (i.e., people, methods, machines, materials, measurements, and environment), you can group potential causes into other customized categories.
  - Below each major category, you can define sub-categories and then classify them to help you visualize the potential causes.
  - Enter each cause category in a box and connect the box to the spine. Link each potential cause to its corresponding cause category.



• Step 3

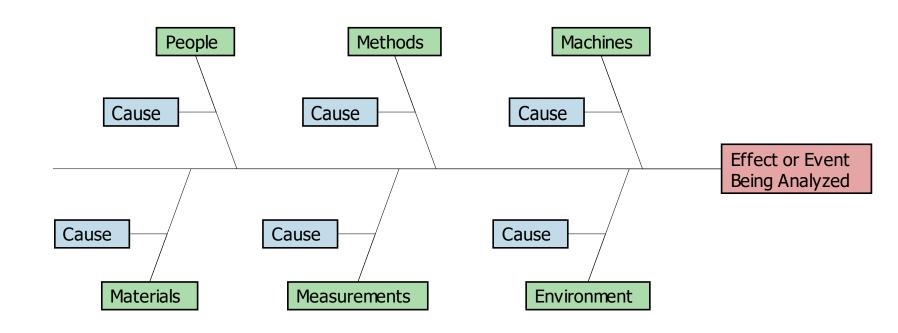



 $\odot$ 

- Step 4: Analyze the cause and effect diagram.
  - A cause and effect diagram includes all the possible factors of the effect/event being analyzed.
  - Use a Pareto chart to filter causes the project team needs to focus on.
  - Identify causes with high impact that the team can take action upon.
  - Determine how to measure causes and effects quantitatively. Prepare for further statistical analysis.



#### Benefits to Using Cause and Effect Diagram

- Helps to quickly identify and sort the potential causes of an effect.
- Provides a systematic way to brainstorm potential causes effectively and efficiently.
- Identifies areas requiring data collection for further quantitative analysis.
- Locates "low-hanging fruit."



## Limitation of Cause and Effect Diagrams

- A cause and effect diagram only provides qualitative analysis of correlation between each cause and the effect.
- One cause and effect diagram can only focus on *one* effect or event at a time.
- Further statistical analysis is required to quantify the relationship between various factors and the effect and identify the root causes.



- Case study:
  - A real estate company is interested to find the root causes of high energy costs of its properties.
  - The cause and effect diagram is used to identify, organize, and analyze the potential root causes.




• Step 1: Identify and define the effect/event being analyzed: high energy costs of buildings.






• Step 2: Brainstorm the potential causes or factors of the high energy costs.

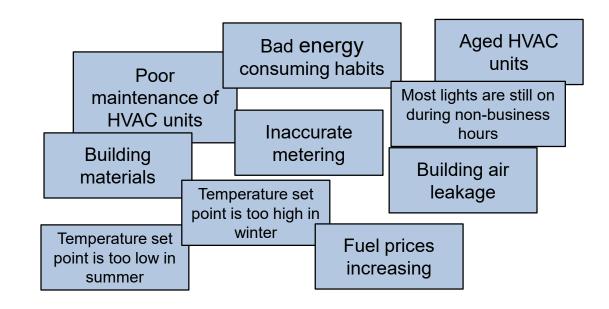



268

• Step 3: Identify the main categories of causes and group the potential causes accordingly.

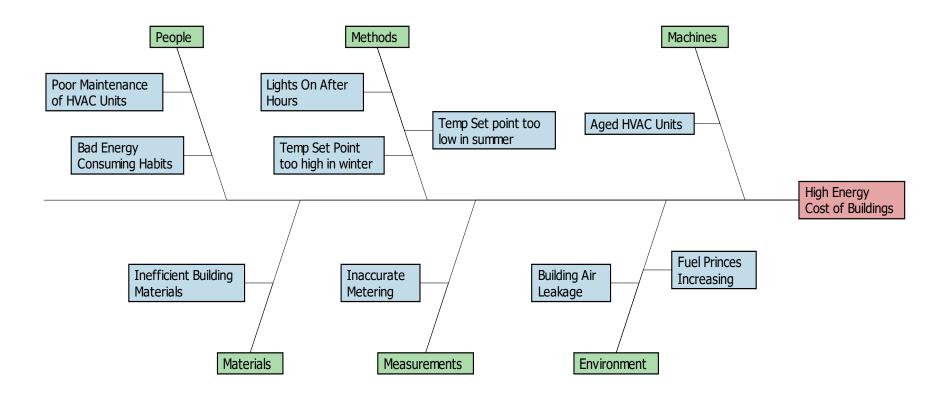



- Step 4: Analyze the cause and effect (C&E) diagram.
  - After completing the C&E diagram, the real estate company conducts further research on each potential root cause.
  - It is discovered that:
    - The utility metering is accurate
    - The building materials are fine and there is not significant amount of air leakage from the building
    - The fuel prices increased recently but were negligible
    - Most lights are off during the non-business hours except that some lights have to be on for security purposes
    - The temperature set points in the summer and winter are both adequate and reasonable
    - The high energy costs are probably caused by the poor HVAC maintenance on aged units and the wasteful energy consuming habits.
- Next, the real estate company needs to collect and analyze the data to check whether root causes identified in the C&E diagram are statistically the causes of the high energy costs.



## 2.1.2 Cause and Effects Matrix



#### What is a Cause and Effect Matrix?

- The **cause and effect matrix** (XY Matrix) is a tool to help subjectively quantify the relationship of several X's to several Y's.
- Among the Y's under consideration, two important ones should be the *primary* and *secondary metrics* of your Six Sigma project.
- The X's should be derived from your cause and effect diagram. Let us take a peek as what it looks like on the next page.



Lean Six Sigma X	Y Matrix
------------------	----------

Date:											
Project:											
XY Matrix Owner:											
Output Measures (Y's)*	Y <sub>1</sub>	Y <sub>2</sub>	Y <sub>3</sub>	Y <sub>4</sub>	Y <sub>5</sub>	Y <sub>6</sub>	Y <sub>7</sub>	Y <sub>8</sub>	Y <sub>9</sub>	Y <sub>10</sub>	
Weighting (1-10):											
Input Variables (X's)#		For each X, score its impact on each Y listed above (use a 0,3,5,7 scale)					Score				
v											0
A1							·	•			0
Λ <sub>1</sub> Χ <sub>2</sub>											
λ <sub>1</sub> X <sub>2</sub> X <sub>3</sub>											0




 $\odot$ 

#### How to Use a Cause and Effect Matrix

- 1. Across the top enter your output measures. These are the Y's that are important to your project.
- 2. Next, give each Y a weight. Use a 1–10 scale, 1 being least important and 10 most important.
- 3. Below, in the leftmost column, enter all the variables you identified with your cause and effect diagram.
- 4. Within the matrix itself, rate the strength of the relationship between the X in the row and the corresponding Y in that column. Use a scale of 0, 3, 5, and 7.
- 5. Lastly, sort the "Score" column to order the most important X's first.



#### **Cause and Effect Matrix Notes**

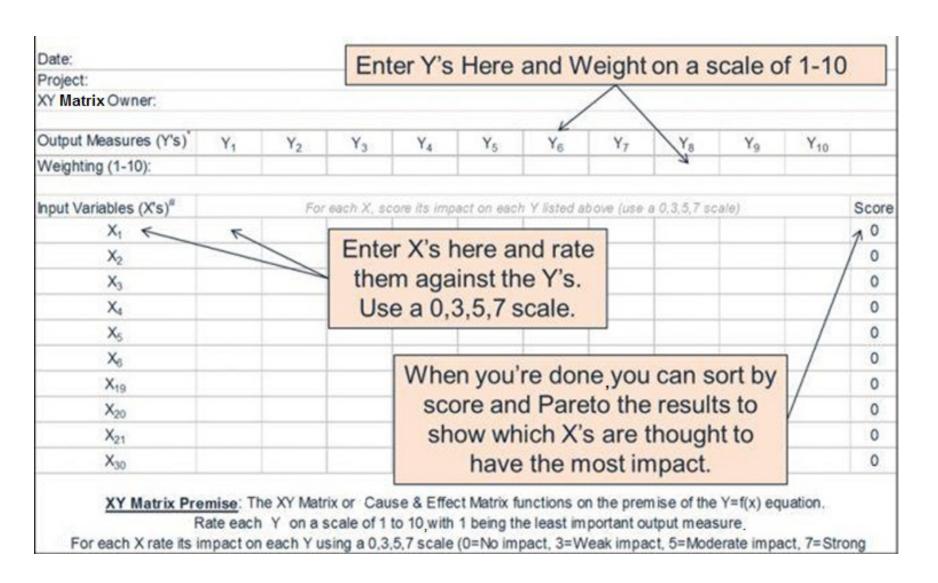

 $\bigcirc$ 

#### After You Have Completed the C&E Matrix

After you have completed your cause and effects matrix, build a strategy for validating and/or eliminating the x's as significant variables to the Y=f(x) equation.

- Build a data collection plan
- Prepare and execute planned studies
- Perform analytics
- Review results with SMEs



• etc.

276

277

# 2.1.3 Process Mapping



#### What is a Process Map?

- **Process mapping** is an important aspect to begin understanding a process. It provides a visual display of the steps required to produce a good or service.
- There are various forms of process mapping techniques that are used in the DMAIC methodology. We have already covered three common and useful maps in our "Process Definition" section of the Define phase:
  - High Level Process Map
  - Detailed Process Map
  - Functional Process Map
- Now we will explore a few other value process mapping techniques:
  - SIPOC
  - Value Stream
  - Spaghetti Diagram
  - Thought Process Map



#### What is SIPOC?

- A SIPOC (Suppliers-Input-Process-Output-Customers) is a high-level visualization tool to help identify and link the different components in a process.
- It is usually applied in the Measure phase in order to better understand the current state of the process and define the scope of the project.



280

## Key Components of a SIPOC

- Suppliers: vendors who provide the raw material, services, and information. Customers can also be suppliers sometimes.
- Input: the raw materials, information, equipment, services, people, environment involved in the process.
- Process: the high-level sequence of actions and decisions that results in the services or products delivered to the customers.
- Output: the services or products delivered to the customers and any other outcomes of the process.



• Customers: the end users or recipients of the services or products.

## How to Plot a SIPOC Diagram

- The first method:
  - Step 1: Create a template that can contain the information of the five key components in a clear way.
  - Step 2: Plot a high-level process map that covers five steps at maximum.
  - Step 3: Identify the outputs of the process.
  - Step 4: Identify the receipt of the process.
  - Step 5: Brainstorm the inputs required to run each process step.
  - Step 6: Identify the suppliers who provide the inputs.



#### How to Plot a SIPOC Diagram

- The second method:
  - Step 1: Create a template that can contain the information of the five key components in a clear way.
  - Step 2: Identify the receipt of the process.
  - Step 3: Identify the outputs of the process.
  - Step 4: Plot a high-level process map that covers five steps at maximum.
  - Step 5: Brainstorm the inputs required to run each process step.
  - Step 6: Identify the suppliers who provide the inputs.



#### **Benefits of SIPOC Diagrams**


- A SIPOC diagram provides more detailed information than process maps and it demonstrates how each component gets involved in the process.
- It helps visualize and narrow the project scope.
- It serves as a great communication tool to help different process owners understand the entire process, their specific roles and responsibilities.



#### SIPOC Diagram Example

......


 Example of plotting a SIPOC diagram for Mom cooking scrambled eggs for two kids

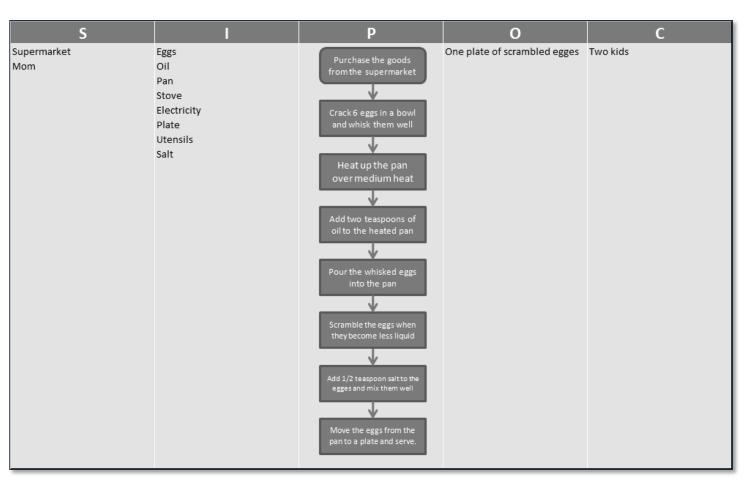



## Creating a SIPOC

- Step 1: Vertically List High-Level Process
  - If you followed the general rules for a high-level process map, then you should have no more than 4–6 steps for your process.
  - List those steps in a vertical manner as depicted below.

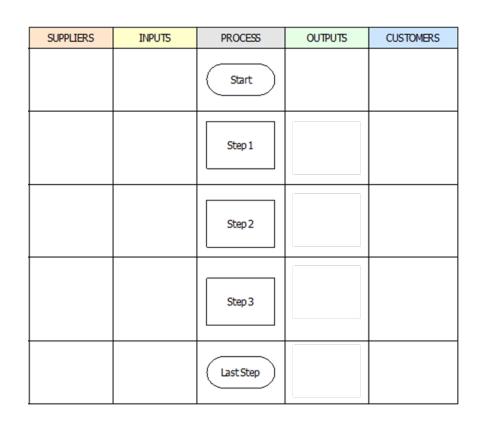



Step 2: List Process Outputs

SUPPLIERS	INPUTS	PROCESS	OUTPUTS	CUSTOMERS
		Start		
		Step 1	Enter Step 1 Outputs	
		Step 2	Enter Step 2 Outputs	
		Step 3	Enter Step 3 Outputs	
		Last Step	Enter Step 4 Outputs	



 $\odot$ 

• Step 3: List Output Customers

SUPPLIERS	INPUTS	PROCESS	OUTPUTS	CUSTOMERS
		Start		
		Step 1	Enter Step 1 Outputs	Enter Step 1 Customers
		Step 2	Enter Step 2 Outputs	Enter Step 2 Customers
		Step 3	Enter Step 3 Outputs	Enter Step 3 Customers
		Last Step	Enter Step 4 Outputs	Enter Step 4 Customers





• Step 4: List Process Inputs

SUPPLIERS	INPUTS	PROCESS	OUTPUTS	CUSTOMERS
		Start		
	Enter Step 1 Inputs	Step 1	Enter Step 1 Outputs	Enter Step 1 Customers
	Enter Step 2 Inputs	Step 2	Enter Step 2 Outputs	Enter Step 2 Customers
	Enter Step 3 Inputs	Step 3	Enter Step 3 Outputs	Enter Step 3 Customers
	Enter Step 4 Inputs	Last Step	Enter Step 4 Outputs	Enter Step 4 Customers



• Step 5: List Suppliers of Inputs

SUPPLIERS	INPUTS	PROCESS	OUTPUTS	CUSTOMERS
		Start		
Enter Step 1	Enter Step 1	Step 1	Enter Step 1	Enter Step 1
Suppliers	Inputs		Outputs	Customers
Enter Step 2	Enter Step 2	Step 2	Enter Step 2	Enter Step 2
Suppliers	Inputs		Outputs	Customers
Enter Step 3	Enter Step 3	Step 3	Enter Step 3	Enter Step 3
Suppliers	Inputs		Outputs	Customers
Enter Step 4	Enter Step 4	Last Step	Enter Step 4	Enter Step 4
Suppliers	Inputs		Outputs	Customers



www.LeanSigmaCorporation.com

### **SIPOC Benefits**

- Visually communicate project scope
- Identify key inputs and outputs of a process
- Identify key suppliers and customers of a process
- Verify:
  - Inputs match outputs for upstream processes
  - Outputs match inputs for downstream processes.
- This type of mapping is effective for identifying opportunities for improvement of your process.
- If you have completed your high-level process map, follow the outlined steps to create a process map of Suppliers, Inputs, Process, Outputs, and Customer.




www.LeanSigmaCorporation.com

## What is Value Stream Mapping?

- Value stream mapping is a method to visualize and analyze the path of how information and raw materials are transformed into products or services customers receive.
- It is used to identify, measure, and decrease the non-value-adding steps in the current

process.

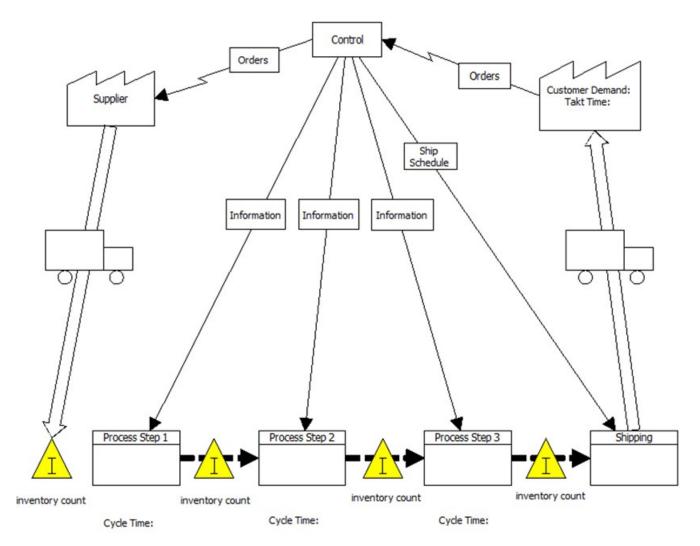



#### **Non-Value-Added Activities**

- Non-value-adding activities are activities in a process that do not add any other value to the products or services customers demand.
- Example of non-value-adding activities:
  - Rework
  - Overproduction
  - Excess transportation
  - Excess stock
  - Waiting
  - Unnecessary motion.
- Not all non-value-adding activities are unnecessary.



## How to Plot a Value Stream Map

- Plot the entire high-level process flow from when the customer places the order to when the customer receives the products or services in the end.
- A value stream map requires more detailed information for each step than the standard process map.
  - Cycle time
  - Preparation time
  - Actual working time
  - Available time
  - Scrap rate
  - Rework rate
  - Number of operators
- Assess the value stream map of current process, identity and eliminate the waste.



## Spaghetti Chart

- A **spaghetti chart** is a graphical tool to map out the physical flow of materials, information, and people involved in a process. It can also reflect the distances between multiple workstations the physical flow has been through.
- A process that has not been streamlined has messy and wasteful movements of materials, information, and people, resembling a bowl of cooked spaghetti.




#### How to Plot a Spaghetti Chart

- Step 1: Create a map of the work area layout.
- Step 2: Observe the current work flow and draw the actual work path from the very beginning of work to the end when products exit the work area.
- Step 3: Analyze the spaghetti chart and identify improvement opportunities.



#### Spaghetti Chart Example

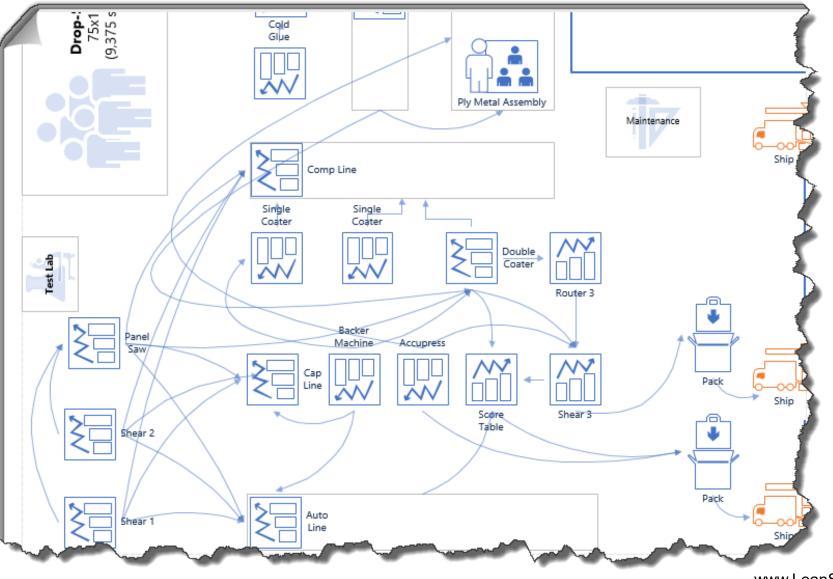



www.LeanSigmaCorporation.com

296

Lean Six Sigma Training - JMP

© Lean Sigma Corporation

### **Thought Process Mapping**

- A thought process map is a graphical tool to help brainstorm, organize, and visualize the information, ideas, questions, or thoughts regarding reaching the project goal.
- It's a popular tool often used at the beginning of a project in order to:
  - identify knowns and unknowns
  - communicate assumptions and risks
  - discover potential problems and solutions
  - identify resources, information, and actions required to meet the goal
  - present relationship of thoughts.




## How to Plot a Thought Process Map

- Step 1: Define the project goal.
- Step 2: Brainstorm knowns and unknowns about the project.
- Step 3: Brainstorm questions and group the unknowns and questions into five phases (Define, Measure, Analyze, Improve, and Control).
- Step 4: Sequence the questions below the project goal and link the related questions.
- Step 5: Identify tools or methods that would be used to answer the questions.



#### **Thought Process Map Example**

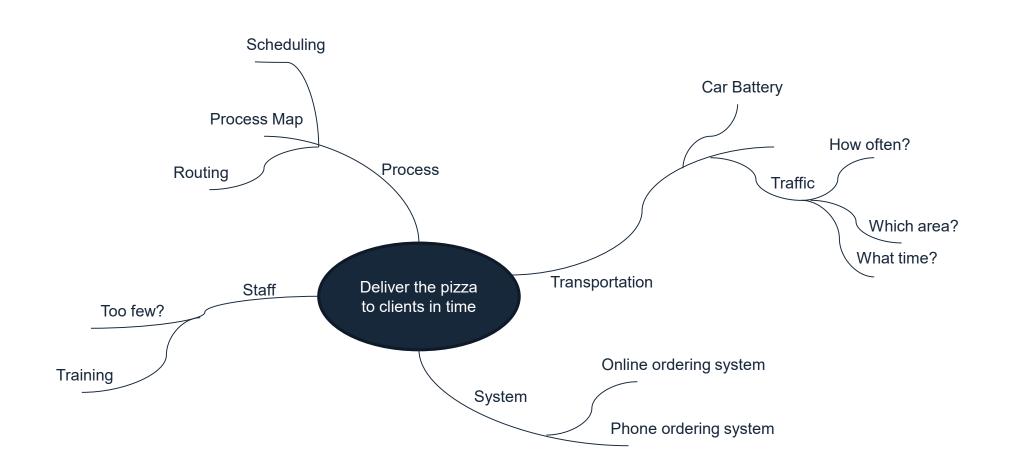



299



2.1.4 FMEA

## What is FMEA?

• The FMEA (Failure Modes and Effects Analysis) is an analysis technique to identify, evaluate, and prioritize a potential deficiency in a process so that the project team can design action plans to reduce the probability of the failure/deficiency occurring.

#### Failure Modes & Effects Analysis - FMEA

Product or Process Step	Potential Failure Mode	Potential Failure Effects	S	Potential Causes	0	Current Controls	D	R P N	Recommended Actions	Responsible	Actions Taken	S	0	D	R P N
								0							0
								0							0
								<b>0</b>			·				0
	°							•							0
								•			·				0
	*							•							0
								0			·				0

• FMEA is completed in cross-functional brainstorming sessions in which attendees have a good understanding of the entire process or of a segment of it.



#### **Basic FMEA Terms**

#### Process Functions

 Process steps depicted in the process map. FMEA is based on a process map and one step/function is analyzed at a time.

#### Failure Modes

 Potential and actual failure in the process function/step. It usually describes the way in which failure occurs. There might be more than one failure mode for one process function.

#### Failure Effects

 Impact of failure modes on the process or product. One failure mode might trigger multiple failure effects.

#### Failure Causes

• Potential defect of the design that might result in the failure modes occurring. One failure mode might have multiple potential failure causes.

#### Current Controls

• Procedures currently conducted to prevent failure modes from happening or to detect the failure mode occurring.



#### **Basic FMEA Terms**

#### Severity Score

- The seriousness of the consequences of a failure mode occurring.
- Ranges from 1 to 10, with 10 indicating the most severe consequence.

#### Occurrence Score

- The frequency of the failure mode occurring.
- Ranges from 1 to 10, with 10 indicating the highest frequency.

#### Detection Score

- How easily failure modes can be detected.
- Ranges from 1 to 10, with 10 indicating the most difficult detection.



#### **Basic FMEA Terms**

#### RPN (Risk Prioritization Number)

- The product of the severity, occurrence, and detection scores.
- Ranges from 1 to 1000.
- The higher RPN is, the more focus the particular step/function needs.

#### Recommended Actions

 The action plan recommended to reduce the probability of failure modes occurring.



305

## How to Conduct an FMEA

- Step 1: List the critical functions of the process based on the process map created.
- Step 2: List all potential failure modes that might occur in each function. One function may have multiple potential failures.
- Step 3: List all potential failure effects that might affect the process or product.
- Step 4: List all possible causes that may lead to the failure mode happening.
- Step 5: List the current control procedures for each failure mode.

## How to Conduct an FMEA

- Step 6: Determine the severity rating for each potential failure mode.
- Step 7: Determine the occurrence rating for each potential failure cause.
- Step 8: Determine the detection rating for each current control procedure.
- Step 9: Calculate RPN (Risk Prioritization Number).
- Step 10: Rank the failures using RPN and determine the precedence of problems or critical inputs of the process. A Pareto chart might help to focus on the failure modes with high RPNs. The higher the RPN, the higher the priority the correction action plan.



## How to Conduct an FMEA

- Step 11: Brainstorm and create recommended action plans for each failure mode.
- Step 12: Determine and assign the task owner and projected completion date to take actions.
- Step 13: Determine the new severity rating if the actions are taken.
- Step 14: Determine the new occurrence rating if the actions are taken.
- Step 15: Determine the new detection rating if the actions are taken.
- Step 16: Update the RPN based on new severity, occurrence, and detection ratings.



Case study:

- Joe is trying to identify, analyze, and eliminate the failure modes he experienced in the past when preparing his work bag before heading to the office every morning. He decides to run an FMEA for his process of work bag preparation.
- There are only two steps involved in the process.
  - Putting the work files in the bag
  - Putting a water bottle in the bag.



• Step 1: List the critical functions of the process based on the process map created.

Product or Process Step	Potential Failure Mode	Potential Failure Effects
Place files in bag		
Put water bottle in bag		

• Step 2: List all the potential failure modes for each function.

Product or Process Step	Potential Failure Mode	Potential Failure Effects
Place files in bag	Incorrect files put in the bag	
Put water bottle in bag	Water leaks	

• Step 3: List potential failure effects that might affect the process.

Product or Process Step	Potential Failure Mode	Potential Failure Effects
Place files in bag	Incorrect files put in the bag	Work is delyed
Put water bottle in bag	Water leaks	Files in bag damaged



• Step 4: List all possible causes to the failure mode.

Potential Failure Effects	S	Potential Causes	0
Work is delyed		Files are not organized well	
Files in bag damaged		Cap on water bottle not tight	

• Step 5: List any control procedures for each failure mode.



• Step 6: Determine the severity rating for each failure mode.

Potential Failure Effects	S	Potential Causes	0	Current Controls
Work is delyed	9	Files are not organized well		Check if files are needed
Files in bag damaged	7	Cap on water bottle not tight		Check bottle cap before inserting



• Step 7: Determine the occurrence rating for each failure cause.

Potential Failure Effects	S	Potential Causes	0	Current Controls
Work is delyed	9	Files are not organized well	3	Check if files are needed
Files in bag damaged	7	Cap on water bottle not tight	5	Check bottle cap before inserting

• Step 8: Determine the detection rating for each control.

S	Potential Causes	0	Current Controls	D	R P N
9	Files are not organized well	3	Check if files are needed	5	135
7	Cap on water bottle not tight	5	Check bottle cap before inserting	5	175


• Step 9: Calculate the RPN (Risk Prioritization Number).

S	Potential Causes	0	Current Controls	D	R P N
9	Files are not organized well	3	Check if files are needed	5	135
7	Cap on water bottle not tight	5	Check bottle cap before inserting	5	175



#### www.LeanSigmaCorporation.com

• Step 10: Rank the failures using the RPN and determine the precedence of problems or critical inputs of process.

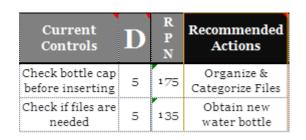

- Step 11: Brainstorm and create recommended action plans.
- Step 12: Determine and assign owners with completion dates.

D	R P N	Recommended Actions	Responsible
5	175	Organize & Categorize Files	Joe
5	135	Obtain new water bottle	Joe



 Steps 13-15: Determine new severity, occurrence and detection ratings if actions are taken.

Recommend Actions	ed Responsible	Actions Taken S	01	) R P N						
Organize & Categorize Fil	Joe			0						
Obtain nev water bottl	Recommended Actions	Responsible	Actions Taken	S	0	D	R P N			
	Organize & Categorize Files	Joe					0			
	Obtain new water bottle	Recommende Actions	ed Resp	onsib	le <sup>A</sup>	ctions Faken	S	0	D	R P N
		Organize & Categorize File	es	Joe						0
		Obtain new water bottle		Joe						0

• Step 16: Update RPN based on new ratings.

Recommended Actions	Responsible	Actions Taken	S	O D	R P N
Organize & Categorize Files	Joe				0
Obtain new water bottle	Joe				0







#### What is the Theory of Constraints?

- Processes, systems, and organizations are vulnerable to their weakest part.
- Any manageable system is limited by constraints in its ability to produce more (and there is always at least one constraint).






#### **Performance Measures**

Making sound financial decisions based on these three measures is a critical requirement.

- Throughput rate at which a system generates money through sales.
- Operational Expense money spent by the system to turn inventory into throughput.
- **Inventory** money the system has invested in purchasing things it intends to sell.

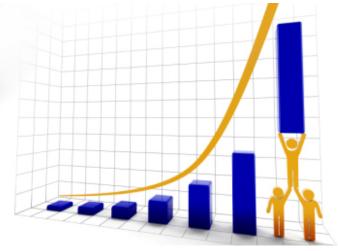



## Five Focusing Steps

*Objective:* To ensure ongoing improvement efforts are focused on the constraints of a system.

- 1. Identify the system's constraint(s).
- 2. Decide how to exploit the constraint(s).
- 3. Subordinate everything else to the decision in step 2.
- 4. Elevate the constraint(s).
- 5. If in previous steps a constraint has been broken, return to step 1, but do not allow inertia to cause a system's constraint.





## Logical Thinking Processes

	Focusing Step	Thinking Process	Tools		
1	Identify the system's constraint(s)	<ul><li> Identify the problems</li><li> Find the root causes</li></ul>	Cause and effect diagram		
2	Decide how to exploit the constraint(s)	• Develop a solution	Future reality tree		
3	Subordinate everything else to the decision in step 2	<ul><li> Identify the conflict preventing the solution</li><li> Remove the conflict</li></ul>	Evaporating cloud		
4	Elevate the constraint	<ul> <li>Construct and execute an implementation plan</li> </ul>	Prerequisite tree Transition tree		
5	If in previous steps a constraint has been broken, return to step 1, but do not allow inertia to cause a system's constraint				



318

#### **Simulation Exercise**

Resources needed:

- 3 "production line" participants
- 1 timer per each "production line" participant
- 5 small boxes of 15 widgets each (paperclips, pens/pencils, candy, etc.)

#### Widget Value Chain:





### **Simulation Exercise**

Widget Value Chain:



Five focusing steps:

- 1. Identify the system's constraint(s).
- 2. Decide how to exploit the constraint(s). Quick improvements. Use what you have.
- 3. Subordinate everything else to the decision in step 2.
- 4. Elevate the constraint(s). If more improvement is needed, what actions are required?
- 5. If in previous steps a constraint has been broken, return to step 1, but do not allow inertia to cause a system's constraint.



320

 $\bigcirc$ 

## 2.2 Six Sigma Statistics



## Black Belt Training: Measure Phase

# 2.1 Process Definition 2.1.1 Cause and Effect Diagrams 2.1.2 Cause and Effects Matrix 2.1.3 Process Mapping 2.1.4 FMEA: Failure Modes & Effects Analysis 2.1.5 Theory of Constraints

#### 2.2 Six Sigma Statistics

2.2.1 Basic Statistics

- 2.2.2 Descriptive Statistics
- 2.2.3 Distributions and Normality
- 2.2.4 Graphical Analysis

2.3 Measurement System Analysis
2.3.1 Precision and Accuracy
2.3.2 Bias, Linearity, and Stability
2.3.3 Gage R&R
2.3.4 Variable and Attribute MSA

#### 2.4 Process Capability

2.4.1 Capability Analysis2.4.2 Concept of Stability2.4.3 Attribute and Discrete Capability2.4.4 Monitoring Techniques



## 2.2.1 Basic Statistics



#### What is Statistics?

- **Statistics** is the science of collection, analysis, interpretation, and presentation of data.
- In Six Sigma, we apply statistical methods and principles to quantitatively measure and analyze the process performance to reach statistical conclusions and help solve business problems.



# Types of Statistics

- Descriptive Statistics
  - Describing what was going on
- Inferential Statistics
  - Making inferences from the data at hand to more general conditions



#### **Descriptive Statistics**

- **Descriptive statistics** is applied to describe the main characteristics of a collection of data.
- Descriptive statistics summarizes the features of the data quantitatively.
- Descriptive statistics is descriptive only and it does not make any generalizations beyond the data at hand.
- The data used for descriptive statistics are for the purpose of representing or reporting.



#### **Inferential Statistics**

- Inferential statistics is applied to infer the characteristics or relationships of the populations from which the data are collected.
- Inferential statistics draws statistical conclusions about the population by analyzing the sample data subject to random variation.
- A complete data analysis includes both descriptive statistics and inferential statistics.



#### Statistics vs. Parameters

- The word *statistic* refers to a numeric measurement calculated using a sample data set, for example, sample mean or sample standard deviation. Its plural is *statistics* (the same spelling as "statistics" which refers to the scientific discipline).
- The *parameter* refers to a numeric metric describing the population, for example, population mean and population standard deviation. Unless you have the full data set of the population, you will not be able to know the population parameters.



# Continuous Variable vs. Discrete Variable

- Continuous Variable
  - Measured
  - There is an infinite number of values possible
  - Examples: temperature, height, weight, money, time
- Discrete Variable
  - Counted
  - There is a finite number of values available
  - Examples: count of people, count of countries, count of defects, count of defectives



# Types of Data

- Nominal
  - Categorical data
  - Examples: a set of colors, the social security number
- Ordinal
  - Rank-ordering data
  - Examples: the first, second place in a race, scores of exams
- Interval
  - Equidistant data
  - Examples: temperature with Fahrenheit or Celsius scale
- Ratio
  - The ratio between the magnitude of a continuous value and the unit value of the same category
  - Examples: weight, length, time



# 2.2.2 Descriptive Statistics



# **Basics of Descriptive Statistics**

- Descriptive statistics provides a quantitative summary for the data collected.
- It summarizes the main features of the collection of data.
  - Shape
  - Location
  - Spread
- It is a presentation of data collected and it does *not* provide any inferences about a more general condition.



#### Shape of the Data

- Distribution is used to describe the shape of the data.
- Distribution (also called frequency distribution) summarizes the frequency of an individual value or a range of values of a variable (either continuous or discrete).
- Distribution is depicted as a table or graph.



### Shape of the Data

- Simple example of distribution
  - We are tossing a fair die. The possible value we obtain from each tossing is a value between 1 and 6.
  - Each value between 1 and 6 has a 1/6 chance to be hit for each tossing.
  - The distribution of this game describes the relationship between every possible value and the percentage of times the value is being hit (or count of times the value is being hit).



# Shape of the Data

- Examples of continuous distribution
  - Normal Distribution
  - T distribution
  - Chi-square distribution
  - F distribution
- Examples of discrete distribution
  - Binomial distribution
  - Poisson distribution



#### Location of the Data

- The **location** (i.e. central tendency) of the data describes the value where the data tend to cluster around.
- There are multiple measurements to capture the location of the data:
  - Mean
  - Median
  - Mode.



• The mean is the arithmetic average of a data set.

$$\overline{x} = \frac{1}{n} \sum_{i=1}^{n} x_i$$

*n* is the number of values in the data set

• For example, we have a set of data: 2, 3, 5, 8, 5, and 9. The arithmetic mean of the data set is

$$\frac{2+3+5+8+5+9}{6} = 5.33$$



337

#### Median

- The median is the middle value of the data set in numeric order.
- It separates the finite set of data into two parts: one with values higher that the median and the other with values lower than the median.
- For example, we have a set of data: 45, 32, 67, 12, 37, 54, and 28. The median is 37 since it is the middle value of the sorted list of values (i.e., 12, 28, 32, 37, 45, 54, and 67).



- The mode is the value that occurs most often in the data set.
- If no number is repeated, there is no mode for the data set.
- For example, we have a data set: 55, 23, 45, 45, 68, 34, 45, 55. The mode is 45 since it occurs most frequently.



#### Spread of the Data

- The **spread** (i.e. variation) of the data describes the degree of data dispersing around the center value.
- There are multiple measurements to capture the spread of the data:
  - Range
  - Variance
  - Standard Deviation.





- The **range** is the numeric difference between the greatest and smallest values in a data set.
- Only two data values (i.e., the greatest and the smallest values) are accounted for calculating the range.
- For example, we have a set of data: 34, 45, 23, 12, 32, 78, and 23. The range of the data is 78–12 = 66.



#### Variance

- The **variance** measures how far on average the data points spread out from the mean.
- It is the average squared deviation of each value from its mean.
- It is the square of the sample standard deviation.
- All the data points are accounted for calculating the variance.

$$s^{2} = \frac{1}{n} \sum_{i=1}^{n} (x_{i} - \overline{x})^{2}$$

where

*n* is the number of values in the data set

$$\overline{x} = \frac{1}{n} \sum_{i=1}^{n} x_i$$



#### **Standard Deviation**

- **Standard deviation** describes how far the data points spread away from the mean.
- It has the same measurement units as the data itself.
- It is simply the square root of the variance.
- All the data points are accounted for calculating the standard deviation.

$$s = \sqrt{\frac{1}{n} \sum_{i=1}^{n} (x_i - \overline{x})^2}$$

where

*n* is the number of values in the data set

$$\overline{x} = \frac{1}{n} \sum_{i=1}^{n} x_i$$



343

# 2.2.3 Normal Distribution & Normality



www.LeanSigmaCorporation.com

# What is Normal Distribution?

- The **normal distribution** is a probability distribution of a continuous random variable whose values spread symmetrically around the mean.
- A normal distribution can be completely described by using its mean ( $\mu$ ) and variance ( $\sigma^2$ ).
- When a variable x is normally distributed, we denote  $x \sim N(\mu, \sigma^2)$ .



### Z Distribution

- The **Z distribution** is the simplest normal distribution with the mean equal to zero and the variance equal to one.
- Any normal distribution can be transferred to a Z distribution by applying

$$z = \frac{x - \mu}{\sigma}$$

where

$$x \sim N(\mu, \sigma^2) \qquad \sigma \neq 0$$



#### Z Score

- The **Z Score** is the measure of how many standard deviations an observation is above or below the mean.
- Positive Z Scores indicate the observation is above the mean or "right of the mean".
- Negative Z Scores indicate the observation is below the mean of "left of the mean"
- Calculate Z Score using the formula below:

$$z = \frac{x - \mu}{\sigma}$$

#### where

X is the observation


- $\mu$  is the mean of the population
- $\sigma$  is the standard deviation of the population



347

# Shape of Normal Distribution

- The probability density function curve of normal distribution is bellshaped.
- Probability density function of normal distribution

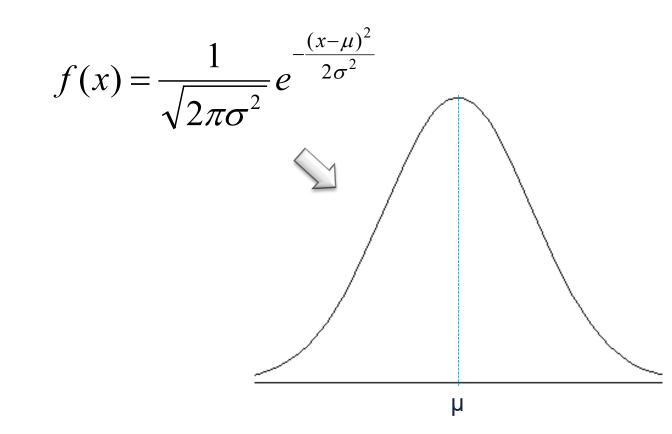



# Location of Normal Distribution

- If a variable is normally distributed, the mean, the median, and the mode have the same value.
- The probability density curve of normal distribution is symmetric around a center value which is the mean, the median, and the mode at the same time.



# Spread of Normal Distribution


- The spread or variation of the normally-distributed data can be described using the variance or the standard deviation.
- The smaller the variance or the standard deviation, the less variability in the data set.



# **Empirical Rule**

- The 68-95-99.7 rule or the *empirical rule in statistics* states that for a normal distribution:
  - About 68% of the data fall within one standard deviation of the mean
  - About 95% of the data fall within two standard deviations of the mean
  - About 99.7% of the data fall within three standard deviations of the mean.



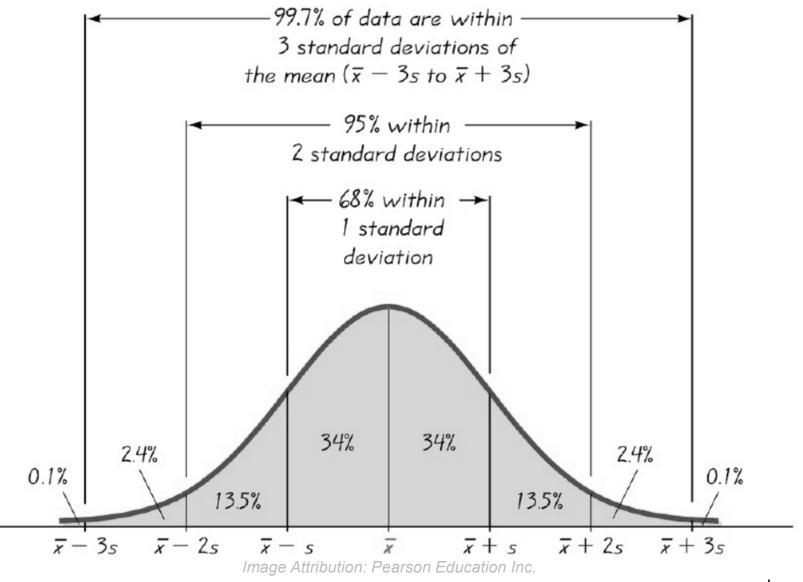



www.LeanSigmaCorporation.com

352

Lean Six Sigma Training - JMP

0

Lean Sigma Corporation

# Normality

- Not all the distributions with a bell shape are normal distributions.
- To check whether a group of data points are normally distributed, we need to run a *normality test*.
- There are different normality tests available:
  - Anderson-Darling test
  - Sharpiro-Wilk test
  - Jarque-Bera test.
- More details of normality test will be introduced in the Analyze module.



# **Normality Testing**

- To check whether the population of our interest is normally distributed, we need to run normality test.
  - Null Hypothesis (H<sub>0</sub>): The data points *are* normally distributed.
  - Alternative Hypothesis ( $H_a$ ): The data points are *not* normally distributed.
- There are many normality tests available. For example, Anderson-Darling test, Sharpiro-Wilk test, Jarque-Bera test, and so on.



- Case study: we are interested to know whether the height of basketball players is normally distributed.
  - Data File: "OneSampleT-Test.jmp"
- Null Hypothesis (H0): the height of basketball players is normally distributed.
- Alternative Hypothesis (Ha): the height of basketball players is not normally distributed.




- Steps to run a normality test in JMP
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "HtBk" in the Distribution page
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"



E Distribution - JMP			
The distribution of values in each column			
Select Columns	Cast Selected Columns into Roles		Action —
<ul> <li>Columns</li> <li>HtBk</li> </ul>	Y, Columns	<mark>⊿ H</mark> tBk	ОК
Histograms Only	Weight	optional numeric	Cancel
	Freq	optional numeric	
	Ву	optional	Remove
			Recall
			Help
			▲ □ ▼



- Null Hypothesis (H0): The data are normally distributed.
- Alternative Hypothesis (Ha): The data are not normally distributed.
- Since the p-value of the normality is 0.3197 greater than alpha level (0.05), we fail to reject the null and claim that the data are normally distributed.

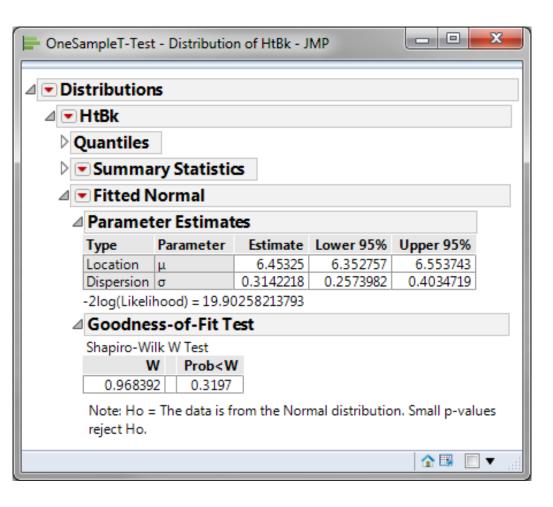



# 2.2.4 Graphical Analysis



### What is Graphical Analysis?

- In statistics, **graphical analysis** is a method to visualize the quantitative data.
- Graphical analysis is used to discover the structure and patterns in the data, explaining and presenting the statistical conclusions.
- A complete statistical analysis includes both quantitative analysis and graphical analysis.



## **Graphical Analysis Example**

- There are various graphical analysis tools available. Here are four most commonly used examples:
  - Box Plot
  - Histogram
  - Scatter Plot
  - Run Chart.




#### **Box Plot**

- A box plot is a graphical method to summarize a data set by visualizing the minimum value, 25<sup>th</sup> percentile, median, 75<sup>th</sup> percentile, the maximum value, and potential outliers.
- A percentile is the value below which a certain percentage of data fall.
   For example, if 75% of the observations have values lower than 685 in a data set, then 685 is the 75<sup>th</sup> percentile of the data.



#### **Box Plot**

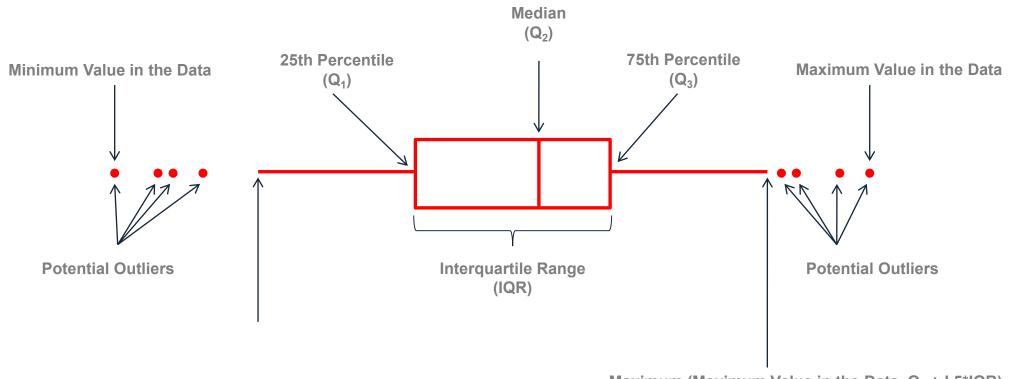

Minimum (Minimum Value in the Data,  $Q_1 - I.5*IQR$ )

Maximum (Maximum Value in the Data,  $Q_3 + I.5*IQR$ )

Interquartile Range = 75<sup>th</sup> Percentile – 25<sup>th</sup> Percentile



#### How to Use JMP to Generate a Box Plot

- Data File: "Box Plot.jmp"
- Steps to render a Box Plot in JMP
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - Click on the red triangle button next to "HtBk" 4.
  - Uncheck Histogram Options -> Vertical 5.




#### How to Use JMP to Generate a Box Plot

E Distribution - JMP						
The distribution of values in each column						
Select Columns	Cast Selected Columns into Roles —	Action —				
1 Columns	Y, Columns 4 HtBk	ОК				
	Weight optional numeric	Cancel				
Histograms Only	Freq optional numeric					
	By optional	Remove				
		Recall				
	L	Help				



 $\odot$ 

#### How to Use JMP to Generate a Box Plot

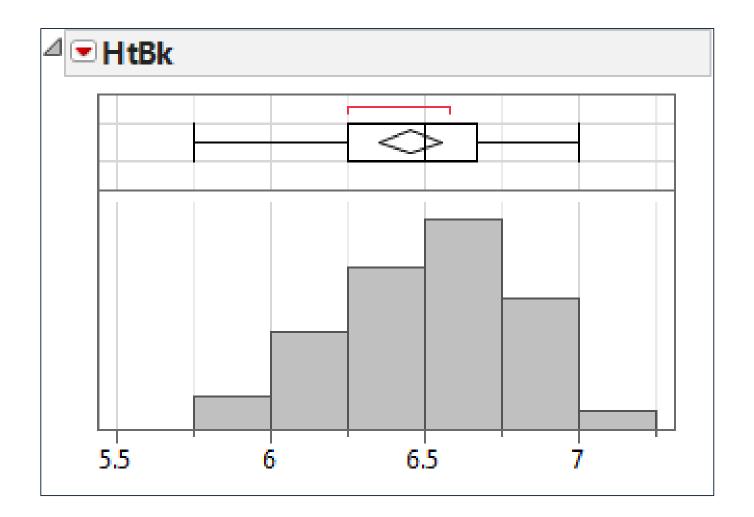



366

 $\odot$ 

#### Histogram

- A histogram is a graphical tool to present the distribution of the data.
- The X axis represents the possible values of the variable and the Y axis represents the frequency of the value occurring.
- A histogram consists of adjacent rectangles erected over intervals with heights equal to the frequency density of the interval.
- The total area of all the rectangles in a histogram is the number of data values.




## Histogram

- A histogram can also be normalized. In this case, the X axis still represents the possible values of the variable, but the Y axis represents the percentage of observations that fall into each interval on the X axis.
- The total area of all the rectangles in a normalized histogram is 1.
- With the histogram, we have a better understanding of the shape, location, and spread of the data.



#### Histogram

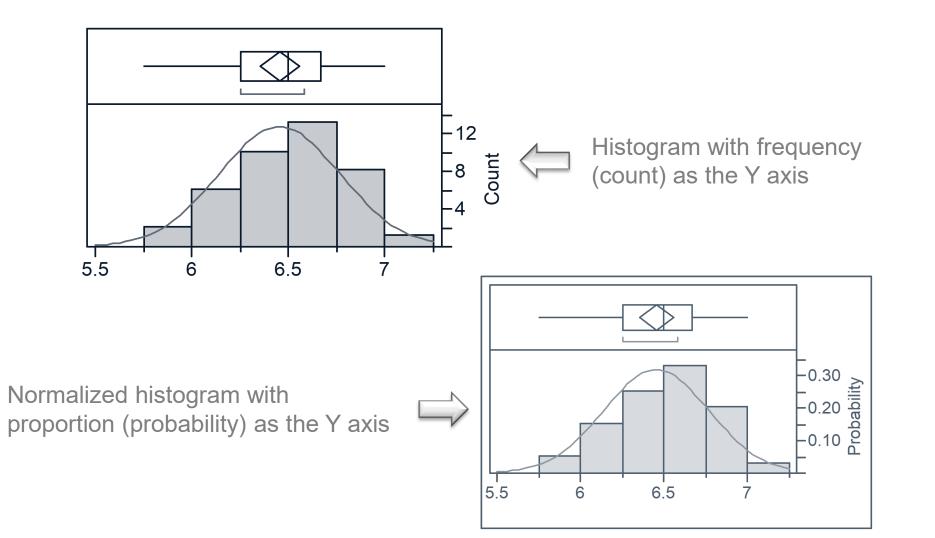





© Lean Sigma Corporation

370

### How to Use JMP to Generate a Histogram

- Data File: "Histogram.jmp"
- Steps to render a Box Plot in JMP
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "HtBk"
  - 5. Uncheck Histogram Options -> Vertical



#### How to Use JMP to Generate a Histogram


E Distribution - JMP						
The distribution of values in each column						
Select Columns	- Cast Selected Columns into Role	sAction				
1 Columns	Y, Columns	ОК				
	Weight optional numeric	Cancel				
Histograms Only	Freq optional numeric					
	By optional	Remove				
		Recall				
		Help				
		🟠 🔲 ▼ 📑				



371

 $\odot$ 

## How to Use JMP to Generate a Histogram

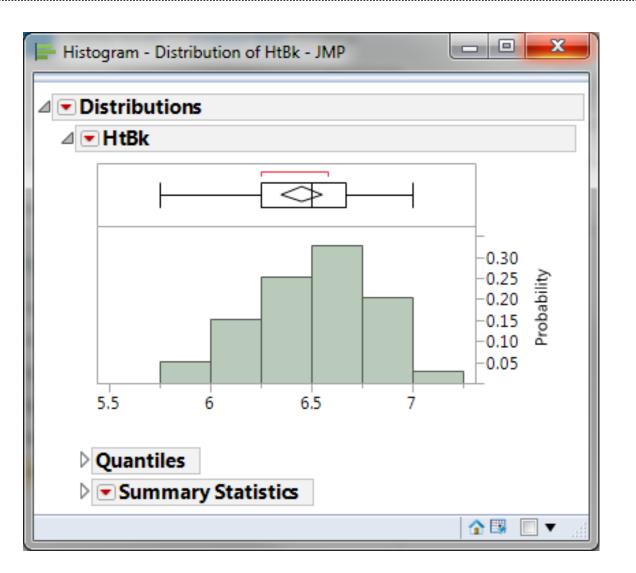



 $\odot$ 

#### **Scatter Plot**

- A scatter plot is a diagram to present the relationship between two variables of a data set.
- A scatter plot consists of a set of data points.
- On the scatter plot, a single observation is presented by a data point with its horizontal position equal to the value of one variable and its vertical position equal to the value of the other variable.



#### **Scatter Plot**

- A scatter plot helps to understand:
  - Whether the two variables are related to each other or not
  - How is the strength of their relationship
  - What is the shape of their relationship
  - What is the direction of their relationship
  - Whether outliers are present.



#### How to Use JMP to Generate a Scatter Plot

- Data File: "Scatter Plot.jmp"
- Steps to render a Scatterplot in JMP:
  - 1. Click Analyze -> Fit Y by X
  - 2. Select MPG as the "Y, Response" and weight as the "X, Factor"
  - 3. Click "OK"




#### How to Use JMP to Generate a Scatter Plot

$\frac{y_x}{x}$ Fit Y by X - Contextual - JMP						
Distribution of Y for each X. Modeling types determine analysis.						
- Select Columns	Cast Selected Colur	Action —				
2 Columns	Y, Response 🖉 M	1PG	ОК			
MPG	optic	onal	Cancel			
Weight	X, Factor	/eight				
Bivariate	opti	onal				
φφ <sup>φ</sup>	Block	onal	Remove			
	Weight option	onal numeric	Recall			
Bivariate Oneway		onal numeric	Help			
	By optio	onal				
Logistic Contingency						
▲ ▲ ▲	·					
			🟠 🔲 🔻 🔡			



 $\odot$ 

#### How to Use JMP to Generate a Scatter Plot

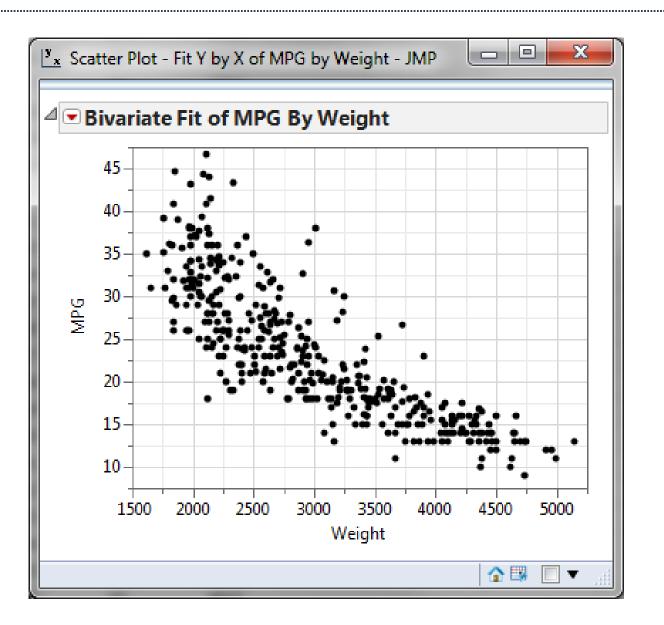



 $\odot$ 

www.LeanSigmaCorporation.com

#### Run Chart

- A **run chart** is a chart used to present the data in time order. It captures the process performance over time.
- The X axis of the run chart indicates the time and the Y axis indicates the observed values.
- Run chart looks similar to control charts except that a run chart does not have control limits plotted. It is easier to produce a run chart than a control chart.
- It is often used to identify the anomalies in the data and discover the pattern of data changing over time.



## How to Plot a Run Chart in JMP

- Data File: "RunChart.jmp"
- Steps to plot a run chart in JMP:
  - 1. Click > Analyze -> Quality & Process -> Control Chart -> Run Chart
  - 2. Select "Measurement" as the "Process"
  - 3. Click "OK".


😽 Control Chart - JMP		- • ×
Run Chart Control Chart		
- Select Columns	Cast Columns into Roles	Action
Columns	Process Measurement	ОК
Measurement	optional numeric	Cancel
Cycle		
Trend	Sample Label optional	
	By optional	Remove
		Recall
		Help
	Sample Size	
	Sample Grouped by Sample Label	Get Limits
	Sample Size Constant	
	1	Capability
	L	



www.LeanSigmaCorporation.com

## How to Plot a Run Chart in JMP


- Run charts are used to identify the trend, cycle, seasonal pattern, or abnormality in the data.
  - The time series in this chart appears stable.
  - There are no extreme outliers, trending or seasonal patterns.

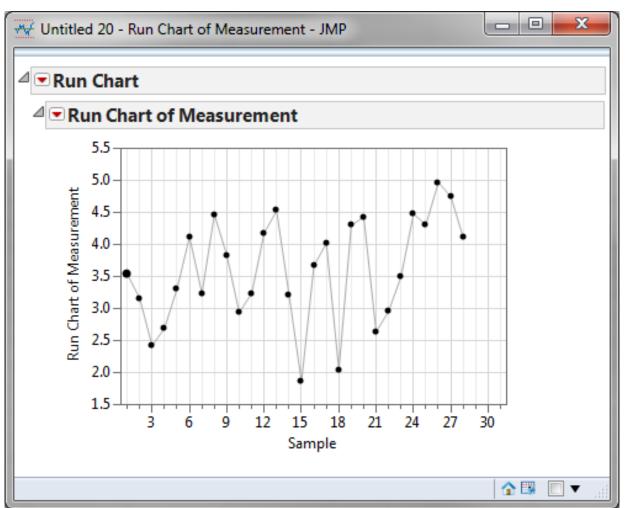



## Run Chart Example


- Following the previous "Run Chart" instructions, create a new chart using the data listed in the column "Cycle" in the "Run Chart.jmp" data file.
- Notice the repeating pattern of the data. This could suggest something cyclical or seasonal.

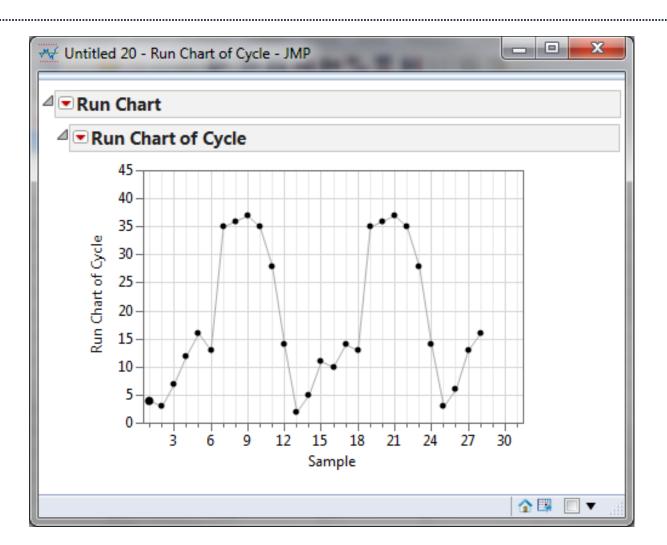



## Run Chart Example

- Create another run chart using the data listed in column "Trend" in the "Run Chart.jmp" data file.
- Notice the trending pattern represented by the data points successively declining.

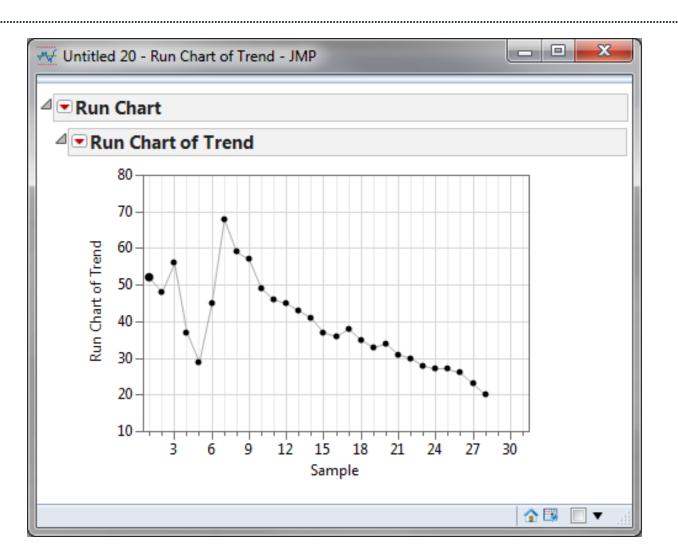



# 2.3 MSA (Measurement System Analysis)



## Black Belt Training: Measure Phase

#### 2.1 Process Definition

2.1.1 Cause and Effect Diagrams2.1.2 Cause and Effects Matrix2.1.3 Process Mapping2.1.4 FMEA: Failure Modes & Effects Analysis2.1.5 Theory of Constraints

#### 2.2 Six Sigma Statistics

- 2.2.1 Basic Statistics
- 2.2.2 Descriptive Statistics
- 2.2.3 Distributions and Normality
- 2.2.4 Graphical Analysis

#### 2.3 Measurement System Analysis

- 2.3.1 Precision and Accuracy2.3.2 Bias, Linearity, and Stability2.3.3 Gage R&R2.3.4 Variable and Attribute MSA
- 2.4 Process Capability
  2.4.1 Capability Analysis
  2.4.2 Concept of Stability
  2.4.3 Attribute and Discrete Capability
  2.4.4 Monitoring Techniques



# 2.3.1 Precision and Accuracy



#### What is Measurement System Analysis

- **Measurement System Analysis** (MSA) is a systematic method to identify and analyze the variation components in the measurement.
- It is a mandatory step in any Six Sigma project to ensure the data are reliable before making any data-based decisions.
- The MSA is the check point of data quality before we start any further analysis and draw any conclusions from the data.



#### **Data-Based Analysis**

- Here are some examples of data-based analysis where MSA is the prerequisite:
  - Correlation analysis
  - Regression analysis
  - Hypothesis testing
  - Analysis of variance
  - Design of experiments
  - Multivariate analysis
  - Statistical process control.



www.LeanSigmaCorporation.com

#### Measurement System


Inputs (Xs)

• A measurement system is a process to obtain data.

Measurement

System

- Y (output of the measurement system)
  - Observed values
- X's (inputs of the measurement system)
  - True values
  - Measurement errors

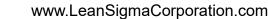

**Output (Y)** 



Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

#### **Observed Value = True Value + Measurement Error**

#### True Value

- The actual value we are interested to measure
- It reflects the true performance of the process we are measuring

#### Measurement Error

• The errors brought in by measurement system

#### Observed Value

The observed/measured value obtained by the measurement system



## **Measurement Errors**

- Types of Observed Values:
  - Continuous measurements
    - Weight
    - Height
    - Money
  - Discrete measurements
    - Red/Yellow/Green
    - Yes/No
    - Ratings of 1–10
- A variable MSA is designed for continuous measurements and an *attribute MSA* is for discrete measurements.



390

 $\odot$ 

### **Measurement Errors**

- Sources of measurement errors:
  - Human
  - Environment
  - Equipment
  - Sample
  - Process
  - Material
  - Method.
- Fishbone diagrams can help to brainstorm the potential factors affecting the measurement system.



#### **Measurement Errors**

- The more errors the measurement system brings in, the less reliable the observed values are.
- A valid measurement system brings in minimum amount of measurement errors.
- The goal of MSA is to qualify the measurement system by quantitatively analyzing its characteristics.



## Characteristics of a Measurement System

- Any measurement systems can be characterized by two aspects:
  - Accuracy (location related)
  - Precision (variation related).
- A valid measurement system is *both* accurate and precise.
  - Being accurate does not guarantee the measurement system is precise.
  - Being precise does not guarantee the measurement system is accurate.



393


#### Accuracy vs. Precision

- Accuracy:
  - The level of closeness between the average observed value and the true value
  - How well the observed value reflects the true value.
- Precision:
  - The spread of measurement values
  - How consistent the repeated measurements deliver the same values under the same circumstances.



## Accuracy vs. Precision


- Accurate and precise
  - high accuracy and high precision

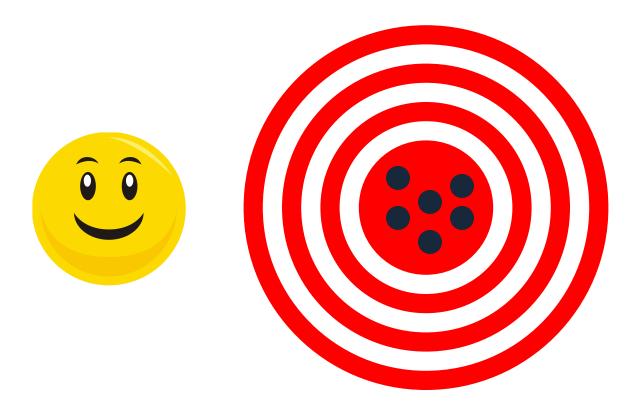



## Accuracy vs. Precision


- Accurate and not precise
  - high accuracy and low precision

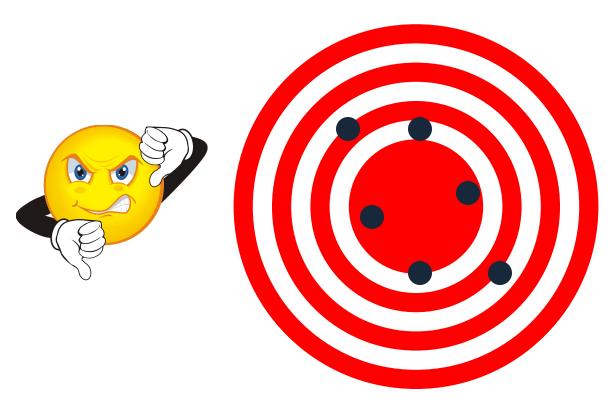



#### Accuracy vs. Precision

- Precise and not accurate
  - high precision and low accuracy

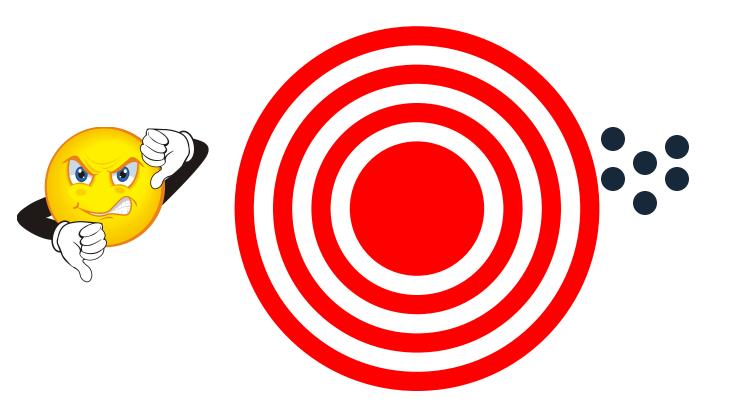



## Accuracy vs. Precision

- Not accurate and not precise
  - low accuracy and low precision





 $\odot$ 

#### MSA Conclusions

- If the measurement system is considered *both* accurate and precise, we can start the data-based analysis or decision making.
- If the measurement system is either not accurate or not precise, we need to identify the factor(s) affecting it and calibrate the measurement system until it is both accurate and precise.



#### Stratification of Accuracy and Precision

- Accuracy
  - Bias
  - Linearity
  - Stability
- Precision
  - Repeatability
  - Reproducibility



# 2.3.2 Bias, Linearity and Stability






- **Bias** is the difference between the observed value and the true value of a parameter or metric being measured.
- It is calculated by subtracting the reference value from the average value of the measurements.

#### **Bias = Grand Mean – Reference Value**

where the reference value is a standard agreed upon



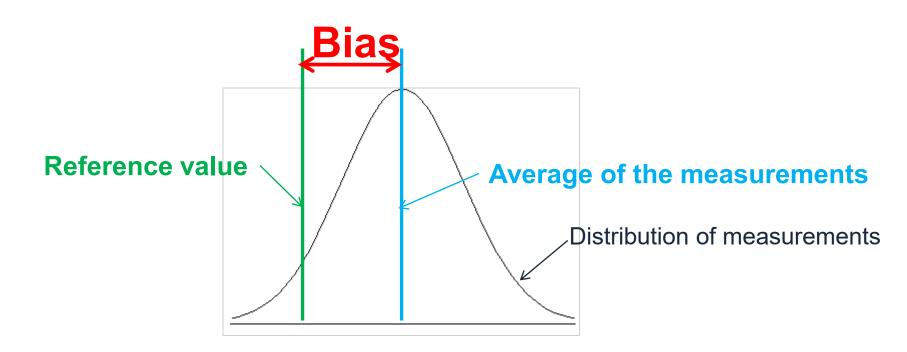

- The closer the average of all measurements is to the reference level, the smaller the bias.
- The reference level is the average of measurements of the same items using the master or standard instrument.



- To determine whether the difference between the average of observed measurement and the reference value is statistically significant (we will explain more details about statistical significance in the Analyze module), we can either conduct a *hypothesis testing* or *compare* the reference value against the confidence intervals of the average measurements.
- If the reference value falls into the confidence intervals, the bias is not statistically significant and can be ignored. Otherwise, the bias is statistically significant and must be fixed.



www.LeanSigmaCorporation.com

#### Bias

- Potential causes of bias:
  - Errors in measuring the reference value
  - Lack of proper training for appraisers
  - Damaged equipment or instrument
  - Measurement instrument not calibrated precisely
  - Appraisers read the data incorrectly.






- Linearity is the degree of the consistency of bias over the entire expected measurement range.
- It quantifies how the bias changes over the range of measurement.
- For example, a scale is off by 0.01 pounds when measuring an object of 10 pounds. However, it is off by 10 pounds when measuring an object of 100 pounds. The scale's bias is not linear.



Linearity

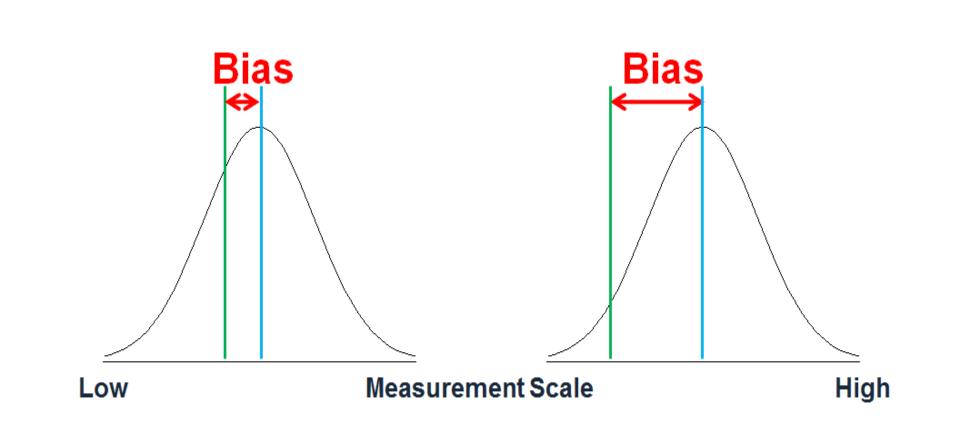




www.LeanSigmaCorporation.com

# Linearity

- Create a scatter plot for bias (Y-axis) and reference level (X-axis).
- Find a best fit linear regression line and compute the slope of the line.
- The closer the slope is to zero, the better the measurement system performs.

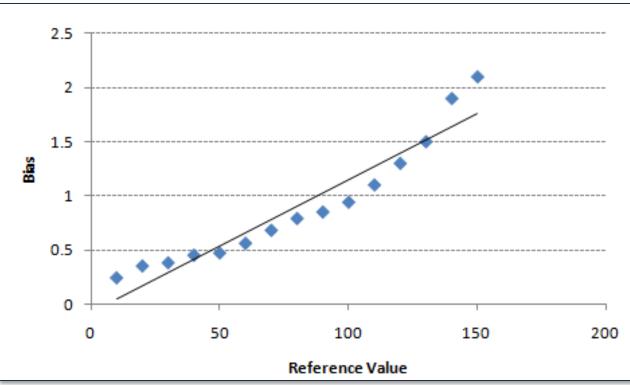






• Formula of the linearity of a measurement system:

Linearity = |Slope| × Process Variation

where

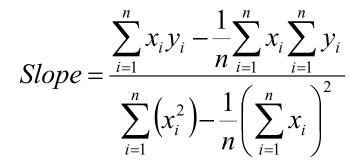

 $x_i$  is the reference value;  $y_i$  is the bias at each reference level; n is the sample size.



# Linearity

- Potential causes of linearity:
  - Errors in measuring the lower end or higher end of the reference value
  - Lack of proper training for appraisers
  - Damaged equipment or instrument
  - Measurement instrument not calibrated correctly at the lower or higher end of the measurement scale
  - Innate nature of the instrument.






- **Stability** is the consistency level needed to obtain the same values when measuring the same objects over an extended period of time.
- A measurement system that has low bias and linearity close to zero but cannot consistently perform well would not deliver reliable data.
- Stability is evaluated using control charts.






Stability

# Time

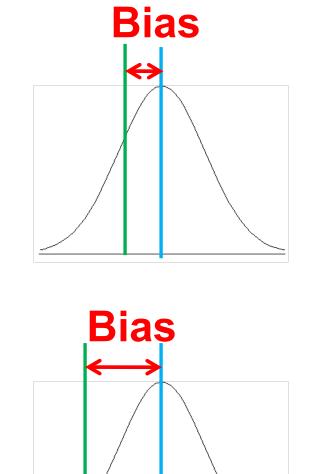

## Stability

- Control charts are used to evaluate the stability of a measurement system.
- When there are no data points out of control, the measurement system is considered stable.

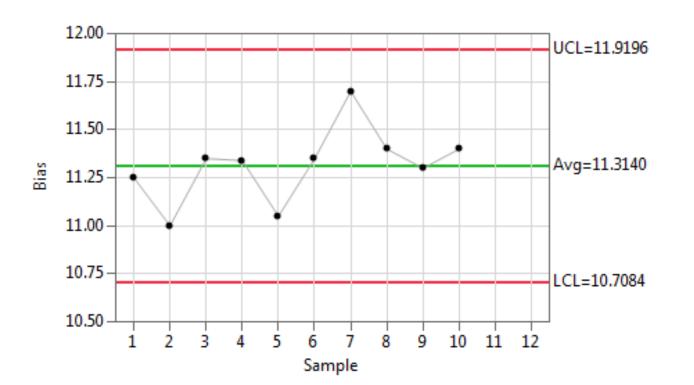



# Stability

- Potential causes of instability:
  - Inconsistent training for appraisers
  - Damaged equipment or instrument
  - Worn equipment or instrument
  - Measurement instrument not calibrated
  - Appraisers do not follow the procedure consistently.





2.3.3 Gage R&R

Lean Six Sigma Training - JMP

© Lean Sigma Corporation

#### Repeatability

- **Repeatability** evaluates whether the same appraiser can obtain the same value multiple times when measuring the same object using the same equipment under the same environment.
- It refers to the level of agreement between the repeated measurements of the same appraiser under the same condition.
- Repeatability measures the inherent variation of the measurement instrument.



#### Reproducibility

- **Reproducibility** evaluates whether different appraisers can obtain the same value when measuring the same object independently.
- It refers to the level of agreement between different appraisers.
- It is not caused by the inherent variation of the measurement instrument. It reflects the variability caused by different appraisers, locations, gauges, environments etc.





- Gauge R&R (i.e. Gauge Repeatability & Reproducibility) is a method to analyze the variability of a measurement system by partitioning the variation of the measurements using ANOVA (Analysis of Variance).
- Gauge R&R only addresses the precision of a measurement system.

418

 $\odot$ 



#### Gauge R&R

- Data collection of a gauge R&R study:
  - let k appraisers measure n random samples independently and repeat the process p times.
- Different appraisers perform the measurement independently.
- The order of measurement (e.g., sequence of samples and sequence of appraisers) is randomized.



#### Gauge R&R

- The potential sources of variance in the measurement:
  - Appraisers:  $\sigma^2_{appraisers}$
  - Parts:  $\sigma_{parts}^2$
  - Appraisers × Parts:  $\sigma^2_{appraisers \times parts}$
  - Repeatability:  $\sigma^2_{repeatability}$
- Variance Components

$$\sigma_{total}^2 = \sigma_{appraisers}^2 + \sigma_{parts}^2 + \sigma_{appraisers \times parts}^2 + \sigma_{repeatability}^2$$



• A valid measurement system has low variability in both repeatability and reproducibility so that the total variability observed can reflect the true variability in the objects (parts) being measured.

$$\sigma_{total}^2 = \sigma_{reproducibility}^2 + \sigma_{repeatability}^2 + \sigma_{parts}^2$$

where

$$\sigma^2_{reproducibility} = \sigma^2_{appraisers} + \sigma^2_{appraisers \times parts}$$

 Gauge R&R variance reflects the precision level of the measurement system.

$$\sigma_{R\&R}^2 = \sigma_{repeatability}^2 + \sigma_{reproducibility}^2$$



Variation Components

$$Variation_{total} = Z_0 \times \sigma_{total}$$

$$Variation_{repeatability} = Z_0 \times \sigma_{repeatability}$$

$$Variation_{reproducibility} = Z_0 \times \sigma_{reproducibility}$$

$$Variation_{parts} = Z_0 \times \sigma_{parts}$$
where
$$\sigma_{total}^2 = \sigma_{reproducibility}^2 + \sigma_{repeatability}^2 + \sigma_{parts}^2$$

 $Z_0$  is a sigma multiplier that assumes a specific confidence level in the spread of the data.



Lean Six Sigma Training - JMP

© Lean Sigma Corporation

423



• The percentage of variation R&R contributes to the total variation in the measurement:

 $Contribution\%_{R\&R} = \frac{Variation_{R\&R}}{Variation_{total}} \times 100\%$ 

where 
$$Variation_{R\&R} = Z_0 \times \sqrt{\sigma_{repeatability}^2 + \sigma_{reproducibility}^2}$$

Measurement System	% Study Var.	% Contribution	Distinct Categories
Acceptable	10% or less	1% or Less	5 or Greater
Marginal	10% - 30%	1% - 9%	
Unacceptable	30% or Greater	9% or Greater	Less than 5



# 2.3.4 Variable and Attribute MSA



#### Variable Gage R&R

- Whenever something is measured repeatedly or by different people or processes, the results of the measurements will vary. Variation comes from two primary sources:
  - 1. Differences between the parts being measured
  - 2. The measurement system.
- We can use a gage R&R to conduct a measurement system analysis to determine what portion of the variability comes from the parts and what portion comes from the measurement system.
- There are key study results that help us determine the components of variation within our measurement system.



## Key Measures of a Variable Gage R&R

- %Contribution: The percent of contribution for a source is 100 times the variance component for that source divided by the total variance.
- %Study Var (6\*SD): The percent of study variation for a source is 100 times the study variation for that source divided by the total variation.
- %Tolerance (SV/Tolerance): The percent of spec range taken up by the total width of the distribution of the data based on variation from that source.
- Distinct Categories: The number of distinct categories of parts that the measurement system is able to distinguish. If a measurement system is not capable of distinguishing at least five types of parts, it is probably not adequate.



## Variable Gage R&R Guidelines (AIAG)

#### Percent Tolerance and Percent Study Variation

- 10% or less Acceptable
- 10% to 30% Marginal
- 30% or greater Unacceptable

#### Percent Contribution

- 1% or less Acceptable
- 1% to 9% Marginal
- 9% or greater Unacceptable

#### Distinct Categories

 Look for five or more distinct categories to indicate that your measurement system is acceptable.



## Guidelines for Distinct Categories

• Distinct categories is the number of categories of parts that your measurement system can distinguish. If it is below five, it is likely not able to distinguish between parts.

Number of Categories	Conclusion	
Distinct Categories = 1	Measurement system cannot discriminate between parts	
Distinct Categories = 2	Measurement system can only distinguish between high/low or big/small	
Distinct Categories = 3 or 4	Measurement system is of little or no value	
Distinct Categories = 5+	According to AIAG, the measurement system can acceptably discriminate parts	



- Data File: "VariableMSA.jmp"
- Step 1: Initiate the MSA study
  - 1. Click: Analyze > Quality & Process > Measurement Systems Analysis
  - 2. Select "Measurement" as "Y, Response"
  - 3. Select "Operator" as "X, Grouping"
  - 4. Select "Part" as "Part, Sample ID"
  - 5. Select "Gauge R&R" as the "MSA Method"
  - 6. Select "Crossed" as "Model Type"
  - 7. Click "OK"



www.LeanSigmaCorporation.com


.....

Measurement Systems Analysis	- JMP	<b> </b>
Select Columns 4 Columns ARun Order Part Operator Measurement	Cast Selected Columns into Roles Y, Response Measurement optional numeric continu- Standard Optional	Action OK Cancel
MSA Method Gauge R&R Model Type Crossed	Standard     Optional       Part, Sample ID     Part       X, Grouping     Il Operator       optional	Remove Recall Help
Options Analysis Settings Specify Alpha	Freq optional numeric By optional	



- Step 2: Create the variability chart for measurement
  - 1. Click on the red triangle button next to "Variability Gauge"
  - 2. Click "Connect Cell Means" to link the average measurement for each part together
  - 3. Click "Show Group Means" to display the average measurement for each appraiser (solid line)
  - 4. Click "Show Grand Mean" to display the average measurement for the entire data set (dotted line)



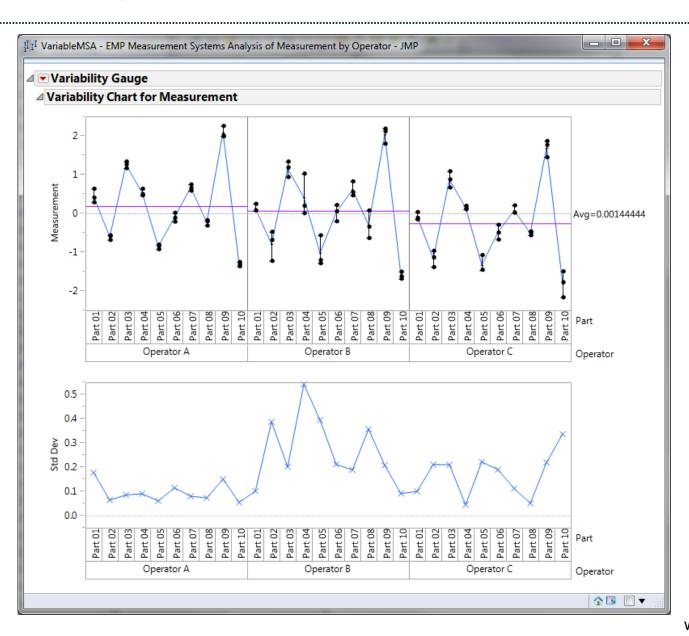

www.LeanSigmaCorporation.com

432

Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

- Step 3: Implement Gauge R&R
  - 1. Click on the red triangle button next to "Variability Gauge"
  - 2. Click "Gauge Studies" -> "Gauge RR"
  - 3. A window named "Enter/Verify Gauge R&R Specifications" opens
  - 4. Enter the specified value into "K, Sigma Multiplier" box. In this example, we use 5.15 to assume a 99% spread of the data.
  - 5. Click "OK"



📴 Enter/Verify Gauge R&R Specific	cations		x
Choose tolerance entry method	K, Sigma Multiplier [e.g. 6 gives a 99.73% spread]	5.15	
Tolerance Interval 🔻	Tolerance Interval, USL-LSL, optional		
	Spec Limits, optional		LSL
			USL
	Historical Mean, optional		
	Historical Sigma, optional		
	ОК	Cancel	elp



434

 $\odot$ 


- The percentage of variation R&R contributes to the total variation is 26.15% The precision level of this measurement system is not good.
   Actions are required to calibrate the measurement system.
- Note: This section in JMP covers the detailed calculation of the sources of variation and also variance components

Variability G	iaug	e				
Variability Ch	nart	for Measur	ement			
Gauge R&R				1		
Measurement Source		Variatio (5.15*StdDe				which is 5.15*sqrt of
Repeatability	(EV)	1.007530	06 Equipm	ent Var	iation	V(Within)
	(AV)		28 Apprais			V(Operator) + V(Operator*Part)
Operator		0.808502				V(Operator)
Operator*Part		0.230993	15			V(Operator*Part)
Gauge R&R	(RR)	1.312307	76 Measur	ement	Variation	V(Within) + V(Operator) + V(Operator*Part)
Part Variation	(PV)	4.844231	L6 Part Va	riation		V(Part)
Total Variation	(TV)	5.01883	76 Total Va	ariation		V(Within) + V(Operator) + V(Operator*Part) + V(Part
5.15 k						
26.1476 % Gaud	ae R&	R = 100*(RR/	TV)		-	
0.2709 Precisio						
5 Numbe	er of D	Distinct Catego	ries = 1.41	(PV/RR	)	
Jsing last column	'Part	' for Part.				
⊿ Variance Co	omp	onents for	Gauge R	&R		
		Var				
Component	C	omponent 9	6 of Total	20 4	0 60 80	
Gauge R&R	(	0.06493171	6.84			7
Repeatability	(	0.03827384	4.03			1
Reproducibili	_	0.02665787	2.81			1
Part-to-Part		0.88478009	93.16			1



- Step 4: Create Mean Plots for further analysis
  - 1. Click on the red triangle button next to "Variability Gauge"
  - 2. Click "Gauge Studies" -> "Gauge R&R Plots" -> "Mean Plots"
  - 3. Three plots appear



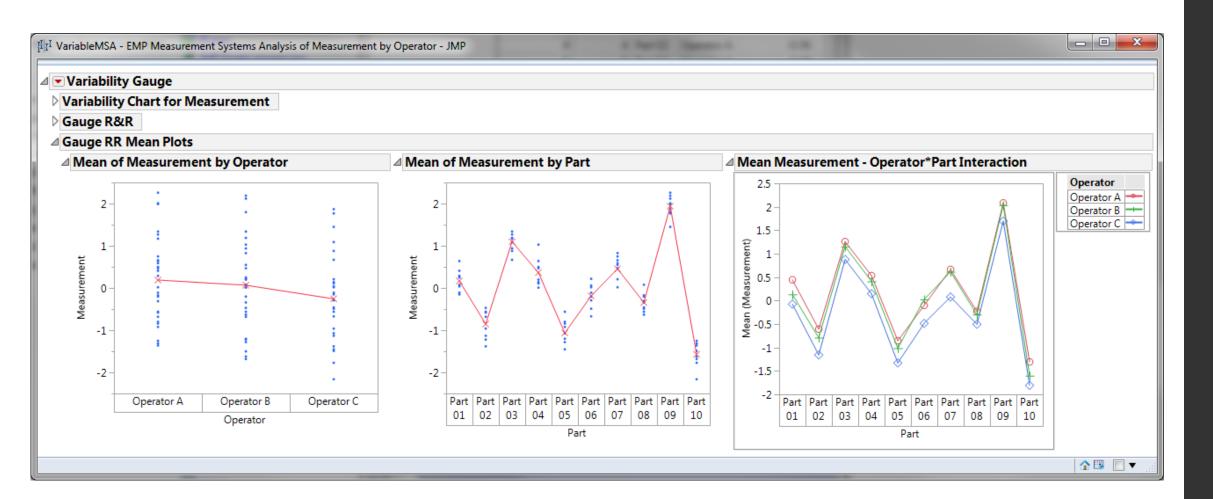




437

 $\bigcirc$ 


- Data File: "AttributeMSA.jmp"
- Steps in JMP to run an attribute MSA
  - 1. Click Analyze -> Quality & Process -> Variability/Attribute Gauge Chart
  - 2. Select "Appraiser A", "Appraiser B" and "Appraiser C" as "Y, Response"
  - 3. Select "Part" as "X, Grouping"
  - 4. Select "Reference" as "Standard"
  - 5. Select "Attribute" as the "Chart Type"
  - 6. Click "OK"
  - 7. Click on the red triangle button next to "Attribute Gauge"
  - 8. Click "Show Effectiveness Points"
  - 9. Click "Connect Effectiveness Points"



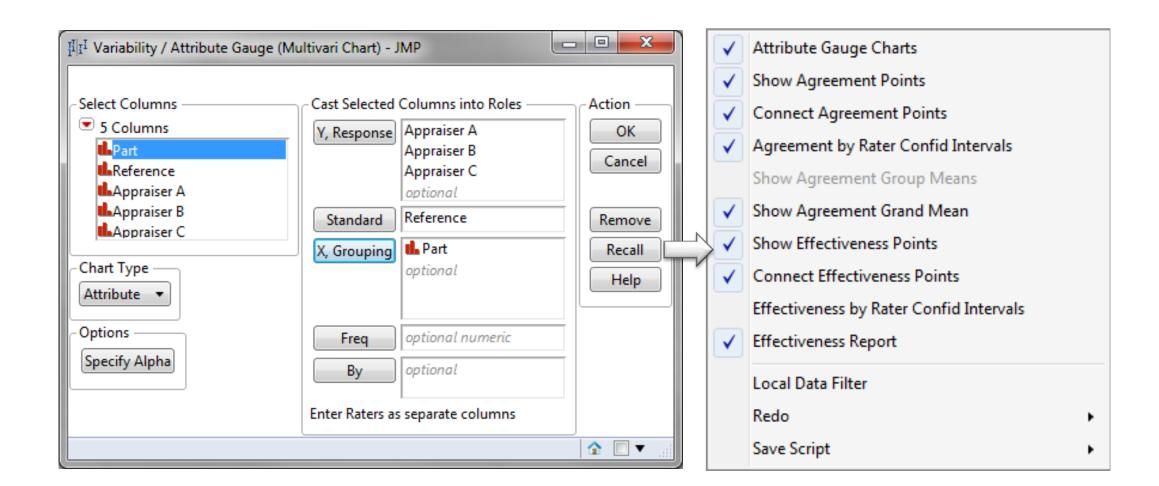


 $\bigcirc$ 

Lean Sigma Corporation

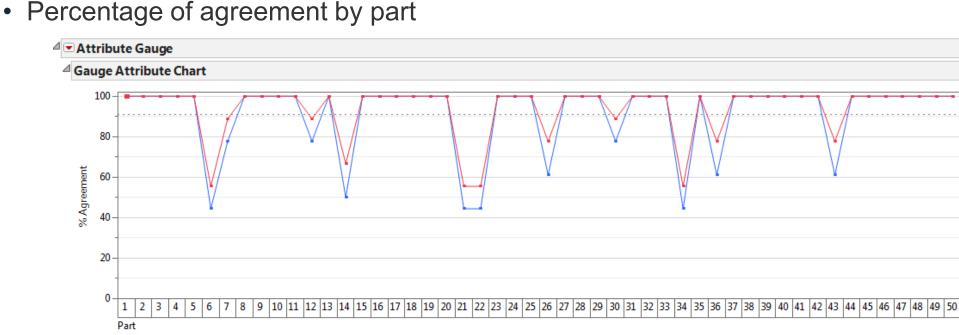

- Percentage of agreement by appraiser
  - Red line: the percentage of agreement with the reference level
  - Blue line: the percentage of agreement between and within the appraisers
  - When both lines are at 100% level across parts and appraisers, the measurement system is perfect.

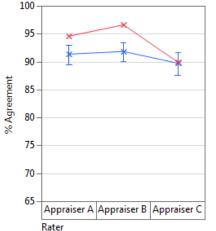

440

- % Agreement: Overall agreement percentage of both within and between appraisers. It reflects how precise the measurement system performs.
- In this example, 78% of items inspected have the same measurement across different appraisers and also within each individual appraiser.
- Rater Score: the agreement percentage within each individual appraiser.

1	Agreeme	пкероп			
			95%	<b>95%</b>	
	Rater	% Agreement	t Lower Cl	Upper Cl	[
	Appraiser A	91.4286	89.5082	93.0248	
	Appraiser B	91.9048	90.0502	93.4388	
	Appraiser C	89.8095	87.6057	91.6588	
	Number	Number		95%	95%
	Inspected	Matched % Ag	greement	Lower CI	Upper CI
	50	39	78.000	64.758	87.246

Agreement within Raters									
Number Number 95% 95									
Rater	Inspected	Matched	Rater Score	Lower CI	Upper CI				
Appraiser A	50	42	84.0000	71.4858	91.6626				
Appraiser B	50	45	90.0000	78.6398	95.6524				
Appraiser C	50	40	80.0000	66.9629	88.7562				



www.LeanSigmaCorporation.com

- **Kappa statistic** is a coefficient indicating the agreement percentage above the expected agreement by chance.
- Kappa ranges from -1 (perfect disagreement) to 1 (perfect agreement).
- When the observed agreement is less than the chance agreement, Kappa is negative.
- When the observed agreement is greater than the chance agreement, Kappa is positive.
- Rule of thumb: If Kappa is greater than 0.7, the measurement system is acceptable. If Kappa is greater than 0.9, the measurement system is excellent.



- The first table shows the Kappa statistic of the agreement between appraisers
- The second table shows the Kappa statistic of the agreement between individual appraiser and the standard
- The bottom table shows the categorical kappa statistic to indicate which category in the measurement has worse results.

4	Agreement Comparisons									
		Compared						Standard		
	Rater	with Rater	Kappa	.2	.4	.6	.8	Error		
	Appraiser A	Appraiser B	0.8629					0.0442		
	Appraiser A	Appraiser C	0.7761	<b>.</b>	·			0.0547		
	Appraiser B	Appraiser C	0.7880					0.0537		

	Compared							Standard
Rater	with Standard	Карра	.2	.4	.6	.8		Error
Appraiser A	Reference	0.8788					]	0.0416
Appraiser B	Reference	0.9230						0.0338
Appraiser C	Reference	0.7740						0.0551

Agreem	entacr	USS CO	itege	nes			
							Standard
Category	Kappa	.2		4	.6	.8	Error
0	0.7936						0.0236
1	0.7936						0.0236
Overall	0.7936						0.0236

A groom opt perces Catogorias



- Count of true positives, true negatives, false positives and false negatives.
- The effectiveness shows the percentage of the agreement between each appraiser and the standard. It reflects the accuracy of the measurement system.

			Total			
Rater	Correct(0)	Correct(1)	Correct	Incorrect(0)	Incorrect(1)	Grand Tota
Appraiser A	45	97	142	3	5	15
Appraiser B	45	100	145	3	2	15
Appraiser C	42	93	135	6	9	15
	F44	959 		CI Error rate		
Kater						
	94.66				-	
Rater Appraiser A Appraiser B		67 89.8290	5 97.27	30 0.0533		
Appraiser A	94.660	57 89.8290 57 92.4348	5 97.27 3 98.56	30 0.0533 80 0.0333	]	

Standard		
Level	0	1
0		16
1	12	
Other	0	0

#### Conformance Report

	P(False		Assumptions
Rater	Alarms)	P(Misses)	NonConform = 0
Appraiser A	0.0490	0.0625	Conform = 1
Appraiser B	0.0196	0.0625	
Appraiser C	0.0882	0.1250	

## 2.4 Process Capability



#### Black Belt Training: Measure Phase

# 2.1 Process Definition 2.1.1 Cause and Effect Diagrams 2.1.2 Cause and Effects Matrix 2.1.3 Process Mapping 2.1.4 FMEA: Failure Modes & Effects Analysis 2.1.5 Theory of Constraints

#### 2.2 Six Sigma Statistics

- 2.2.1 Basic Statistics
- 2.2.2 Descriptive Statistics
- 2.2.3 Distributions and Normality
- 2.2.4 Graphical Analysis

2.3 Measurement System Analysis
2.3.1 Precision and Accuracy
2.3.2 Bias, Linearity, and Stability
2.3.3 Gage R&R
2.3.4 Variable and Attribute MSA

#### 2.4 Process Capability

2.4.1 Capability Analysis2.4.2 Concept of Stability2.4.3 Attribute and Discrete Capability2.4.4 Monitoring Techniques



# 2.4.1 Capability Analysis



#### What is Process Capability?

- The **process capability** measures how well the process performs to meet given specified outcome.
- It indicates the conformance of a process to meet given requirements or specifications.
- **Capability analysis** helps to better understand the performance of the process with respect to meeting customer's specifications and identify the process improvement opportunities.



#### **Process Capability Analysis Steps**

- Step 1: Determine the metric or parameter to measure and analyze.
- Step 2: Collect the historical data for the parameter of interest.
- Step 3: Prove the process is statistically stable (i.e., in control).
- Step 4: Calculate the process capability indices.
- Step 5: Monitor the process and ensure it remains in control over time. Update the process capability indices if needed.



#### **Process Capability Indices**

- Process capability can be presented using various indices depending on the nature of the process and the goal of the analysis.
- Popular process capability indices:
  - C<sub>p</sub>
  - P,
  - C<sub>pk</sub>
  - P<sub>pk</sub>
  - C<sub>pm</sub>



• C<sub>p</sub> stands for **capability of the process**.

$$C_p = \frac{USL - LSL}{6 \times \sigma_{within}}$$

where

$$\sigma_{within} = \frac{s_p}{c_4(d+1)} \qquad s_p = \sqrt{\frac{\sum_i \sum_j (x_{ij} - \bar{x}_i)}{\sum_i (n_i - 1)}}$$
$$d = \sum_i (n_i - 1) \qquad c_4 = \frac{4(n-1)}{(4n-3)}$$

**USL** and **LSL** are the upper and lower specification limits. *n* is the sample size.

Lean Six Sigma Training - JMP

© Lean Sigma Corporation

C<sub>p</sub>

- C<sub>p</sub> measures the process' potential capability to meet the two-sided specifications.
- It does not take the process average into consideration.
- High C<sub>p</sub> indicates the small spread of the process with respect to the spread of the customer specifications.
- C<sub>p</sub> is recommended when the process is centered between the specification limits.
- $C_p$  works when there are both upper and lower specification limits.



• **P**<sub>p</sub> stands for **performance of the process**.

$$P_{p} = \frac{USL - LSL}{6 \times \sigma_{overall}}$$

#### where

$$\sigma_{overall} = \frac{s}{c_4(n)} \qquad s = \sqrt{\sum_i \sum_j \frac{(x_{ij} - \bar{x})^2}{n - 1}}$$
$$c_4 = \frac{4(n - 1)}{(4n - 3)}$$

**USL** and **LSL** are the upper and lower specification limits. *n* is the sample size.



www.LeanSigmaCorporation.com

- Similar to C<sub>p</sub>, P<sub>p</sub> measures the capability of the process to meet the two-sided specifications.
- It only focuses on the spread and does not take the process centralization into consideration.
- It is recommended when the process is centered between the specification limits.
- $C_p$  considers the within-subgroup standard deviation and  $P_p$  considers the total standard deviation from the sample data.
- P<sub>p</sub> works when there are both upper and lower specification limits.

455

• C<sub>pk</sub> stands for the capability of the process with a k factor adjustment.

$$C_{pk} = (1-k) \times C_p$$



$$k = \frac{\left| m - \mu \right|}{\frac{USL - LSL}{2}} \qquad m = \frac{USL + LSL}{2}$$

 $\mu$  is the process mean; *n* is the sample size.

**USL** and **LSL** are the upper and lower specification limits.



456



• The formulas to calculate  $C_{pk}$  can also be expressed as follows:

$$C_{pk} = \min\left(\frac{USL - \mu}{3 \times \sigma_{within}}, \frac{\mu - LSL}{3 \times \sigma_{within}}\right)$$

where

$$\sigma_{within} = \frac{s_p}{c_4(d+1)} \qquad s_p = \sqrt{\frac{\sum_i \sum_j (x_{ij} - \bar{x}_i)}{\sum_i (n_i - 1)}}$$
$$d = \sum_i (n_i - 1) \qquad c_4 = \frac{4(n-1)}{(4n-3)}$$

**USL** and **LSL** are the upper and lower specification limits.





- C<sub>pk</sub> measures the process' actual capability by taking both the variation and average of the process into consideration.
- The process does not need to be centered between the specification limits to make the index meaningful.
- C<sub>pk</sub> is recommended when the process is not in the center between the specification limits.
- When there is only a one-sided limit,  $C_{pk}$  is calculated using  $C_{pu}$  or  $C_{pl}$ .





• C<sub>pk</sub> for upper specification limit:

$$C_{pu} = \frac{USL - \mu}{3 \times \sigma_{within}}$$

• C<sub>pk</sub> for lower specification limit:

$$C_{pl} = \frac{\mu - LSL}{3 \times \sigma_{within}}$$

**USL** and **LSL** are the upper and lower specification limits.  $\mu$  is the process mean.



www.LeanSigmaCorporation.com

 P<sub>pk</sub> stands for the performance of the process with a k factor adjustment.

$$P_{pk} = (1-k) \times P_p$$

where

$$k = \frac{\left| m - \mu \right|}{\frac{USL - LSL}{2}}$$
$$m = \frac{USL + LSL}{2}$$

**USL** and **LSL** are the upper and lower specification limits.  $\mu$  is the process mean.



• The formulas to calculate  $P_{pk}$  can also be expressed as follows:

$$P_{pk} = \min\left(\frac{USL - \mu}{3 \times \sigma_{overall}}, \frac{\mu - LSL}{3 \times \sigma_{overall}}\right)$$

$$\sigma_{overall} = \frac{s}{c_4(n)} \qquad s = \sqrt{\sum_i \sum_j \frac{(x_{ij} - \overline{x})^2}{n - 1}}$$

$$c_4 = \frac{4(n-1)}{(4n-3)}$$

**USL** and **LSL** are the upper and lower specification limits.  $\mu$  is the process mean. *n* is the sample size.



- Similar to  $C_{pk}$ ,  $P_{pk}$  measures the process capability by taking both the variation and the average of the process into consideration.
- P<sub>pk</sub> solves the decentralization problem P<sub>p</sub> cannot overcome.
- $C_{pk}$  considers the within-subgroup standard deviation, while  $P_{pk}$  considers the total standard deviation from the sample data.
- When there is only a one-sided specification limit,  $\mathsf{P}_{\mathsf{pk}}$  is calculated using  $\mathsf{P}_{\mathsf{pu}}$  or  $\mathsf{P}_{\mathsf{pl}}.$



• P<sub>pk</sub> for upper specification limit:

$$P_{pu} = \frac{USL - \mu}{3 \times \sigma_{overall}}$$

• P<sub>pk</sub> for lower specification limit:

$$P_{pl} = \frac{\mu - LSL}{3 \times \sigma_{overall}}$$

USL and LSL are the upper and lower specification limits.



www.LeanSigmaCorporation.com



- $C_p$ ,  $P_p$ ,  $C_{pk}$ , and  $P_{pk}$  all consider the variation of the process.  $C_{pk}$  and  $P_{pk}$  take both the variation and the average of the process into consideration when measuring the process capability.
- It is possible that the process average fails to meet the target customers require while the process still remains between the specification limits. C<sub>pm</sub> (Taguchi's capability index) helps to capture the variation from the specified target.



463

C<sub>pm</sub>

• Formula to calculate C<sub>pm</sub>

$$C_{pm} = \frac{\min(T - LSL, USL - T)}{3 \times \sqrt{s^2 + (\mu - T)^2}}$$

**USL** and **LSL** are the upper and lower specification limits. *T* is the specified target.  $\mu$  is the process mean.

Note: Cpm can work only if there is a target value specified.



464

## Interpreting Capability

- Interpreting the results of a capability analysis is very dependent upon the nature of the business, product and/or customer. The Automotive Industry Action Group (AIAG) suggests that:
  - $P_p$  and  $P_{pk}$  should be > 1.67
  - $C_p$  and  $C_{pk}$  should be > 1.33.
- The reality is that anything greater than 1.0 is a fairly capable process but your business needs to assess the costs vs. benefits of achieving capability greater than 1.67 or even higher. Below is a simple table for quick interpretation

Index	Value	Interpretation	Sigma Level
C <sub>pk</sub>	<1.0	Not Very Capable	<3
C <sub>pk</sub>	1.0-1.99	Capable	3-6
C <sub>pk</sub>	>2.0	Very Capable	>6

• If you're dealing with customer safety or life and death influences then obviously the product necessitates a capability greater than 2.0.




#### Use JMP to Run a Process Capability Analysis

- Data File: "CapabilityAnalysis.jmp"
- Steps in JMP to run a process capability analysis:
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red button next to "HtBk"
  - 5. Click "Capability Analysis"
  - 6. A window named "Capability Analysis, Setting Specification Limits" pops up
  - 7. Enter the 6.0 as the "Lower Spec Limit", 6.5 as the "Target" and 7.0 as the "Upper Spec Limit"
  - 8. Click "OK"



#### Use JMP to Run a Process Capability Analysis

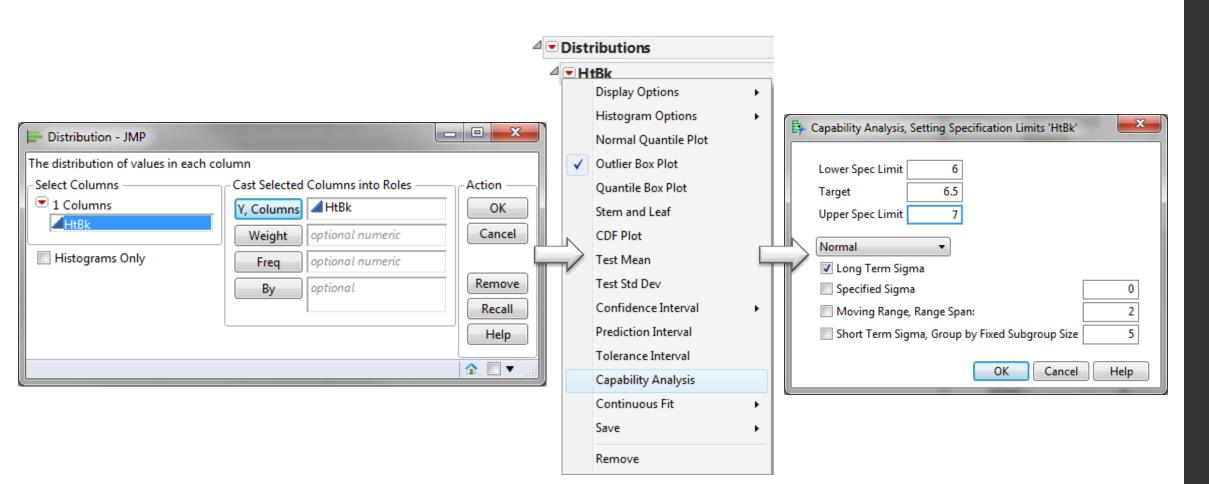



467


 $\bigcirc$ 

## Use JMP to Run a Process Capability Analysis

- Process capability indices are shown by the JMP output
  - CP: 0.530
    - Capability Analysis
  - CPK: 0.481
  - CMP: 0.525

Capability Analysis								
Specification	Value	Portion	% Actual					
Lower Spec Limit	6	Below LSL	5.0000					
Spec Target	6.5	Above USL	0.0000					
Upper Spec Limit	7	Total Outside	5.0000					

Long Term Sigma

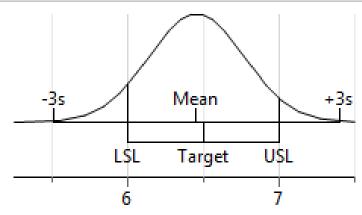

Sigma = 0.31422

Capability	Index	Lower CI	Upper CI
СР	0.530	0.413	0.648
CPK	0.481	0.332	0.629
CPM	0.525	0.415	0.647
CPL	0.481	0.331	0.628
CPU	0.580	0.414	0.743

			Sigma
Portion	Percent	PPM	Quality
Below LSL	7.4587	74587.383	2.942
Above USL	4.0928	40928.354	3.240
Total Outside	11.5516	115515.74	2.698



# 2.4.2 Concept of Stability



## What is Process Stability?

- A process is said to be stable when:
  - the process is in control
  - the future behavior of the process is predictable at least between some limits
  - there is only random variation involved in the process.
  - the causes of variation in the process are only due to chance or common causes
  - there are not any trends, patterns, or outliers in the control chart of the process.



# Root Causes of Variation in the Process

#### Common Cause:

- Chance
- Random and anticipated
- Natural noise
- Inherent in the process
- Unable to be eliminated from the process.

#### Special Cause:

- Assignable cause
- Unanticipated
- Unnatural pattern
- Signal of changes in the process
- Able to be eliminated from the process.



### **Control Charts**

- **Control charts** are the graphical tools to analyze the stability of a process.
- A control chart is used to identify the presence of potential special causes in the process and to determine whether the process is statistically in control.
- If the samples or calculations of samples are all in control, the process is stable and the data from the process can be used to predict the future performance of the process.



# **Popular Control Charts**

- I-MR Chart
- Xbar-R Chart
- Xbar-S Chart
- C Chart
- U Chart
- P Chart
- NP Chart
- EWMA Chart
- CUSUM Chart



Note: More details of the control charts will be introduced in the Control module.

473

 $\bigcirc$ 

# Process Stability vs. Process Capability

- Process stability indicates how stable a process performed in the past.
- When the process is stable, we can use the data from the process to predict its future behavior.
- Process capability indicates how well a process performs with respect to meeting the customer's specifications.
- The process capability analysis is valid only if the process is statistically stable (i.e., in control, predictable).
- Being stable does *not* guarantee that the process is also capable. However, being stable is the prerequisite to determine whether a process is capable.



# 2.4.3 Attribute & Discrete Capability



www.LeanSigmaCorporation.com

### Process Capability Analysis for Binomial Data

 If we are measuring the count of defectives in each sample set to assess the process performance of meeting the customer specifications, we use "%Defective" (percentage of items in the samples that are defective) as the process capability index.

%Defective = 
$$\frac{N_{defectives}}{N_{overall}}$$

where  $N_{\rm defectives}$  is the total count of defectives in the samples and  $N_{\rm overall}$  is the sum of all the sample sizes.



### Process Capability Analysis for Poisson Data

 If we are measuring the count of defects in each sample set to assess the process performance of meeting the customer specifications, we use Mean DPU (defects per unit of measurement) as the process capability index.

$$DPU = \frac{N_{defects}}{N_{overall}}$$

where  $N_{defects}$  is the total count of defects in the samples and  $N_{overall}$  is the sum of all the units in the samples.



# 2.4.4 Monitoring Techniques



# **Capability and Monitoring**

- In the Measure phase of the project, process stability analysis and process capability analysis are used to baseline the performance of current process.
- A stable process means we can expect the same process capability in the future.
- In the Control phase of the project, process stability analysis and process capability analysis are combined to monitor whether the improved process is maintained consistently as expected.



# 3.0 Analyze Phase



## Black Belt Training: Analyze Phase

#### **3.1 Patterns of Variation**

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

#### **3.4 Hypothesis Testing: Normal Data** 3.4.1 One and Two Sample T-Tests 3.4.2 One sample variance 3.4.3 One Way ANOVA

#### 3.5 Hypothesis Testing: Non-Normal Data

3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# 3.1 Patterns of Variation



## Black Belt Training: Analyze Phase

#### 3.1 Patterns of Variation

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

3.4 Hypothesis Testing: Normal Data3.4.1 One and Two Sample T-Tests3.4.2 One sample variance3.4.3 One Way ANOVA

#### 3.5 Hypothesis Testing: Non-Normal Data

3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# 3.1.1 Multi-Vari Analysis



### What is Multi-Vari Analysis?

- **Multi-Vari analysis** is a graphic-driven method to analyze the effects of categorical inputs on a continuous output.
  - Y: continuous variable
  - X's: discrete categorical variables. One X may have multiple levels.
- It studies how the variation in the output changes across different inputs and helps us quantitatively determine the major source of variability in the output.
- Multi-Vari charts are used to visualize the source of variation. They work for both crossed and nested hierarchies.




# Hierarchy

- **Hierarchy** is a structure of objects in which the relationship of objects can be expressed similar to an organization tree.
- Each object in the hierarchy is described as above, below, or at the same level as another one.
  - If object A is above object B and they are directly connected to each other in the hierarchy tree, A is B's parent and B is A's child.
- In Multi-Vari analysis, we use the hierarchy to present the relationship between categorical factors (inputs).
- Each object in the hierarchy tree indicates a specific level of a factor (input).
- There are generally two types of hierarchies: crossed and nested.



# **Crossed Hierarchy**

• In the hierarchy tree, if one child item has more than one parent item at the higher level, it is a crossed relationship.

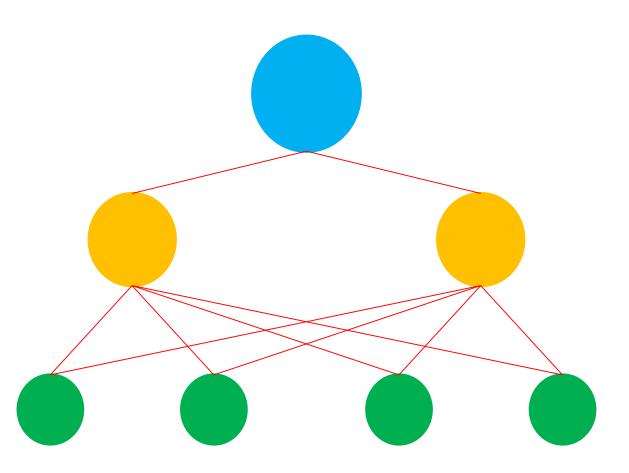






# **Nested Hierarchy**

• In the hierarchy tree, if one child item only has one parent item at the higher level, it is a nested relationship.

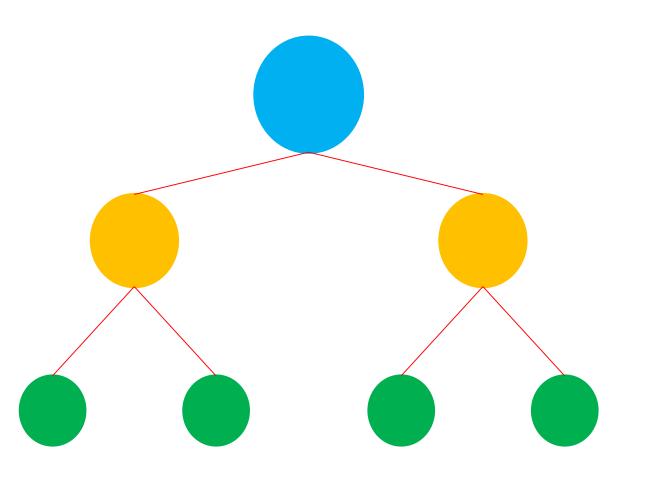



- Data File: "Multi-Vari.jmp"
  - Case study:
  - ABC company produces 10 kinds of units with different weights. Operators measure the weights of the units before sending them out to customers.
  - Multiple factors could have an impact on the weight measurements. The ABC company wants to have a better understanding of the main source of variability existing in the weight measurement.
  - The ABC company randomly selects 3 operators (Joe, John and Jack) each of whom measures the weights of 10 different units. For each unit, there are 3 items sampled.



- Steps to run a multi-vari analysis in JMP
  - 1. Click Analyze -> Quality and Process -> Variability/Attribute Gauge Chart
  - 2. Select "Measurement" as "Y, Response"
  - 3. Select both "Operator" and "Unit" as "X, Grouping"
  - 4. Select "Variability" as "Chart Type"
  - 5. Select "Crossed" as "Model Type" since it's a crossed hierarchy
  - 6. Click "OK"
  - 7. In the red triangle button next to "Variability Gauge"
  - 8. Click "Connect Cell Means" to create lines connecting individual observations
  - 9. Click "Show Group Means" to display the average within individual group
  - 10. Click "Show Grand Mean" to display the average across all the groups
  - 11. Click "Variance Components" to display the proportion table of variance components




$I^{I}$ Variability / Attribute Gauge (M	ultivari Chart) - JMP	
I IIII Variability / Attribute Gauge (M         Select Columns         Image: Select Columns <tr< th=""><th>Cast Selected Columns into Roles   Y, Response   Measurement optional numeric   Standard   optional   X, Grouping   I. Operator I. Unit optional   Freq   optional   Freq   optional   By   optional</th><th>Action OK Cancel Remove Recall Help</th></tr<>	Cast Selected Columns into Roles   Y, Response   Measurement optional numeric   Standard   optional   X, Grouping   I. Operator I. Unit optional   Freq   optional   Freq   optional   By   optional	Action OK Cancel Remove Recall Help
Analysis Settings Specify Alpha	Operator, Instrument are examples of possible Grouping Cols	



 $\odot$ 

- Connecting the cell means enables you to see the variation within and between units, and within operators.
- Adding the group means you can see the variation between operators as well.
- Grand mean on the right of the chart provide a broad reference point.

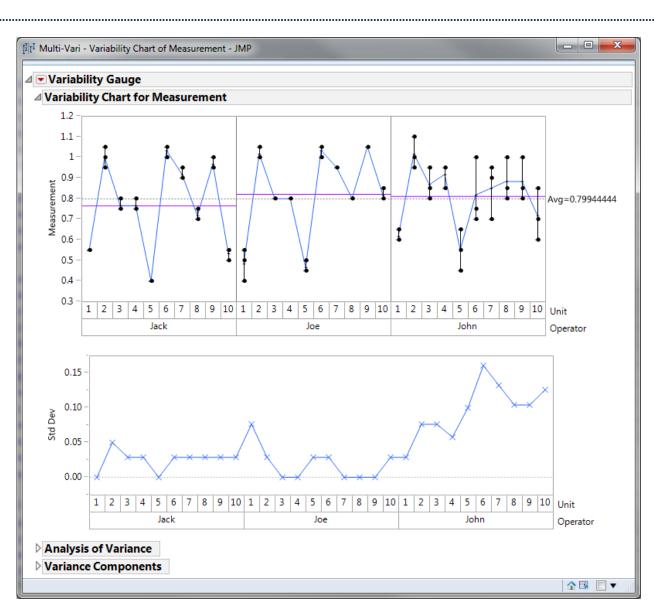




www.LeanSigmaCorporation.com

 $\odot$ 

Lean Sigma Corporation

# Interpreting JMP's Multi-Vari Analysis

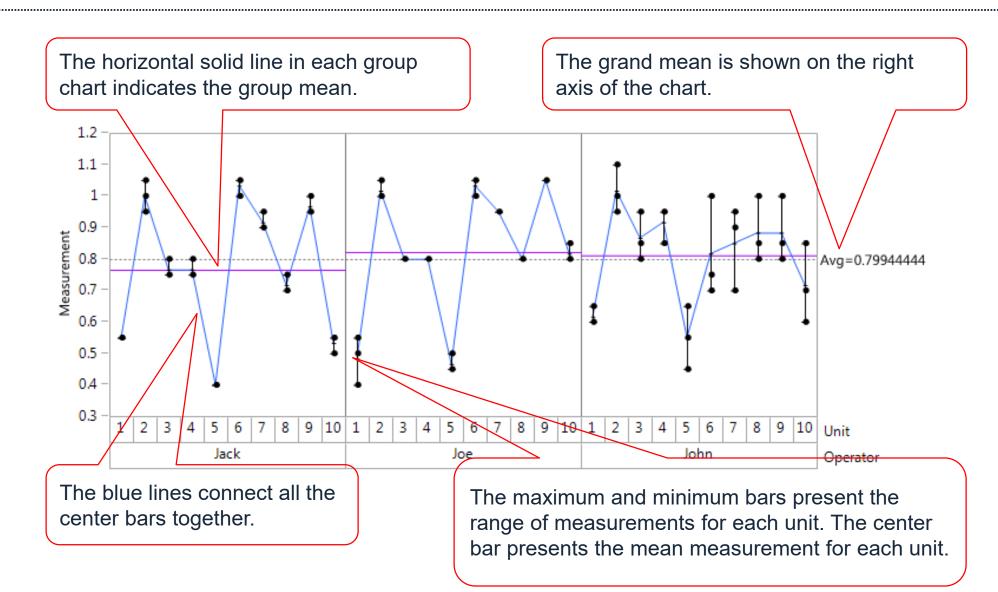



www.LeanSigmaCorporation.com

493

 $\bigcirc$ 

Lean Sigma Corporation

# Interpreting JMP's Multi-Vari Analysis

- Based on the Multi-Vari Chart, the measurement of units range from 0.3 to 1.2.
- The group means of three operators are very close to each other.
- John has the worst variation when measuring the same kind of unit because John has the largest difference between the maximum and minimum bars for any kind of unit.
- By observing the blue lines of three operators, it seems like three operators' measurements follow the same pattern. The operator-to-operator variability is not large.
- The unit-to-unit variability is large and it might be the main source of variation in measurements.



# **Quantifying Variance Components**

• The variance components table quantitatively shows that the variation in the measurements mainly come from the variation between different units (75.2%).

IIII Multi-Vari - Variability Chart of Measurement - JMP						
⊿ 💌 Variability Gauge						
Variability Chart for Measurement						
Analysis of Variance						
⊿ Variance Components						
	Var			Sqrt(Var		
Component	Component	% of Total	20 40 60 80	Comp)		
Operator	0.00021914	0.5461		0.01480		
Unit	0.03019444	75.2		0.17377		
Operator*Unit	0.00557716	13.9		0.07468		
Within	0.00413889	10.3		0.06433		
Total	0.04012963	100.0		0.20032		



495

# 3.1.2 Classes of Distribution



© Lean Sigma Corporation Lean Six Sigma Training - JMP

496

## What is Probability?

- Probability is the likelihood of an event occurring.
- The probability of event A occurring is written as P(A).
- Probability is a percentage between 0% and 100%. The higher the probability, the more likely the event will happen.
- When probability is equal to 0%, it indicates that the event will take place with no chance.
- When probability is equal to 100%, it indicates the event will definitely take place without any uncertainty.
- Example of probability: when tossing a coin, there is 50% chance that the head lands face up and 50% chance that the head lands face down.



497

• The probability of event A not occurring:

$$P(\overline{A}) = 1 - P(A)$$

*To be, or not to be: that is the question. William Shakespeare* 



• The probability of event A OR B OR both events occurring:

 $P(A \cup B) = P(A) + P(B) - P(A \cap B)$ 

• If event A and B are mutually exclusive:

$$P(A \cap B) = 0$$

and

$$P(A \cup B) = P(A) + P(B)$$



• The probability of event A AND B occurring together:

 $P(A \cap B) = P(A \mid B)P(B)$ 

• If event A and B are independent of each other:

 $P(A \mid B) = P(A)$ 

and

 $P(A \cap B) = P(A)P(B)$ 



• The probability of event A occurring given event B taking place:

$$P(A | B) = \frac{P(A \cap B)}{P(B)}$$
 where  $P(B) \neq 0$ 




## What is Distribution?

- **Distribution** (or probability distribution) describes the range of possible events and the possibility of each event occurring.
- In statistical terms, distribution is the probability of each possible value of a random variable when the variable is discrete, or the probability of a value falling in a specific interval when the variable is continuous.



## **Probability Mass Function**


- **PMF** (Probability Mass Function) is a function describing the probability of a discrete random variable equal to a particular value.
- Here is the probability mass function chart for a fair die.

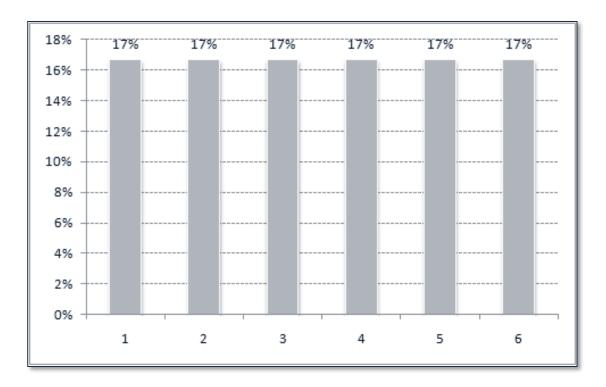



## **Probability Density Function**

- **PDF (Probability Density Function)** is a function used to retrieve the probability of a continuous random variable falling within a particular interval.
- The probability of a variable falling within a particular region is the integral of the probability density function over the region.
- Here is the probability density function chart of a standard normal distribution.

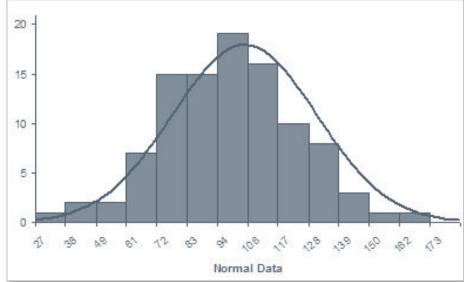



# Advantages of Distribution

- Distributions capture the most basic features of data
  - Shape
    - Which distribution family may the data belong to?
    - Is the data symmetric?
    - Are the tails of the data flat?
  - Center
    - Where is the midpoint of the data?
  - Scale
    - What is the range of data?



# Measures of Skewness and Kurtosis

- The shape, center (i.e., location), and scale (i.e., variability) are three basic data characteristics that probability distributions capture.
- Skewness and kurtosis are the two more advanced characteristics of the probability distribution.



506

### Skewness

- **Skewness** is a measure of the asymmetry degree of the probability distribution.
- The mathematical definition of the skewness is

$$\gamma_1 = \mathbf{E}\Big[\Big(\frac{X-\mu}{\sigma}\Big)^3\Big] = \frac{\mu_3}{\sigma^3} = \frac{\mathbf{E}\big[(X-\mu)^3\big]}{(\mathbf{E}\big[(X-\mu)^2\big])^{3/2}} = \frac{\kappa_3}{\kappa_2^{3/2}}$$


where  $\mu_3$  is the third moment about the mean and  $\sigma$  is the standard deviation.

- The skewness of a normal distribution is zero.
- When the distribution looks symmetric to the left side and the right side of the center point, the skewness is close to zero.
- Potential causes of skewness:
  - Extreme values exist in the data
  - Data have a lower or higher bound.




## Skewness

- Left Skew
  - Skewness < 0
  - The left tail of the distribution is longer than the right tail.

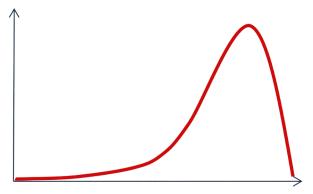

- Right Skew
  - Skewness > 0
  - The right tail of the distribution is longer than the left tail.

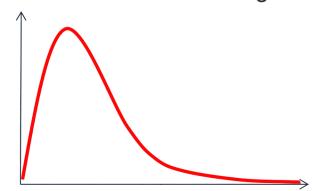



## **Kurtosis**

- Kurtosis is a measure of the peakedness of the probability distribution.
- The mathematical definition of the excess kurtosis is

$$\gamma_2 = \frac{\kappa_4}{\kappa_2^2} = \frac{\mu_4}{\sigma^4} - 3$$


where  $\mu_4$  is the fourth moment about the mean and  $\sigma$  is the standard deviation.

- The kurtosis of a normal distribution is zero.
- Distributions with a zero excess kurtosis are called mesokurtic.
- The distribution with a high kurtosis has a more distinct peak and fatter, longer tails.
- The distribution with a low kurtosis has a more rounded peak and thinner, shorter tails.




# **Kurtosis**

- Leptokurtic
  - Excess Kurtosis > 0
  - A sharper peak near the mean, declining rapidly, and fatter tails.

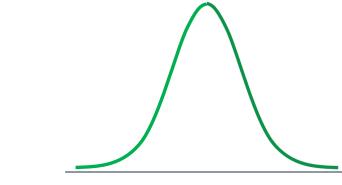

- Platykurtic
  - Excess Kurtosis < 0
  - A flatter top near the mean, declining slowly, and thinner tails.

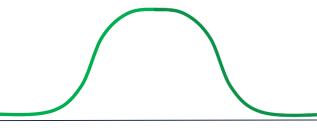




# **Multimodal Distribution**

- In statistics, a continuous probability distribution with two or more different unimodal distributions is called a **multimodal distribution**.
- A **unimodal distribution** has only one local maximum which is equal to its global maximum.
- A multimodal probability distribution has more than one local maximum.
  - Example: a bivariate, multimodal distribution

(Image source: S&P 500 Composite 20-year total real returns)

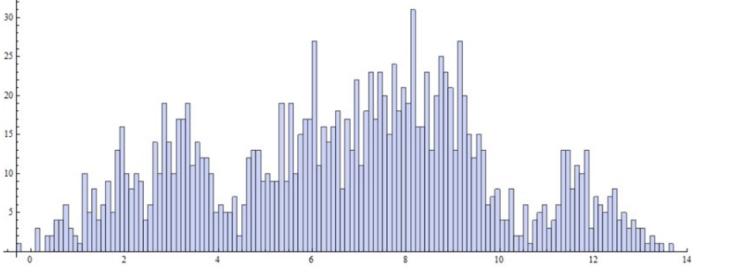




511

# **Bimodal Distribution**

- In statistics, a continuous probability distribution with two different unimodal distributions is called a **bimodal distribution**.
- A bimodal probability distribution has two local maxima.
- By mixing two unimodal distributions with different means the mixture distribution is not necessarily a bimodal distribution.
- The mixture of two normal distributions with the same standard deviation is a bimodal distribution only if the difference between their means is at least twice their common standard deviation.

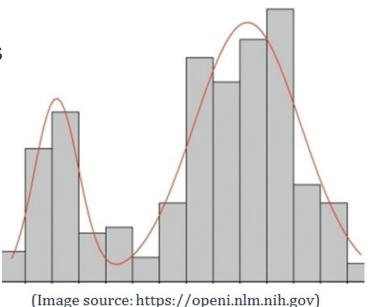



# **Examples of Discrete Distributions**

- Binomial Distribution
- Poisson Distribution



# **Binomial Distribution**

- Assume there is an experiment with *n* independent trials, each of which only has two potential outcomes (i.e., yes/no, fail/pass). *p* is the probability of one outcome and (1 p) is the probability of the other.
- **Binomial distribution** is a discrete probability distribution describing the probability of any outcome of the experiment.
- Excel formula for binomial distribution:
  - BINOMDIST(number\_s, trials, probability\_s, cumulative)



# **Binomial Distribution**

PMF of Binomial Distribution

the probability of getting *k* successes in *n* trials:

$$f(k;n,p) = \binom{n}{k} p^k (1-p)^{n-k} \text{ where } \binom{n}{k} = \frac{n!}{k!(n-k)!}$$

Mean of Binomial Distribution

 $n \times p$ 

• Variance of Binomial Distribution

$$n \times p \times (1-p)$$



# **Poisson Distribution**

- Poisson distribution is a discrete probability distribution describing the probability of a number of events occurring at a known average rate and in a fixed period of time. The expected number of occurrences in this fixed period of time is λ.
- Excel formula for Poisson distribution
  - POISSON(x, mean, cumulative)



# **Poisson Distribution**

- PMF of Poisson Distribution
  - the probability of getting k occurrences in *n* trials

$$f(k;\lambda) = \frac{\lambda^k e^{-\lambda}}{k!}$$

Mean of Poisson Distribution

### λ

Variance of Poisson Distribution





# **Examples of Continuous Distributions**

- Normal Distribution
- Exponential Distribution
- Weibull Distribution
- Student's t distribution
- Chi-square distribution
- F distribution



# Normal Distribution

- **Normal distribution** is a continuous probability distribution describing random variables which cluster around the mean.
- Its probability density function is a bell-shaped curve. But not all the bell-shaped PDFs are from normal distributions.
- It is the most extensively used distribution.
- Excel formula for normal distribution
  - NORMDIST(x, mean, standard\_dev, cumulative)
- The Empirical Rule (68-95-99.7 rule) for normal distribution:
  - about 68% of the data stay within  $\sigma$  from the mean
  - about 95% of the data stay within  $2\sigma$  from the mean
  - about 99.7% of the data stay within  $3\sigma$  from the mean.



# **Normal Distribution**

• PDF of Normal Distribution

$$\frac{1}{\sqrt{2\pi\sigma^2}}e^{-\frac{(x-\mu)^2}{2\sigma^2}}$$

Mean of Normal Distribution

### μ

• Variance of Normal Distribution



www.LeanSigmaCorporation.com

# **Exponential Distribution**

- **Exponential distribution** is a continuous probability distribution describing the probability of events occurring at a known constant average rate between points of time.
- The exponential distribution is very similar to the Poisson distribution, except that the former is built on continuous variables and the latter is built on discrete variables.
- Excel formula for exponential distribution
  - EXPONDIST(x, lambda, cumulative)



# **Exponential Distribution**

• PDF of Exponential Distribution

$$f(x;\lambda) = \begin{cases} \lambda e^{-\lambda x} & x \ge 0\\ 0 & x < 0 \end{cases}$$

Mean of Exponential Distribution

• Variance of Exponential Distribution

 $\lambda^2$ 



# Weibull Distribution

- Weibull distribution is a continuous probability distribution which is widely used to model a great variety of data due to its flexibility.
- *K* is the shape parameter and  $\lambda$  is the scale parameter. Both are positive numbers.
- Excel formula for Weibull distribution
  - WEIBULL(x, alpha, beta, cumulative)



# Weibull Distribution

• PDF of Weibull Distribution

$$f(x) = \begin{cases} \frac{k}{\lambda} \left(\frac{x}{\lambda}\right)^{k-1} e^{-(x/\lambda)k} & x \ge 0\\ 0 & x < 0 \end{cases}$$

Mean of Weibull Distribution

$$\lambda \Gamma \left(1 + \frac{1}{k}\right)$$

• Variance of Weibull Distribution

$$\lambda^2 \Gamma \left(1 + \frac{2}{k}\right) - \mu^2$$



# Student's T Distribution

- **Student's t distribution** is a continuous probability distribution that resembles a normal distribution.
- When *n* random samples were drawn from a normally-distributed population with the mean  $\mu$  and the standard deviation  $\sigma$ , then

$$t = \frac{\overline{x} - \mu}{s / \sqrt{n}}$$


follows a t distribution with (n - 1) degrees of freedom.

• Its probability density function is a bell-shaped curve but with heavier tails than those of the normal distribution.



# Student's T Distribution

• PDF of Student's T Distribution

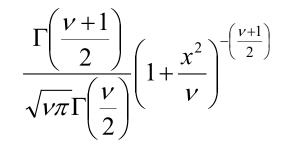

Mean of Student's T Distribution

0 for degrees of freedom greater than 1, otherwise undefined

Variance of Student's T Distribution

$$v/(v-2)$$
  $v > 2$   
 $\infty$   $1 < v \le 2$   
undefined otherwise



526

# **Chi-Square Distribution**

- Chi-square distribution is a continuous probability distribution of the sum of squares of multiple independent standard normal random variables.
- If  $Y_1, Y_2, ..., Y_k$  are a group of independent normal distributed variables, each with mean 0 and standard deviation 1, then

$$\chi^2 = \sum_{i=1}^k Y_i^2$$

follows a chi-square distribution with *k* degrees of freedom.



# **Chi-Square Distribution**

• PDF of Chi-Square Distribution

$$\frac{1}{2^{\frac{k}{2}}\Gamma(k/2)}x^{k/2-1}e^{-x/2}$$

Mean of Chi-Square Distribution

k

• Variance of Chi-Square Distribution



# F Distribution

- F distribution is a continuous probability distribution which arises in the analysis of variance or test of equality between two variances.
- If  $\chi^2_{\nu_1}$  and  $\chi^2_{\nu_2}$  are independent variables with chi-square distributions with  $\nu_1$  and  $\nu_2$  degrees of freedom,

$$F = \frac{\chi_{\nu_1}^2 / \nu_1}{\chi_{\nu_2}^2 / \nu_2}$$

follows a F distribution.



• PDF of F Distribution

$$\frac{\sqrt{\frac{(\nu_1 x)^{\nu_1} \nu_2^{\nu_2}}{(\nu_1 x + \nu_2)^{\nu_1 + \nu_2}}}}{xB\left(\frac{\nu_1}{2}, \frac{\nu_2}{2}\right)}$$

Mean of F Distribution

$$\frac{\nu_2}{\nu_2 - 2}$$

• Variance of F Distribution

$$\frac{2v_2^2(v_1+v_2-2)}{v_1(v_2-2)^2(v_2-4)}$$



530

 $\odot$ 

# Use JMP to Fit a Distribution

- Case Study: We are interested to fit the height data of basketball players into a distribution.
- Data File: "OneSampleT-Test.jmp"
- Steps to fit a distribution in JMP
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "HtBk"
  - 5. Click Continuous Fit -> All




E Distribution - JMP		
The distribution of values in each column		
- Select Columns	Cast Selected Columns into Roles -	Action
I Columns	Y, Columns 🛛 HtBk	ОК
HtBk	Weight optional numeric	Cancel
Histograms Only	Freq optional numeric	
	By optional	Remove
		Recall
	·	Help



 $\odot$ 

# Use JMP to Fit a Distribution

- The distribution that the data fit the best is listed in the first row of the table "Compare Distribution" with a small check-mark and the smallest AIC<sub>c</sub> value.
- In this example, the data fit the normal distribution best.

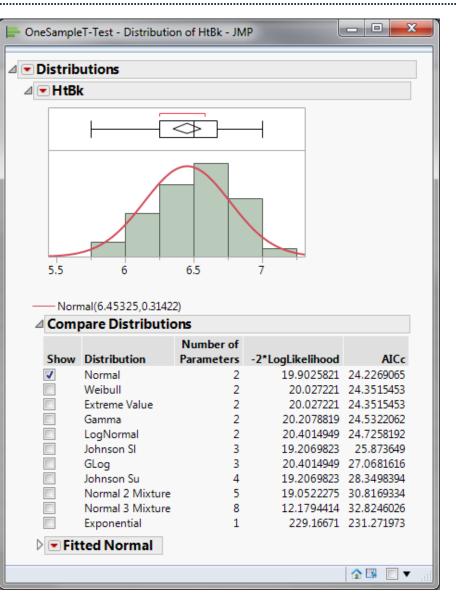



# **3.2 Inferential Statistics**



# Black Belt Training: Analyze Phase

#### **3.1 Patterns of Variation**

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

3.4 Hypothesis Testing: Normal Data3.4.1 One and Two Sample T-Tests3.4.2 One sample variance3.4.3 One Way ANOVA

### 3.5 Hypothesis Testing: Non-Normal Data

3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# 3.2.1 Understanding Inference



# What is Statistical Inference?

- Statistical inference is the process of making inferences regarding the characteristics of an unobservable population based on the characteristics of an observed sample.
- We rely on sample data to draw conclusions about the population from which the sample is drawn.
- Statistical inference is widely used since it is difficult or sometimes impossible to collect the entire population data.



# **Outcome of Statistical Inference**

- The outcome or conclusion of statistical inference is a **statistical proposition** about the population.
- Examples of statistical propositions:
  - Estimating a population parameter
  - Identifying an interval or a region where the true population parameter would fall with some certainty
  - Deciding whether to reject a hypothesis made on characteristics of the population of interest
  - Making predictions
  - Clustering or partitioning data into different groups.



# **Population and Sample**

- m the second second
- A statistical population is an entire set of objects or observations about which statistical inferences are to be drawn based on its sample.
- It is usually impractical or impossible to obtain the data for the entire population. For example, if we are interested in analyzing the population of all the trees, it is extremely difficult to collect the data for all the trees that existed in the past, exist now, and will exist in the future.
- A **sample** is a subset of the population (like a piece of the pie above). It is necessary for samples to be *representative* of the population.
- The process of selecting a subset of observations within a population is referred to as sampling.

# **Population and Sample**

- Population Parameters (Greek letters)
  - Mean: µ
  - Standard deviation: σ
  - Variance: σ<sup>2</sup>
  - Median: η

- Sample Statistics (Roman letters)
  - Sample Mean: $\bar{X}$
  - Standard deviation: S
  - Variance:  $S^2$
  - Median: X

- The population parameter is the numerical summary of a population.
- The **sample statistic** is the numerical measurement calculated based on a sample of that population. It is used to estimate the true population parameter.



 $\odot$ 

# Descriptive Statistics vs. Statistical Inference

#### Descriptive Statistics

- Descriptive statistics summarize the characteristics of a collection of data.
- Descriptive statistics are descriptive only and they do not make any generalizations beyond the data at hand.
- Data used for descriptive statistics are for the purpose of representing or reporting.

#### Statistical Inference

- Statistical inference makes generalizations from a sample at hand of a population.
- Data used for statistical inference are for the purpose of making inferences on the entire population of interest.
- A complete statistical analysis includes *both* descriptive statistics and statistical inference.



#### **Error Sources of Statistical Inference**

- Statistical inference uses sample data to best approximate the true features of the population.
- A valid sample must be unbiased and representative of the population.
- Two sources of error in statistical inference:
  - Random sampling error
  - Selection bias.



#### **Error Sources of Statistical Inference**

- Random Sampling Error
  - Random variation due to observations being selected randomly
  - It is inherent to the sampling process and beyond one's control.
- Selection Bias
  - Non-random variation due to inadequate design of sampling
  - It can be improved by adjusting the sampling size and sampling strategy.



543

# 3.2.2 Sampling Techniques



# What is Sampling?

- **Sampling** is the process of selecting objects or observations from a population of interest about which we wish to make a statistical inference.
- It is extensively used to collect information about a population, which can represent physical or intangible objects.





# **Advantages of Sampling**

- It is usually impractical or impossible to collect the data of an entire population:
  - High cost
  - Time consuming
  - Unavailability of historical records
  - Dynamic nature of the population.
- Advantages of sampling a representative subset of the population:
  - Lower cost
  - Faster data collection
  - Easier to manipulate.



### Uses of Sample

- With valid samples collected, we can draw statistical conclusions about the population of our interest.
- There are two major uses of samples in making statistical inference:
  - *Estimation*: estimating the population parameters using the sample statistics.
  - *Hypothesis testing*: testing a statement about the population characteristics using sample data.
- This module covers sample size calculation for estimation purposes only. Sample size calculations for hypothesis testing purposes will be covered in the Hypothesis Testing module.



# **Basic Sampling Steps**

- 1) Determine the population of interest
- 2) Determine the sampling frame
- 3) Determine the sampling strategy
- 4) Calculate the sample size
- 5) Conduct sampling



## Population

- **Population** in statistics is the entire set of objects or observations about which we are interested to draw conclusions or make generalizations based on some representative sample data.
- A population can be either physical or intangible.
  - Physical: trees, customers, monitors etc.
  - Intangible: credit score, pass/fail decisions etc.
- A population can be static or dynamic
  - Characteristics of individuals are relatively static over time
  - Items making up the population continue to change or be generated over time
- The population covers all the items with characteristics we are interested to analyze.



# **Sampling Frame**

- In the ideal situation, the scope of a population could be defined.
  - Example: Mary is interested to know how the soup she is cooking tastes. The population is simply the pot of soup.
- However, in some other situations, the population cannot be identified or defined precisely.
  - Example: to collect the information for an opinion poll, we do not have a list of all the people in the world at hand.
- A **sampling frame** is a list of items of the population (preferably the entire population; if not, approximate population).
  - Example: The telephone directory would be a sampling frame for opinion poll data collection.



# **Basic Sampling Strategies**

- Simple Random Sampling
- Matched Random Sampling
- Stratified Sampling
- Systematic Sampling
- Proportional to Size Sampling
- Cluster Sampling



#### **Simple Random Sampling**

- Simple random samples are selected in such a way that each item in the population has an equal chance of being selected.
- There is no bias involved in the sample selection. Such selection minimizes the variation between the characteristics of samples and the population.
- It is the basic sampling strategy.



# Matched Random Sampling

- Matched random samples are samples randomly selected in pairs, each of which has the same attribute.
- Example:
  - Researchers are interested in understanding the weight of twins.
  - Researchers are interested in understanding the patients' blood pressure before and after taking some medicine.



## Stratified Sampling

- A population can be grouped or "stratified" into distinct and independent categories. An individual category can be considered as a sub-population. **Stratified samples** are randomly selected in each category of the population.
- The categories can be gender, region, income level etc.
- Stratified sampling requires advanced knowledge of the population characteristics.
- Example: A fruit store wants to measure the quality of all their oranges. They decide to use stratified sampling by region to collect sample data. Since about 40% of their oranges are from California, 40% of the sample is selected from the California

V

oranges sub-population.

# Systematic Sampling

- Systematic samples are selected at regular intervals based on an ordered list where items in the population are arranged according to a certain criterion.
- Systematic sampling has a random start and then every *i*<sup>th</sup> item is selected going forward.
- For example, we are sampling the every 5<sup>th</sup> unit produced on the production line.



## Cluster Sampling

- **Cluster sampling** is a sampling method in which samples are only selected from certain clusters or groups of the population.
- It reduces the cost and time spent on the sampling but bears the risk that the selected clusters are biased.
- For example, selecting samples from the region where researchers are located so that the cost and time spent on travelling is reduced.



# **Sampling Strategy Decision Factors**

- When determining the sampling strategy, we need to consider the following factors:
  - Cost and time constraints
  - Nature of the population of interest
  - Availability of advanced knowledge of the population
  - Accuracy requirement.





- The **sample size** is a critical element that can influence the results of statistical inference.
- The smaller the sample size, the higher the risk that the sample statistic will not reflect the true population parameter.
- The greater the sample size, the more time and money we will spend on collecting the samples.



#### Sample Size Factors

- Is the variable of interest continuous or discrete?
- How large is the population size?
- How much risk do you want to take regarding missing the true population parameters?
- What is the acceptable margin of error you want to detect?
- How much is the variation in the population?



#### Sample Size Calculation for Continuous Data

• Sample size equation for continuous data

$$n_0 = \left(\frac{Z_{\alpha/2} \times s}{d}\right)^2$$

where

 $n_0$  is the number of samples.

 $Z_{\alpha/2}$  is the *Z* score when risk level is  $\alpha/2$ .

- When *α* is 0.05, it is 1.96.
- When *α* is 0.10, it is 1.65.


s is the estimation of standard deviation in the population

*d* is the acceptable margin of error.



### Sample Size Calculation for Continuous Data

When the sample size calculated using the formula

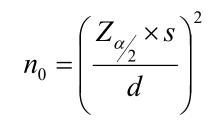


exceeds 5% of the population size, we use a correction formula to calculate the final sample size.

$$n = \frac{n_0}{\left(1 + \frac{n_0}{N}\right)}$$

where

 $n_0$  is the sample size calculated using equation  $n_0 = \left(\frac{Z_{\alpha/2} \times s}{d}\right)^2$ *N* is the population size.

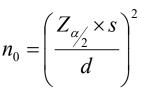



#### Sample Size Calculation for Discrete Data

• Sample size equation for discrete data

$$n_0 = \left(\frac{Z_{\alpha/2}}{d}\right)^2 \times p \times (1-p)$$

where

 $n_0$  is the number of samples.

 $Z_{\alpha_2}$  is the Z score when risk level is  $\alpha/2$ .

- When α is 0.05, it is 1.96.
- When *α* is 0.10, it is 1.65.

s is the estimation of standard deviation in the population.

*d* is the acceptable margin of error.

*p* is the proportion of one type of event occurring (e.g., proportion of passes).

 $p \times (1 - p)$  is the estimate of variance.



#### Sample Size Calculation for Discrete Data

• When the sample size calculated using the formula

$$n_0 = \left(\frac{Z_{\alpha/2}}{d}\right)^2 \times p \times (1-p)$$

exceeds 5% of the population size, we use a correction formula to calculate the final sample size.

$$n = \frac{n_0}{\left(1 + \frac{n_0}{N}\right)}$$

where

 $n_0$  is the sample size calculated using equation N is the population size.

$$n_0 = \left(\frac{Z_{\alpha/2}}{d}\right)^2 \times p \times (1-p)$$



www.LeanSigmaCorporation.com

# Sampling Errors

- Random Sampling Error
  - Random variation due to observations being selected randomly
  - It is inherent in the sampling process and beyond one's control.
- Selection Bias
  - Non-random variation due to inadequate design of sampling
  - It can be improved by adjusting the sampling size and sampling strategy.









- The sample size is a critical element that can influence the results of hypothesis testing.
- The smaller the sample size, the higher the risk that the statistical conclusions will not reflect the population relationship.
- The greater the sample size, the more time and money we will spend on collecting the samples.



 $\odot$ 

#### Sample Size Calculation

• General sample size formula for continuous data

$$n = \left(\frac{\left(Z_{\alpha/2} + Z_{\beta}\right) \times s}{d}\right)^{2}$$

• General sample size formula for discrete data

$$n = \left(\frac{Z_{\alpha/2} + Z_{\beta}}{d}\right)^2 \times p \times (1-p)$$



#### Sample Size Calculation

- *n* is the number of observations in the sample.
- $\alpha$  is the risk of committing a false positive error.
- $\beta$  is the risk of committing a false negative error.
- s is the estimation of standard deviation in the population
- *d* is the size of effect you want to be able to detect.
- *p* is the proportion of one type of event occurring (e.g. proportion of passes).



- Case study:
  - We are interested in comparing the average retail price of a product between two states.
  - We will run a hypothesis test on the two sample means to determine whether there is a statistically significant difference between the retail price in the two states.
  - The average retail price of the product is \$23 based on our estimation and the standard deviation is 3. We want to detect at least a \$2 difference with a 90% chance when it is true and we can tolerate the alpha risk at 5%
  - What should the sample size be?



569

- Steps to calculate the sample size in JMP
  - 1. Click DOE -> Design Diagnostics -> Sample Size and Power
  - 2. Click "Two Sample Means"
  - 3. Enter the alpha level: 0.05
  - 4. Enter the standard deviation value: 3
  - 5. Enter the difference to detect: 2
  - 6. Enter the power: 0.90
  - 7. Click "Continue"
  - 8. The sample size result appears in the box next to "Sample Size"



Sample Size and Power - JMP	Sample Size and Power - JMP	Sample Size and Power - JMP
⊿ Sample Size		
Prospective Power and Sample Size Calculations	<sup>⊿</sup> Sample Size	Sample Size
Select Situation for Sample Size or Power calculation	Two Means	Two Means
One Sample Mean Sample Size for testing a mean in a single sample	Testing if two means are different from each other.	Testing if two means are different from each other. Alpha 0.05
Two Sample Means Testing that the means are different across 2 samples	Std Dev 3	Std Dev 3
k Sample Means Testing that the means are different across k samples	Extra Parameters 0	Extra Parameters 0
One Sample Standard Deviation Sample Size for detecting a change in the standard deviation.	Supply two values to determine the third.	Supply two values to determine the third.
One Sample Proportion Sample Size for testing a proportion in a single sample	Enter one value to see a plot of the other two.	Enter one value to see a plot of the other two.
Two Sample Proportions across 2 samples	Difference to detect 2	Difference to detect 2
Counts per Unit Sample Size for detecting change in count per unit, e.g. DPU (defects per unit)	Sample Size . Power 0.9	Sample Size     97       Power     0.9
Sigma Quality Level Calculator for a popular index in terms of defects per opportunity.	Sample Size is the total sample size; per group would be n/2 Continue	Sample Size is the total sample size; per group would be n/2 Continue
Reliability Test Plan Sample size for reliability studies		
Reliability Demonstration Calculations for planning a reliability demonstration	Back	Back
🗈 🗖 🖈 📑		<b>☆ □ ▼</b>



Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

- If the value of the difference to detect is not entered, JMP will return a chart with X axis being the difference to detect and Y axis being the sample size.
  - When the difference to detect decreases, the required sample size increases.

🖩 Sample Size and Power - JMP	Sample Size and Power - JMP
⊿ Sample Size	<sup>⊿</sup> Sample Size Two Means
Two Means         Testing if two means are different from each other.         Alpha       0.05         Std Dev       3         Extra Parameters       0	Error Std Dev Power Alpha 3 0.9 0.05 100 80
Supply two values to determine the third. Enter one value to see a plot of the other two.	en e
Sample Size         .           Power         0.9           Sample Size is the total sample size; per group would be n/2	20
Continue Back	0 0.0 0.5 1.0 1.5 2.0 2.5 3.0 Difference Back



# 3.2.4 Central Limit Theorem



© Lean Sigma Corporation Lean Six Sigma Training - JMP 573

## What is Central Limit Theorem?

- The **Central Limit Theorem** is one of the fundamental theorems of probability theory.
- It states a condition under which the mean of a large number of independent and identically-distributed random variables, each of which has a finite mean and variance, would be approximately normally distributed.





# What is Central Limit Theorem?

- Let us assume  $Y_1, Y_2, ..., Y_n$  is a sequence of *n* i.i.d. random variables, each of which has finite mean  $\mu$  and variance  $\sigma^2$ , where  $\sigma^2 > 0$ .
- When *n* increases, the sample average of the *n* random variables is approximately normally distributed, with the mean equal to  $\mu$  and variance equal to  $\sigma^2/n$ , regardless of the common distribution Y<sub>i</sub> follows where *i* = 1, 2, ..., *n*.



## Independent and Identically Distributed

- A sequence of random variables is **independent and identically distributed** (i.i.d.) if each random variable is independent of others and has the same probability distribution as others.
- It is one of the basic assumptions in Central Limit Theorem.



# Central Limit Theorem Example





- Each time we roll all 10 die together we record the average of the 10 die.
- We repeat rolling the die 50 times until we will have 50 data points.
- Upon doing so, we will discover that the probability distribution of the sample average approximates the normal distribution even though a single roll of a fair die follows a discrete uniform distribution.



578

#### Central Limit Theorem Explained in Formulas

• Let us assume  $Y_1, Y_2, ..., Y_n$  are i.i.d. random variables with

$$E(Y_i) = \mu_Y$$
 where  $-\infty < \mu_Y < \infty$   
 $var(Y_i) = \sigma_Y^2$  where  $0 < \sigma_Y^2 < \infty$ 

As  $n \to \infty$ , the distribution of  $\overline{Y}$  becomes approximately normally distributed with

$$E(\overline{Y}) = \mu_{Y}$$
$$\operatorname{var}(\overline{Y}) = \sigma_{\overline{Y}}^{2} = \frac{\sigma_{Y}^{2}}{n}$$



## **Central Limit Theorem Application**

- Use the sample mean to estimate the population mean.
- If the assumptions of Central Limit Theorem are met,

$$E(Y_i) = E(\overline{Y})$$
 where  $i = 1, 2, ..., n$ 



### **Central Limit Theorem Application**

• Use standard error of the mean to measure the standard deviation of the sample mean estimate of a population mean.

$$SE_{\overline{Y}} = \frac{S}{\sqrt{n}}$$

where *s* is the standard deviation of the sample and *n* is the sample size.

• Standard deviation of the population mean

$$SD_{\overline{Y}} = \frac{\sigma}{\sqrt{n}}$$

where  $\sigma$  is the standard deviation of the population and *n* is the sample size.



### **Central Limit Theorem Application**

- Use a larger sample size, if economically feasible, to decrease the variance of the sampling distribution.
- The larger the sample size, the more precise the estimation of the population parameter.
- Use a confidence interval to describe the region which the population parameter would fall in.
- The sample distribution approximates the normal distribution in which 95% of the data stays within two standard deviations from the center.
- Population mean would fall in the interval of two standard errors of the mean away from the sample mean, 95% of the time.



#### Confidence Interval

- The **confidence interval** is an interval where the true population parameter would fall within a certain confidence level.
- A 95% confidence interval indicates that the population parameter would fall in that region 95% of the time or we are 95% confident that the population parameter would fall in that region.
- 95% is the most commonly used confidence level.
- Confidence interval is used to describe the reliability of a statistical estimate of a population parameter.



#### **Confidence Interval**

- The width of a confidence interval depends on:
  - Confidence level
  - Sample size
  - Variability in the data.
- The higher the confidence level, the wider the confidence interval.
- The smaller the sample size, the wider the confidence interval.
- The more variability, the wider the confidence interval.



#### Confidence Interval of the Mean

• Confidence interval of the population mean  $\mu_Y$  of a continuous variable Y is

$$\left[\overline{Y} - Z_{\alpha/2} \times \left(\frac{\sigma}{\sqrt{n}}\right), \overline{Y} + Z_{\alpha/2} \times \left(\frac{\sigma}{\sqrt{n}}\right)\right]$$

#### where

 $\overline{Y}$  is the sample mean  $\sigma$  is the standard deviation of the population n is the sample size  $Z_{\alpha_{\lambda}}$  is the Z score when risk level is  $\alpha/2$ .

- When α is 0.05, it is 1.96.
  - When *α* is 0.10, it is 1.65.
- lpha is (1 confidence level).
  - When confidence level is 95%,  $\alpha$  is 5%.

Ø

• When the confidence level is 90%,  $\alpha$  is 10%.

Special Note: Since 95% is the most commonly used confidence level, 0.05 is the most commonly used  $\alpha$  (also called alpha level).

#### JMP: Calculate the Confidence Interval of the Mean

- Data File: "Central Limit Theorem.jmp"
- Steps:
  - 1. Click Analyze -> Distribution
  - 2. Select "Cycle Time (Minutes)" as the "Y, Columns"
  - 3. Click "OK"
  - 4. "Upper 95% Mean" and "Lower 95% Mean" at the bottom of the newly generated window are the upper and lower boundaries of 95% confidence interval.



#### JMP: Calculate the Confidence Interval of the Mean

Distribution - JMP						
The distribution of values in each column				🖉 💌 Summary Statisti		
- Select Columns	Cast Selected Columns into Roles	Action —	Summary Statistics			
I Columns	Y, Columns Cycle Time (Minutes)	ОК		Mean	703.16667	
Cycle Time (Minutes)	Weight optional numeric	Cancel		Std Dev	1180.9511	
Histograms Only	Freq optional numeric			Std Err Mean	215.61119	
	By optional	Remove		Upper 95% Mean	1144.1411	
		Recall		Lower 95% Mean	262.19226	
		Help		N	30	




 $\odot$ 

 $\bigcirc$ 

Lean Sigma Corporation

## JMP: Calculate the Confidence Interval of the Mean

- In JMP, the confidence level is 95% by default.
- In order to see the confidence interval of "Cycle Time (Minutes)" at other confidence levels, we need to
  - Click on the red triangle button next to "Cycle Time (Minutes)"
  - Select Confidence Interval -> the confidence level of interest (e.g. 90%, 95%, 99% etc.)
  - The confidence interval at the selected confidence level appears at the bottom of the distribution analysis page

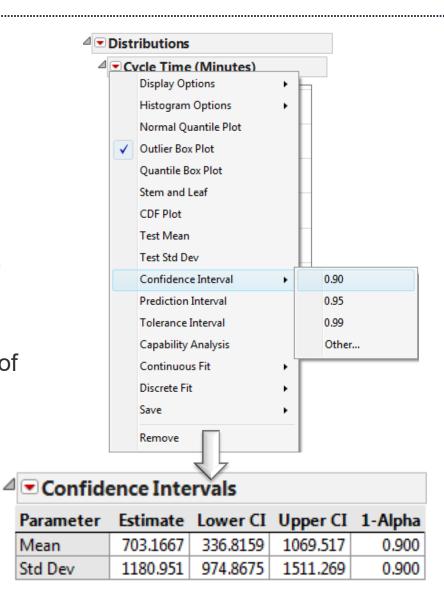



# 3.3 Hypothesis Testing



### Black Belt Training: Analyze Phase

#### **3.1 Patterns of Variation**

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

3.4 Hypothesis Testing: Normal Data3.4.1 One and Two Sample T-Tests3.4.2 One sample variance3.4.3 One Way ANOVA


#### 3.5 Hypothesis Testing: Non-Normal Data

3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# 3.3.1 Goals of Hypothesis Testing



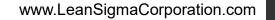

### What is Hypothesis Testing?

- A **hypothesis test** is a statistical method in which a specific hypothesis is formulated about a population, and the decision of whether to reject the hypothesis is made based on sample data.
- Hypothesis tests help to determine whether a hypothesis about a population or multiple populations is true with certain confidence level based on sample data.



591

# Hypothesis Testing Examples

- Hypothesis testing tries to answer whether there is a difference between different groups or there is some change occurring.
  - Are the average SAT scores of graduates from high school A and B the same?
  - Is the error rate of one group of operators higher than that of another group?
  - Are there any non-random causes influencing the height of kids in one state?



#### What is Statistical Hypothesis?

- A statistical hypothesis is an assumption about one or multiple population.
- It is a statement about whether there is any difference between different groups.
- It can be a conjecture about the population parameters or the nature of the population distributions.
- A statistical hypothesis is formulated in pairs:
  - Null Hypothesis
  - Alternative Hypothesis.



### Null and Alternative Hypotheses

- *Null Hypothesis* (H<sub>0</sub>) states that:
  - there is no difference in the measurement of different groups
  - no changes occurred
  - sample observations result from random chance.
- Alternative Hypothesis ( $H_1$  or  $H_a$ ) states that:
  - there is a difference in the measurement of different groups
  - some changes occurred
  - sample observations are affected by non-random causes.



## Null and Alternative Hypotheses

- A statistical hypothesis can be expressed in mathematical language by using population parameters (Greek letters) and mathematical symbols.
  - Population Parameters
     (Greek letters)
    - Mean: µ
    - Standard deviation: σ
    - Variance:  $\sigma^2$
    - Median: η

- <u>Mathematical Symbols</u>
  - Equal: =
  - Not equal: ≠
  - Greater than: >
  - Smaller than:



## Null and Alternative Hypotheses

• Examples of null and alternative hypotheses written in mathematical language.

$$\begin{array}{c}
H_{0}: \mu_{1} = \mu_{2} \\
H_{1}: \mu_{1} \neq \mu_{2} \\
\begin{array}{c}
H_{0}: \sigma_{1} = 0 \\
H_{1}: \sigma_{1} \neq 0 \\
\end{array}$$

$$\begin{array}{c}
H_{0}: \eta_{1} = 10 \\
H_{1}: \eta_{1} > 10 \\
\end{array}$$

$$\begin{array}{c}
H_{0}: \mu_{1} = 10 \\
H_{1}: \mu_{1} < 10
\end{array}$$




596

## Hypothesis Testing Conclusion

- There are two possible conclusions of hypothesis testing:
  - Reject the null
  - Fail to reject the null.
- When there is enough evidence based on the sample information to prove the alternative hypothesis, we reject the null.
- When there is *not* enough evidence or the sample information is *not* sufficiently persuasive, we fail to reject the null.



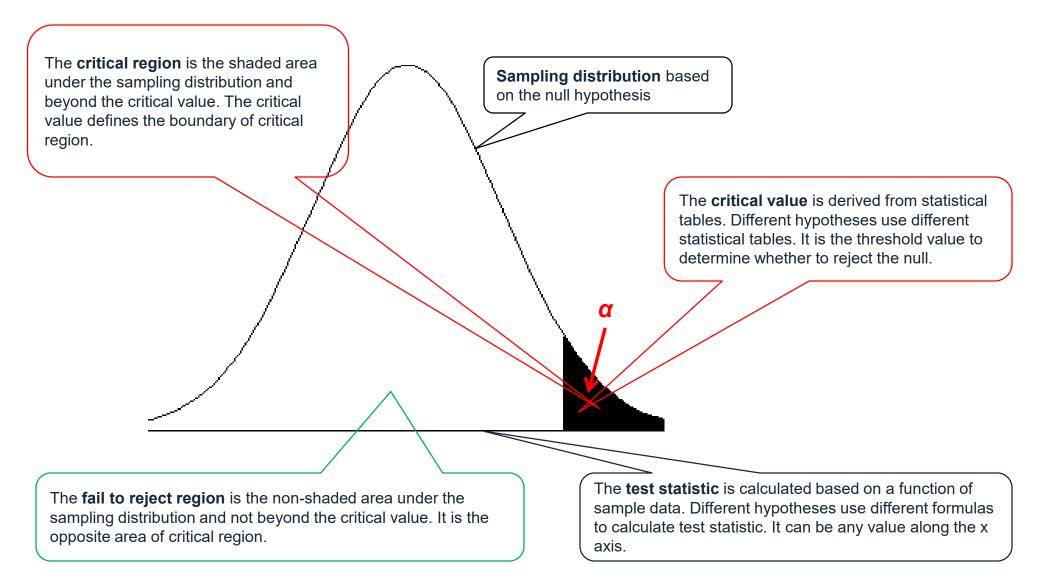

Lean Six Sigma Training - JMP

 $\bigcirc$ 

Lean Sigma Corporation



- The **test statistic** in hypothesis testing is a value calculated using a function of the sample.
- Test statistics are considered the sample data's numerical summary that can be used in hypothesis testing.
- Different hypothesis tests have different formulas to calculate the test statistic.
- The critical value in hypothesis testing is a threshold value to which the test statistic is compared in order to determine whether the null hypothesis is rejected.
- The critical value is obtained from statistical tables.
- Different hypothesis tests need different statistical tables for critical values.



- When the test statistic falls into the fail to reject region, we fail to reject the null and claim that there is no statistically significant difference between the groups.
- When the test statistic falls into the critical region, we reject the null and claim that there is a statistically significant difference between the groups.



- The proportion of the area under the sampling distribution and beyond the critical value indicates α risk (also called *α level*). The most commonly selected α level is 5%.
- The proportion of the area under the sampling distribution and beyond the test statistic is the *p-value*. It is the probability of getting a test statistic at least as extreme as the observed one, given the null is true.



- When the p-value is smaller than the α level, we reject the null and claim that there is a statistically significant difference between different groups.
- When the p-value is higher than the α level, we fail to reject the null and claim that there is no statistically significant difference between different groups.



# Steps in Hypothesis Testing

- Step 1: State the null and alternative hypothesis.
- Step 2: Determine  $\alpha$  level.
- Step 3: Collect sample data.
- Step 4: Select a proper hypothesis test.
- Step 5: Run the hypothesis test.
- Step 6: Determine whether to reject the null.



# 3.3.2 Statistical Significance



#### **Statistical Significance**

- In statistics, an observed difference is *statistically significant* if it is unlikely that the difference occurred by pure chance, given a predetermined probability threshold.
- Statistical significance indicates that there are some non-random factors causing the result to take place.
- The statistical significance level in hypothesis testing indicates the amount of evidence which is sufficiently persuasive to prove that a difference between groups exists not due to random chance alone.



#### **Practical Significance**

- An observed difference is *practically significant* when it is large enough to make a practical difference.
- A difference between groups that is *statistically significant* might not be large enough to be practically significant.
- In some business situations, statistical differences can have little to no meaning because the difference is not large enough to be practical for a business to act upon.





- You started to use the premium gas recently, which was supposed to make your car run better.
- After running a controlled experiment to measure the performance of the car before and after using the premium gas, you performed a statistical hypothesis test and found that the difference before and after was statistically significant.
- Using premium gas did improve the performance.



• However, due to the high cost of the premium gas, you decided that the difference was not large enough to make you pay extra money for it. In other words, the difference is not practically significant.



# 3.3.3 Risk; Alpha & Beta



# Errors in Hypothesis Testing

- In statistical hypothesis testing, there are two types of errors:
  - Type I Error
    - a null hypothesis is rejected when it is true in fact.
  - Type II Error
    - a null hypothesis is not rejected when it is not true in fact.

	Null hypothesis is true	Alternative hypothesis is true
Fail to reject null hypothesis	Correct	Incorrect (Type II Error)
Reject null hypothesis	Incorrect (Type I Error)	Correct



# Type I Error

- Type I error is also called false positive, false alarm, or alpha ( $\alpha$ ) error.
- Type I error is associated with the risk of accepting false positives.
- It occurs when we think there is a difference between groups but in fact there is none.
- Example: telling a patient he is sick and in fact he is not.



# Alpha (α)

- $\alpha$  indicates the probability of making a type I error. It ranges from 0 to 1.
- $\alpha$  risk is the risk of making a type I error.
- 5% is the most commonly used  $\alpha$ .
- $(100\% \alpha)$  is the confidence level which is used to calculate the confidence intervals.
- When making a decision on whether to reject the null, we compare the p-value against α:
  - If p-value is smaller than  $\alpha$ , we reject the null
  - If p-value is greater than  $\alpha$ , we fail to reject the null.
- To reduce the  $\alpha$  risk, we decrease the  $\alpha$  value to which the p-value is compared.



611

# Type II Error

- Type II error is also called false negative, oversight, or beta ( $\beta$ ) error.
- Type II error is associated with the risk of accepting false negatives.
- It occurs when we think there is not any difference between groups but in fact there is.
- Example: telling a patient he is not sick and in fact he is.





- $\beta$  indicates the probability of making a type II error. It ranges from 0 to 1.
- β risk is the risk of making a type II error.
- 10% is the most commonly used  $\beta$ .
- $(100\% \beta)$  is called *power*, which denotes the probability of detecting a difference between groups when in fact the difference truly exists.
- To reduce the  $\beta$  risk, we increase the sample size.
- When holding other factors constant,  $\beta$  is inversely related to  $\alpha$ .



# © Lean Sigma Corporation Lean Six Sigma Training - JMP



3.3.4 Types of Hypothesis Tests

## Two Types of Hypothesis Tests

#### Two-tailed hypothesis test

- It is also called two-sided hypothesis test
- It is a statistical hypothesis test in which the critical region is split into two equal areas, each of which stays on one side of the sampling distribution.

#### One-tailed hypothesis test

- It is also called one-sided hypothesis test
- It is a statistical hypothesis test in which the critical region is only on one side of the sampling distribution.



#### Two-Tailed Hypothesis Test

- A two-tailed hypothesis test is used when we care about whether there is a difference between groups and we do not care about the direction of the difference.
- Examples of a two-tailed hypothesis test:


 $H_0: \mu_1 = 10$  $H_a: \mu_1 \neq 10$ 

The null hypothesis  $(H_0)$  is rejected when:

- the test statistic falls into either half of the critical region
- the test statistic is either sufficiently small or sufficiently large
- the absolute value of the test statistic is greater than the absolute value of the critical value.
- A two-tailed hypothesis test is the most commonly used hypothesis test. In the next modules we will cover more details about it.



#### Two-Tailed Hypothesis Test

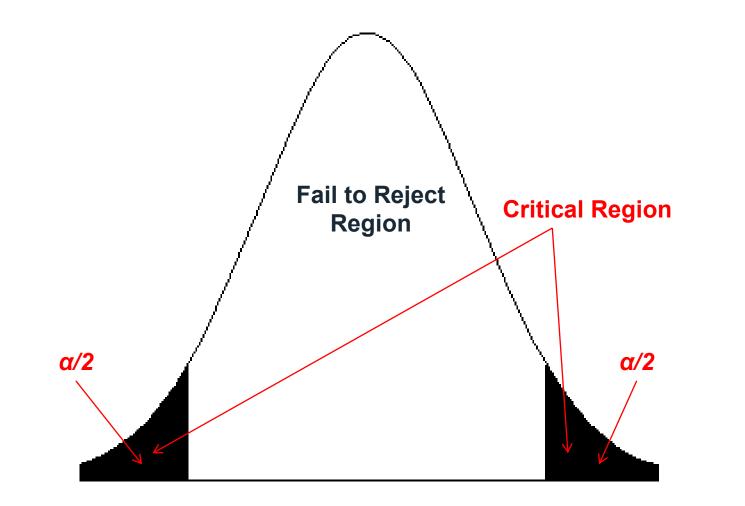




#### www.LeanSigmaCorporation.com

- A one-tailed hypothesis test is used when we care about one direction of the difference between groups.
- Examples of one-tailed hypothesis tests:

 $H_0: \mu_1 = 10$  $H_a: \mu_1 > 10$ 

- The null hypothesis is rejected when the test statistic:
  - falls in the critical region which exists on the right side of the sampling distribution
  - is sufficiently large
  - is greater than the critical value.



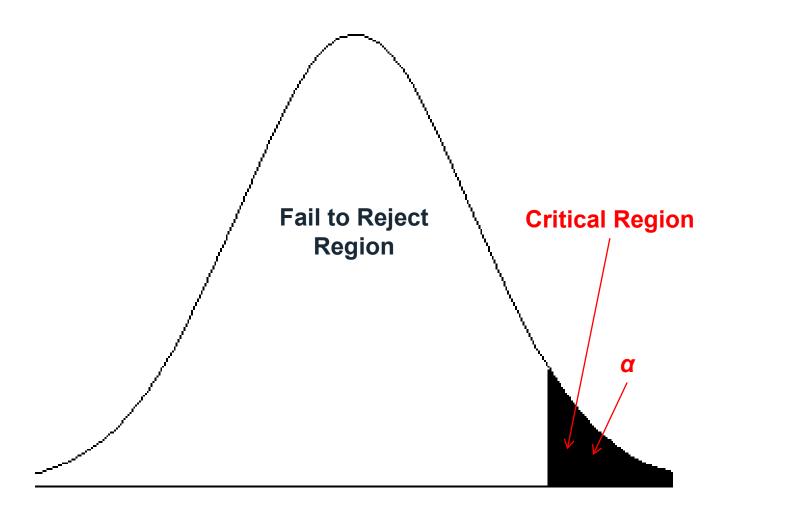




• Examples of one-tailed hypothesis test

 $H_0: \mu_1 = 10$  $H_a: \mu_1 < 10$ 

- The null hypothesis is rejected when the test statistic:
  - falls into the critical region which only exists on the left side of the sampling distribution
  - is sufficiently small
  - is smaller than the critical value.



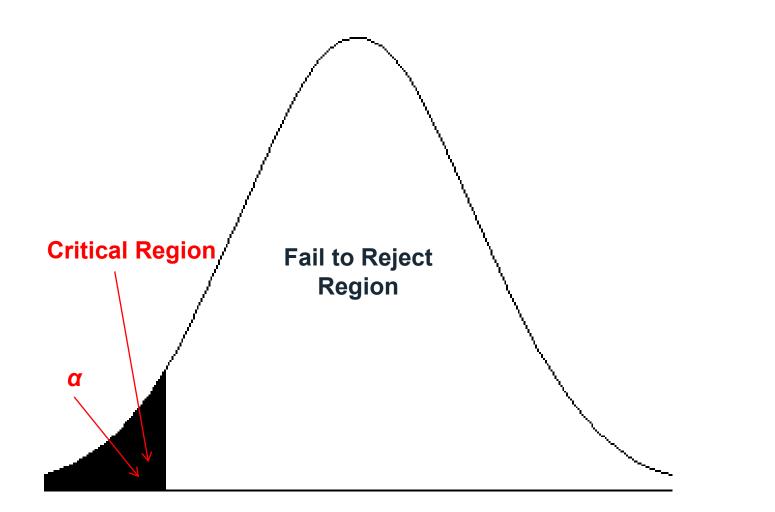

## 3.4 Hypothesis Tests: Normal Data



www.LeanSigmaCorporation.com

### Black Belt Training: Analyze Phase

#### **3.1 Patterns of Variation**

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

## 3.4 Hypothesis Testing: Normal Data3.4.1 One and Two Sample T-Tests3.4.2 One sample variance3.4.3 One Way ANOVA

3.5 Hypothesis Testing: Non-Normal Data
3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# © Lean Sigma Corporation Lean Six Sigma Training - JMP



3.4.1 One & Two Sample T-Tests

#### What is a T-Test?

- In statistics, a **t-test** is a hypothesis test in which the test statistic follows a *Student t* distribution if the null hypothesis is true.
- We apply a t-test when the population variance (σ) is unknown and we use the sample standard deviation (s) instead.



#### What is One Sample T-Test?

- One sample t-test is a hypothesis test to study whether there is a statistically significant difference between a population mean and a specified value.
  - Null Hypothesis (H<sub>0</sub>):  $\mu = \mu_0$
  - Alternative Hypothesis (H<sub>a</sub>):  $\mu \neq \mu_0$

where  $\mu$  is the mean of a population of our interest and  $\mu_0$  is the specific value we want to compare against.



## Assumptions of One Sample T-Test

- The sample data drawn from the population of interest are unbiased and representative.
- The data of the population are continuous.
- The data of the population are normally distributed.
- The variance of the population of our interest is unknown.
- One sample t-test is more robust than the z-test when the sample size is small (< 30).



## **Normality Test**

- To check whether the population of our interest is normally distributed, we need to run normality test.
  - Null Hypothesis (H<sub>0</sub>): The data are normally distributed.
  - Alternative Hypothesis  $(H_a)$ : The data are not normally distributed.
- There are a lot of normality tests available:
  - Anderson-Darling
  - Sharpiro-Wilk
  - Jarque-Bera etc.



#### Test Statistic and Critical Value of One Sample T-Test

Test Statistic

$$t_{calc} = \frac{Y}{\sqrt[s]{\sqrt{n}}}$$
 , where

 $\overline{Y}$  is the sample mean, *n* is the sample size, and s is the sample standard deviation

$$s = \sqrt{\frac{\sum_{i=1}^{n} (Y_i - \overline{Y})^2}{n-1}}$$

- Critical Value
  - t<sub>crit</sub> is the t-value in a Student t distribution with the predetermined significance level α and degrees of freedom (n –1).
  - t<sub>crit</sub> values for a two-sided and a one-sided hypothesis test with the same significance level α and degrees of freedom (n – 1) are different.



#### **Decision Rules of One Sample T-Test**

- Based on the sample data, we calculated the test statistic  $t_{calc}$ , which is compared against  $t_{crit}$  to make a decision of whether to reject the null.
  - Null Hypothesis (H<sub>0</sub>):  $\mu = \mu_0$
  - Alternative Hypothesis (H<sub>a</sub>):  $\mu \neq \mu_0$
- If  $|t_{calc}| > t_{crit}$ , we reject the null and claim there is a statistically significant difference between the population mean  $\mu$  and the specified value  $\mu_0$ .
- If  $|t_{calc}| < t_{crit}$ , we fail to reject the null and claim there is not any statistically significant difference between the population mean  $\mu$  and the specified value  $\mu_0$ .



- Case study: We want to compare the average height of basketball players against 7 feet.
  - Data File: "OneSampleT-Test.jmp"
  - Null Hypothesis ( $H_0$ ):  $\mu = 7$
  - Alternative Hypothesis (H<sub>a</sub>):  $\mu \neq 7$



- Step 1: Test whether the data are normally distributed
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "HtBk" in the Distribution page
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"




E Distribution - JMP		
The distribution of values in each column		
Select Columns	Cast Selected Columns into Roles —	Action
Columns	Y, Columns 🛛 🖉 HtBk	ОК
HtBk	Weight optional numeric	Cancel
Histograms Only	Freq optional numeric	
	By optional	Remove
		Recall
	·	Help



633


 $\odot$ 

- Null Hypothesis (H<sub>0</sub>): The data are normally distributed.
- Alternative Hypothesis (H<sub>a</sub>): The data are not normally distributed.
- Since the p-value of the normality is 0.3197 and greater than the alpha level (0.05), we fail to reject the null and claim that the data are normally distributed.
- If the data are not normally distributed, you need to use other hypothesis tests other than one sample t-test.

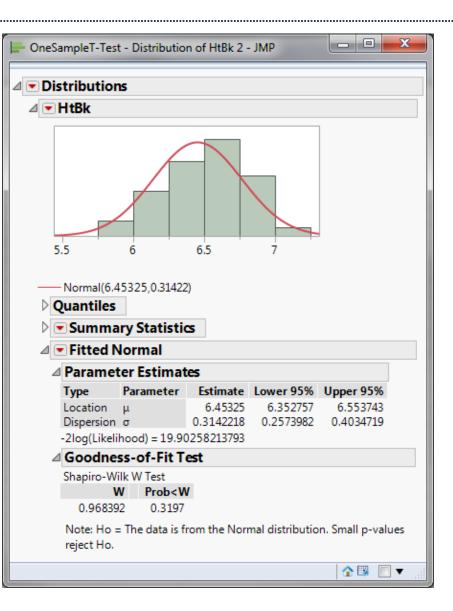




- Step 2: Run the one-sample t-test
  - 1. Click on the red triangle button next to "HtBk"
  - 2. Select "Test Mean"
  - 3. A new window named "Test Mean" pops up
  - 4. Enter the specific value we want to compare against in the box next to "Specify Hypothesized Mean"
  - 5. Click "OK"

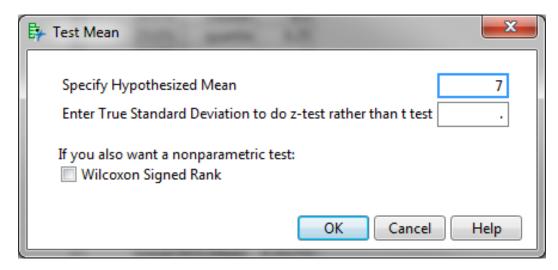



- Null Hypothesis ( $H_0$ ):  $\mu = 7$
- Alternative Hypothesis (H<sub>a</sub>):  $\mu \neq 7$
- Since the p-value is smaller than 0.0001, we reject the null hypothesis and claim that average of basketball players is different from 7 feet.

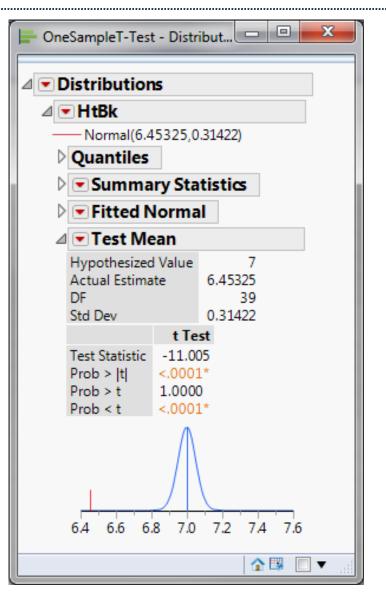



#### What is Two Sample T-Test?

- **Two sample t-test** is a hypothesis test to study whether there is a statistically significant difference between the means of two populations.
  - Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\mu_1 \neq \mu_2$

where  $\mu_1$  is the mean of one population and  $\mu_2$  is the mean of the other population of our interest.



#### Assumptions of Two Sample T-Tests

- The sample data drawn from both populations are unbiased and representative.
- The data of both populations are continuous.
- The data of both populations are normally distributed.
- The variances of both populations are unknown.
- Two sample t-test is more robust than a z-test when the sample size is small (< 30).



## Three Types of Two Sample T-Tests

- 1. Two sample t-test when the variances of two populations are unknown but equal
  - Two sample t-test (when  $\sigma_1^2 = \sigma_2^2$ )
- 2. Two sample t-test when the variances of the two population are unknown and unequal
  - Two sample t-test (when  $\sigma_1^2 \neq \sigma_2^2$ )
- 3. Paired t-test when the two populations are dependent of each other



- To check whether the variances of two populations of interest are statistically significant different, we use the test of equal variance.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma_1^2 = \sigma_2^2$
  - Alternative Hypothesis (H<sub>1</sub>):  $\sigma_1^2 \neq \sigma_2^2$
- An F-test is used to test the equality of variances between two normally distributed populations.



- An **F-test** is a statistic hypothesis test in which the test statistic follows an F-distribution when the null hypothesis is true.
- The most known F-test is the test of equal variance for two normally distributed populations.
- The F-test is very sensitive to non-normality. When any one of the two
  populations is not normal, we use the Brown-Forsythe test for checking
  the equality of variances.



Test Statistic

$$F_{calc} = \frac{{S_1}^2}{{S_2}^2}$$

where

 $s_1$  and  $s_2$  are the sample standard deviations.

- Critical Value
  - $F_{crit}$  is the F value in a F distribution with the predetermined significance level  $\alpha$  and degrees of freedom  $(n_1 1)$  and  $(n_2 1)$ .
  - F<sub>crit</sub> values for a two-sided and a one-sided F-test with the same significance level α and degrees of freedom (n<sub>1</sub> 1) and (n<sub>2</sub> 1) are different.




- Based on the sample data, we calculated the test statistic  $F_{calc}$ , which is compared against  $F_{crit}$  to make a decision of whether to reject the null.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma_1^2 = \sigma_2^2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\sigma_1^2 \neq \sigma_2^2$
- If F<sub>calc</sub> > F<sub>crit</sub>, we reject the null and claim there is a statistically significant difference between the variances of the two populations.
- If F<sub>calc</sub> < F<sub>crit</sub>, we fail to reject the null and claim there is not any statistically significant difference between the variances of the two populations.



Test Statistic & Critical Value of a Two Sample T-Test when  $\sigma_1^2 = \sigma_2^2$ 

• Test Statistic

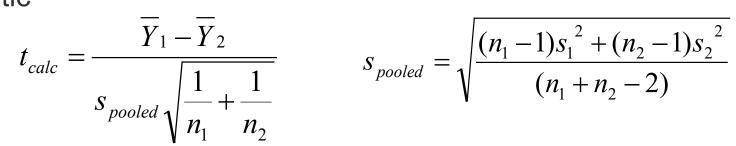

#### where

 $Y_1$  and  $\overline{Y}_2$  are the sample means of the two populations of our interest.  $n_1$  and  $n_2$  are the sample sizes.  $n_1$  is not necessarily equal to  $n_2$ .  $s_{pooled}$  is a pooled estimate of variance.  $s_1$  and  $s_2$  are the sample standard deviations.

Critical Value

 $t_{crit}$  is the *t* value in a Student t distribution with the predetermined significance level  $\alpha$  and degrees of freedom  $(n_1 + n_2 - 2)$ .


 $t_{crit}$  values for a two-sided and a one-sided t-test with the same significance level  $\alpha$  and degrees of freedom  $(n_1 + n_2 - 2)$  are different.



www.LeanSigmaCorporation.com

Test Statistic & Critical Value of a Two Sample T-Test when  $\sigma_1^2 \neq \sigma_2^2$ 

• Test Statistic

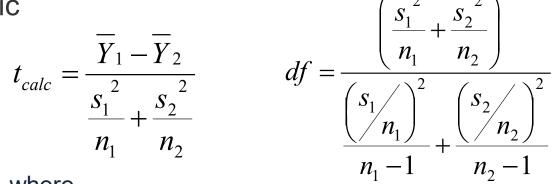

where

 $Y_1$  and  $\overline{Y}_2$  are the sample means of the two populations of our interest.

 $n_1$  and  $n_2$  are the sample sizes.  $n_1$  is not necessarily equal to  $n_2$ .

 $s_1$  and  $s_2$  are the sample standard deviations.

Critical Value

 $t_{crit}$  is the t value in a Student t distribution with the predetermined significance level  $\alpha$  and degrees of freedom *df* calculated using the formula above.

 $t_{crit}$  values for a two-sided and a one-sided t-test with the same significance level  $\alpha$  and degrees of freedom *df are different*.



645

 $\odot$ 

#### Test Statistic & Critical Value of a Paired T-Test

Test Statistic

$$t_{calc} = \frac{d}{\frac{S_d}{\sqrt{n}}}$$

where

*d* is the difference between each pair of data.

d is the average of d.

*n* is the sample size of either population of interest.

 $s_d$  is standard deviation of *d*.

Critical Value

 $t_{crit}$  is the t value in a Student t distribution with the predetermined significance level  $\alpha$  and degrees of freedom (n - 1).

 $t_{crit}$  values for a two-sided and a one-sided t-test with the same significance level  $\alpha$  and degrees of freedom (n-1) are different.



646

#### Decision Rules of a Two Sample T-Test

- Based on the sample data, we calculated the test statistic  $t_{calc}$ , which is compared against  $t_{crit}$  to make a decision of whether to reject the null.
  - Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\mu_1 \neq \mu_2$
- If  $|t_{calc}| > t_{crit}$ , we reject the null and claim there is a statistically significant difference between the means of the two populations.
- If  $|t_{calc}| < t_{crit}$ , we fail to reject the null and claim there is not any statistically significant difference between the means of the two populations.



- Case study: We are trying to compare the average retail price of a product in state A and state B.
  - Data File: "TwoSampleT-Test.jmp"



Avg. Product Price State "B"

- Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2$
- Alternative Hypothesis (H<sub>a</sub>):  $\mu_1 \neq \mu_2$



- Step 1: Test the normality of the retail price for both state A and B.
  - 1. Click Analyze -> Distribution
  - 2. Select "Retail Price" as "Y, Columns"
  - 3. Select "State" as "By"
  - 4. Click "OK"
  - 5. Click on the red triangle button next to "Retail Price" in the Distribution page for "State = State A"
  - 6. Click Continuous Fit -> Normal
  - 7. Click on the red triangle button next to "Fitted Normal"
  - 8. Select "Goodness of Fit"
  - 9. Repeat the same to test the normality for "State = State B"




E Distribution - JMP		
The distribution of values in each co	lumn	
Select Columns	Cast Selected Columns into Roles	Action
2 Columns	Y, Columns ARetail Price	ОК
the State	optional	Cancel
Retail Price	Weight optional numeric	
Histograms Only	Freq optional numeric	Remove
	By State	Recall
	optional	Help



 $\odot$ 

- Null Hypothesis (H<sub>0</sub>): The data are normally distributed.
- Alternative Hypothesis (H<sub>a</sub>): The data are not normally distributed.
- Both retail price data of state A and B are normally distributed since the p-values are both greater than alpha level (0.05).
- If any of the data series is not normally distributed, we need to use other hypothesis testing methods that will be covered later.

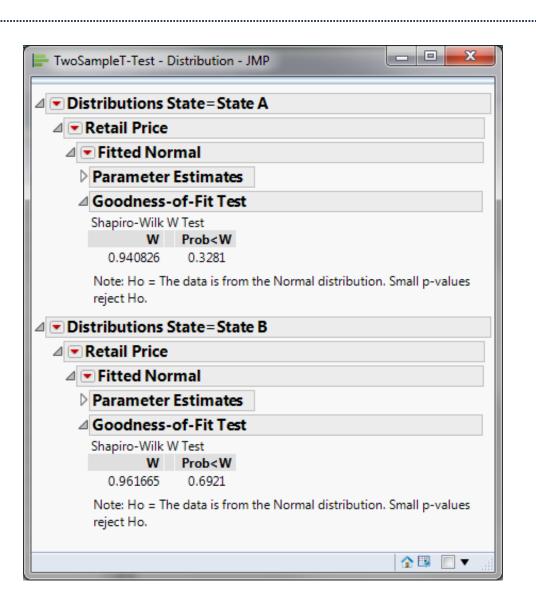




651

- Step 2: Test whether the variances of the two data sets are equal.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma_1^2 = \sigma_2^2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\sigma_1^2 \neq \sigma_2^2$ 
    - 1. Click Analyze -> Fit Y by X
    - 2. Select "Retail Price" as "Y, Response"
    - 3. Select "State" as "X, Factor"
    - 4. Click "OK"
    - Click on the red triangle button next to "Oneway Analysis of Retail Price By State"
    - 6. Select "Unequal Variances"



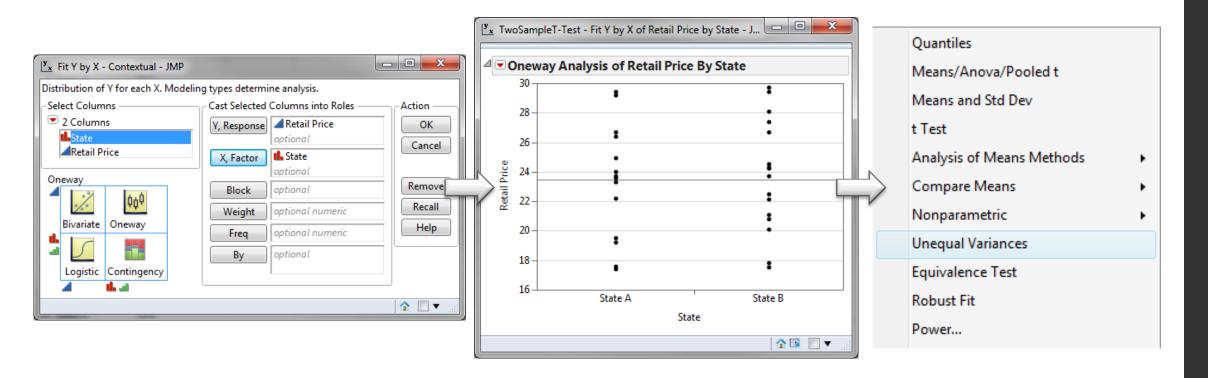




www.LeanSigmaCorporation.com

653

- Since the p-value of F test 2-sided is 0.87 greater than the alpha level (0.05), we fail to reject the null and claim that the variances of the two data sets are equal.
- We will use the two sample t-test (when  $\sigma_1 = \sigma_2$ ) to compare the means of the two groups.
- If  $\sigma_1 \neq \sigma_2$ , we will use the two sample t-test (when  $\sigma_1 \neq \sigma_2$ ) to compare the means of the two groups.

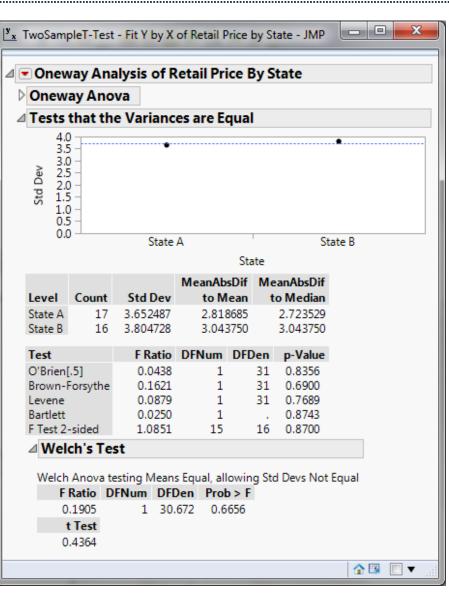




- Step 3: Run two-sample t-test to compare the means of two groups.
  - Click on the red triangle button next to "Oneway Analysis of Retail Price By State"
  - 2. Select "Means/Anova/Pooled t"



 Since the p-value of the t test is 0.6651, greater than the alpha level (0.05), we fail to reject the null hypothesis and we claim that the means of the two data sets are equal.

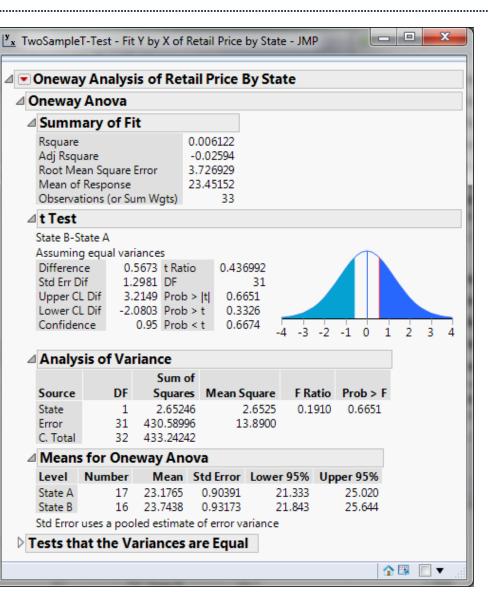



656

- If the variances of the two groups do not equal, we will need to use the two-sample t-test (when  $\sigma_1 \neq \sigma_2$ ) to compare the means of the two groups.
  - Click on the red triangle button next to "Oneway Analysis of Retail Price By State"
  - 2. Select "t test"



• Since the p-value of the t test is 0.6656, greater than the alpha level (0.05), we fail to reject the null hypothesis and we claim that the means of two groups are equal.

<sup>y</sup> x TwoSampleT-T		-					
Oneway A Oneway A	-	of Retail	Price By	State			
⊿ t Test							
State B-State A							
Assuming une	qual varian	ces			$( \land$	· · · · · · · · · · · · · · · · · · ·	
Difference	0.5673	t Ratio	0.436434				
	1.2998		30.67244				
Upper CL Dif							
Lower CL Dif	-2.0848	Prob > t	0.3328				_
Confidence	0.95	Prob < t	0.6672	-1 -2 -2	_1 0	1 2 3	7
				-4 -5 -2	-1 0	1 2 5	4
> Tests that	the Varia	ances ar	e Equal				
						û 🖓 🛛	<b>T</b>



Case study:

- We are interested to know whether the average salaries (\$1000/yr.) of male and female professors at the same university are the same.
  - Data File: "PairedT-Test.jmp"
  - The data were randomly collected from 22 universities. For each university, the salaries of a male and female professors were randomly selected.
- Null Hypothesis (H<sub>0</sub>):  $\mu_{male} \mu_{female} = 0$
- Alternative Hypothesis (H<sub>a</sub>):  $\mu_{male} \mu_{female} \neq 0$



659

- Step 2: Test whether the difference is normally distributed.
  - Null Hypothesis (H<sub>0</sub>): The difference between two data sets is normally distributed.
  - Alternative Hypothesis (H<sub>a</sub>): The difference between two data sets is not normally distributed.
    - 1. Click Analyze -> Distribution
    - 2. Select "Difference" as "Y, Columns"
    - 3. Click "OK"
    - 4. Click on the red triangle button next to "Difference" in the Distribution page
    - 5. Click Continuous Fit -> Normal
    - 6. Click on the red triangle button next to "Fitted Normal"
    - 7. Select "Goodness of Fit"



E Distribution - JMP	and the second se		⊿   Difference
The distribution of values in e	ach column		Normal(0.23182,0.84594
- Select Columns	Cast Selected Columns into Roles	Action	Fitted Normal
<ul> <li>3 Columns</li> </ul>	Y, Columns Difference	ОК	Parameter Estimat
MALES	optional		Type Parameter
FEMALES		Cancel	Location µ
Difference	Weight optional numeric		Dispersion σ -2log(Likelihood) = 54.07
		Remove	
Histograms Only	Freq optional numeric		⊿ Goodness-of-Fit Te
	By optional	Recall	Shapiro-Wilk W Test
	· · · · · · · · · · · · · · · · · · ·	Help	W Prob <w< td=""></w<>
	P		0.931769 0.1336
		💁 🔲 🔻 🖽	Note: Ho = The data is f
			reject Ho.

Pa	aireo	dT-Test - Dis	stribution of [	Difference - J	MP		x
•	Di	stributior	s				
⊿		Difference	e				
		-Normal(0.2	3182,0.84594	4)			
	⊿ (	Fitted N	lormal				
⊿ Parameter Estimates							
		Туре	Parameter	Estimate	Lower 95%	Upper 95%	
		Location Dispersion	μ σ		-0.143249 0.6508214		
		-2log(Likeli	hood) = 54.07	71547897714	41		
	4	Goodne	ss-of-Fit T	est			
		Shapiro-W					
		0.93176	V Prob <w 9 0.1336</w 	/			
		Note: Ho = reject Ho.	The data is f	rom the Nori	mal distributio	n. Small p-valu	ies
							•

- The p-value of the normality test is 0.1336, greater than the alpha level (0.05), so we fail to reject the null hypothesis and claim that the difference is normally distributed.
- If the difference is not normally distributed, we need other hypothesis testing methods.



 $\bigcirc$ 


Lean Sigma Corporation

- Step 3: Run the paired t-test to compare the means of two dependent data sets.
  - 1. Click Analyze -> Specialized Modeling -> Matched Pairs
  - 2. Select both "MALES" and "FEMALES" as "Y, Paired Response"
  - 3. Click "OK"



₩ Matched Pairs - JMP			
Comparing responses in different co	lumns		
- Select Columns	Cast Selected Colur	nns into Roles ———	Action
Columns	Y, Paired Response		ОК
MALES		FEMALES	Cancel
FEMALES Difference		optional numeric	
Difference	X, Grouping	optional	
	Weight	optional numeric	Remove
	Freq	optional numeric	Recall
	Ву	optional	Help
			☆ 🗖 🔻 🔡

- The p-value of the paired t-test is 0.2127, greater than the alpha level (0.05).
- Therefore, we fail to reject the null hypothesis and we claim that there is no statistically significant difference between the salaries of male and female professors' salaries.

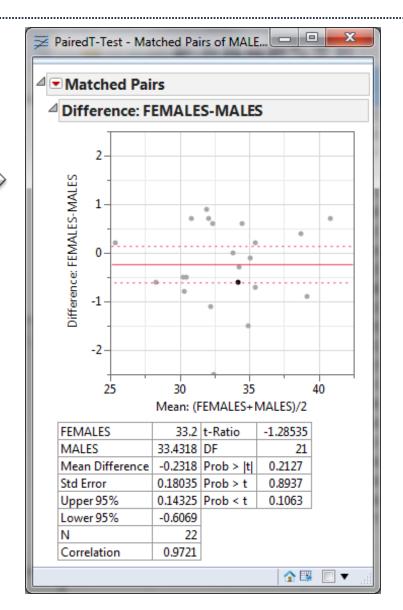

 $\bigcirc$ 

Lean Sigma Corporation



Lean Six Sigma Training - JMF

# 3.4.2 One Sample Variance



### What is One Sample Variance Test?

- One sample variance test is a hypothesis testing method to study whether there is a statistically significant difference between a population variance and a specified value.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma^2 = \sigma_0^2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\sigma^2 \neq \sigma_0^2$

where  $\sigma^2$  is the variance of a population of our interest and  $\sigma_0^2$  is the specific value we want to compare against.



### Chi-Square Test

- A chi-square test is a statistical hypothesis test in which the test statistic follows a chi-square distribution when the null hypothesis is true.
- A chi-square test can be used to test the equality between the variance of a normally distributed population and a specified value.



## **Chi-Square Test**

Test Statistic

$$\chi_{calc}^{2} = \frac{(n-1)s^{2}}{\sigma_{0}^{2}}$$

where

 $s^2$  is the observed variance and *n* is the sample size.

 $\sigma_0^{\ 2}$  is the specified value we compare against.

- Critical Value
  - $\chi_{crit}^2$  is the  $\chi^2$  value in a  $\chi^2$  distribution with the predetermined significance level  $\alpha$  and degrees of freedom (n 1).
  - $\chi_{crit}^{2}$  values for a two-sided and a one-sided  $\chi^{2}$ -test with the same significance level  $\alpha$  and degrees of freedom (n-1) are different.



### Chi-Square Test

- Based on the sample data, we calculated the test statistic  $\chi_{crit}^2$ , which is compared against  $\chi_{calc}^2$  to make a decision of whether to reject the null.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma^2 = \sigma_0^2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\sigma^2 \neq \sigma_0^2$
- If  $|\chi_{calc}^2| > \chi_{crit}^2$ , we reject the null and claim there is a statistically significant difference between the population variance and the specified value.
- If  $|\chi_{calc}^2| < \chi_{crit}^2$ , we fail to reject the null and claim there is not any statistically significant difference between the population variance and specified value.



# Use JMP to Run a One Sample Variance Test

- Case study: We are interested in comparing the variance of the height of basketball players with zero.
  - Data File: "OneSampleT-Test.jmp"
    - Null Hypothesis (H<sub>0</sub>):  $\sigma^2 = 0$
    - Alternative Hypothesis (H<sub>a</sub>):  $\sigma^2 \neq 0$



## Use JMP to Run a One Sample Variance Test


- Step 1: Test whether the data are normally distributed
  - 1. Click Analyze -> Distribution
  - 2. Select "HtBk" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "HtBk" in the Distribution page
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"



# Use JMP to Run a One Sample Variance Test

E Distribution - JMP	_		
The distribution of values in each co	olumn		
Select Columns	Cast Selected (	Columns into Roles —	Action
I Columns	Y, Columns	🚄 HtBk	ОК
<mark>∠ HtBk</mark>	Weight	optional numeric	Cancel
Histograms Only	Freq	optional numeric	
	Ву	optional	Remove
			Recall
			Help

- Null Hypothesis (H<sub>0</sub>): The data are normally distributed.
- Alternative Hypothesis (H<sub>a</sub>): The data are not normally distributed.
- Since the p-value of the normality is 0.3197, greater than alpha level (0.05), we fail to reject the null and claim that the data are normally distributed.
- If the data are not normally distributed, you need to use other hypothesis tests.

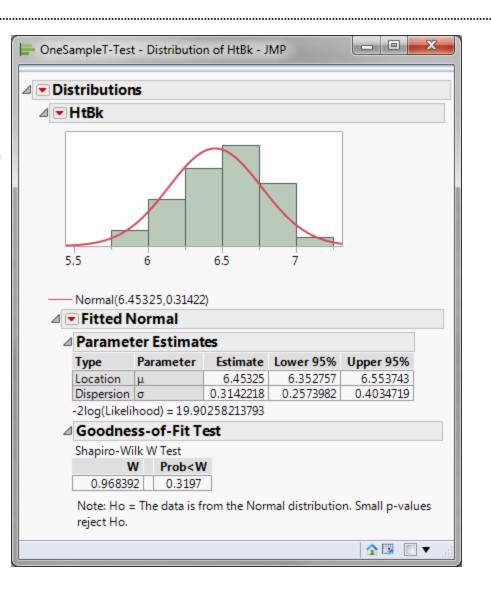


 $\bigcirc$ 

 $\odot$ 

# Use JMP to Run a One Sample Variance Test

- Step 2: Now check whether the specified value (zero) is within the 95% Confidence interval.
  - If the square root of the specified value is between the upper and lower confidence interval boundaries of the standard deviation in "Parameter Estimates" section, we fail to reject the null hypothesis and claim that the variance of the population is not statistically different from the specified value.
  - In this case, the square root of zero is outside of the confidence interval of the population standard deviation and we claim that the population variance is statistically different from zero.

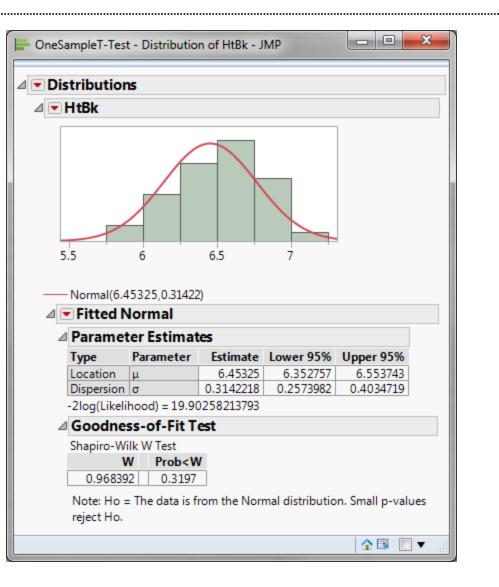



# 3.4.3 One Way ANOVA



## What is One-Way ANOVA?

- **One-way ANOVA** (one-way analysis of variance) is a statistical method to compare means of two or more populations.
  - Null Hypothesis  $(H_0)$ ; $\mu_1 = \mu_2 = ... = \mu_k$
  - Alternative Hypothesis (H<sub>a</sub>): at least one µ<sub>i</sub> is different, where *i* is any value from 1 to k.
- It is a generalized form of the two sample t-test since a two sample ttest compares two population means and one-way ANOVA compares k population means where k ≥ 2.



# Assumptions of One-Way ANOVA

- The sample data drawn from *k* populations are unbiased and representative.
- The data of *k* populations are continuous.
- The data of k populations are normally distributed.
- The variances of *k* populations are equal.



- ANOVA compares the means of different groups by analyzing the variances between and within groups.
- Let us say we are interested in comparing the means of three normally distributed populations. We randomly collected one sample for each population of our interest.
  - Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2 = \mu_3$
  - Alternative Hypothesis ( $H_a$ ): one of the  $\mu$  is different from the others.



- Based on the sample data, the means of the three populations might look different because of two variation sources.
  - 1) Variation between groups


There are non-random factors leading to the variation between groups.

2) Variation within groups

There are random errors resulting in the variation within each individual group.

- What we care about the most is the variation between groups since we are interested in whether the groups are statistically different from each other.
- Variation between groups is the *signal* we want to detect and variation within groups is the *noise* which corrupts the signal.



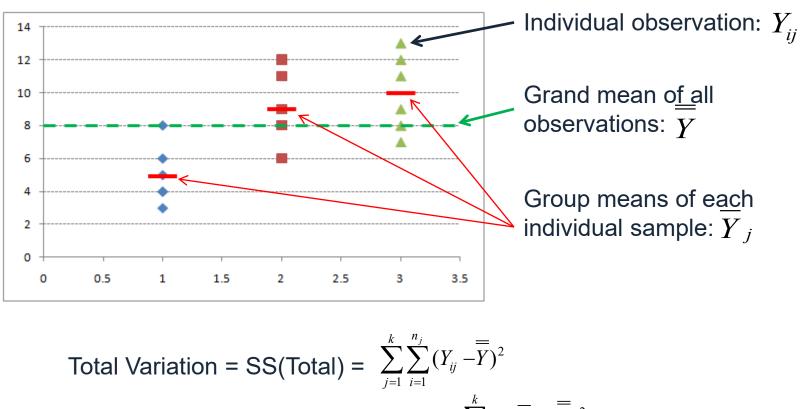

Between Variation = SS(Between) =  $\sum_{j=1}^{k} n_j (\overline{Y}_j - \overline{\overline{Y}})^2$ Within Variation = SS(Within) =  $\sum_{j=1}^{k} \sum_{i=1}^{n_j} (Y_{ij} - \overline{Y}_j)^2$ 



© Lean Sigma Corporation Lean Six Sigma Training - JMP

678

- Variation Components
  - Total Variation = Variation Between Groups + Variation Within Groups  $k = \frac{n_i}{k} = \frac{k}{k} = \frac{n_i}{k}$

$$\sum_{j=1}^{k} \sum_{i=1}^{n_j} (Y_{ij} - \overline{\overline{Y}})^2 = \sum_{j=1}^{k} n_j (\overline{\overline{Y}}_j - \overline{\overline{Y}})^2 + \sum_{j=1}^{k} \sum_{i=1}^{n_j} (Y_{ij} - \overline{\overline{Y}}_j)^2$$

- Total Variation = sums of squares of the vertical difference between the individual observation and the grand mean
- Variation Between Groups = sums of squares of the vertical difference between the group mean and the grand mean
- Variation Within Groups = sum of squares of the vertical difference between the individual observation and the group mean



- Degrees of Freedom (DF)
  - In statistics, the degrees of freedom is the number of unrestricted values in the calculation of a statistic.
- Degrees of Freedom Components
  - $DF_{total} = DF_{between} + DF_{within}$
  - DF<sub>total</sub> = n 1
  - DF<sub>between</sub>= k 1
  - $DF_{within} = n k$

where

n is the total number of observations k is the number of groups.



- Signal-to-Noise Ratio (SNR)
  - SNR denotes the ratio of a signal to the noise corrupting the signal.
  - It measures how much a signal has been corrupted by the noise.
  - When it is higher than 1, there is more signal than noise.
  - The higher the SNR, the less the signal has been corrupted by the noise.
- F-ratio is the SNR in ANOVA

$$F = \frac{MS_{between}}{MS_{within}} = \frac{\frac{SS_{between}}{DF_{between}}}{\frac{SS_{within}}{DF_{within}}} = \frac{\frac{\sum_{j=1}^{k} (\overline{Y}_{j} - \overline{Y})^{2}}{\left(k-1\right)}}{\sum_{j=1}^{k} \sum_{i=1}^{n_{j}} (Y_{ij} - \overline{Y}_{j})^{2}} \left((n-k)\right)}$$

- In ANOVA, we use the F-test to compare the means of different groups. The F-ratio calculated as above is the test statistic  $F_{calc}$ .
- The critical value  $(F_{cri})$  in an F-test can be derived from the F table with predetermined significance level ( $\alpha$ ) and with (k –1) degrees of freedom in the numerator and (n k) degrees of freedom in the denominator.



- Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2 = ... = \mu_k$
- Alternative Hypothesis (H<sub>a</sub>): at least one µ<sub>i</sub> is different, where *i* is any value from 1 to *k*.
- If  $|F_{calc}| < F_{crit}$ , we fail to reject the null and claim that the means of all the populations of our interest are the same.
- If  $|F_{calc}| > F_{crit}$ , we reject the null and claim that there is at least one mean different from the others.



## **Model Validation**

- ANOVA is a modeling procedure. To make sure the conclusions made in ANOVA are reliable, we need to perform residuals analysis.
- Good residuals:
  - Have a mean of zero
  - Are normally distributed
  - Are independent of each other
  - Have equal variance.




# Use JMP to Run an ANOVA

- Case study: We are interested in comparing the average startup costs of five kinds of business.
  - Data File: "OneWayANOVA.jmp"
    - Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2 = \mu_3 = \mu_4 = \mu_5$
    - Alternative Hypothesis (H<sub>a</sub>): at least one of the five means is different from others.



- Step 1 : Test whether the data for each level are normally distributed.
  - 1. Click Analyze -> Distribution
  - 2. Select "Cost" as "Y, Columns"
  - 3. Select "Business" as "By"
  - 4. Click "OK"
  - 5. Click on the red triangle button next to
     "Cost" in the Distribution page for "Business = X<sub>i</sub>"
  - 6. Click Continuous Fit -> Normal
  - 7. Click on the red triangle button next to "Fitted Normal"
  - 8. Select "Goodness of Fit"



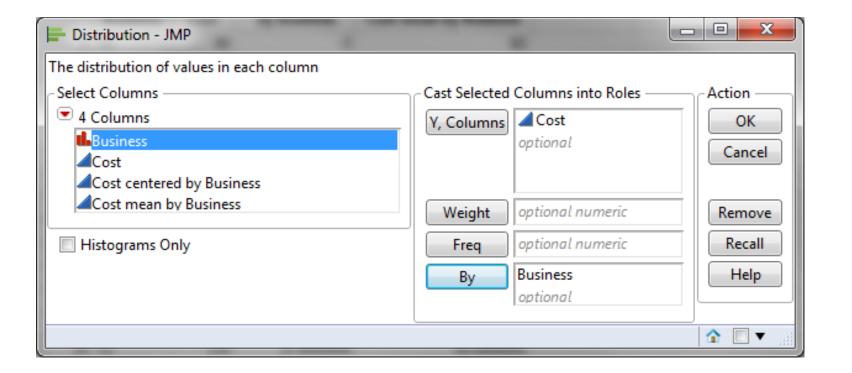



 $\odot$ 

OneWayANOVA - Distribution - JMP			
<ul> <li>Distributions Business=X1</li> <li>Cost</li> </ul>	CneWayANOVA - Distribution - JMP		
<ul> <li>✓ Fitted Normal</li> <li>✓ Parameter Estimates</li> <li>✓ Goodness-of-Fit Test</li> <li>Shapiro-Wilk W Test</li> <li>✓ Prob<w< li=""> <li>0.958930</li> <li>0.7371</li> <li>Note: Ho = The data is from the Nor reject Ho.</li> <li>✓ Distributions Business=X2</li> <li>✓ Cost</li> <li>✓ Fitted Normal</li> <li>✓ Parameter Estimates</li> <li>✓ Goodness-of-Fit Test</li> <li>Shapiro-Wilk W Test</li> <li>✓ Prob<w< li=""> <li>0.942962</li> <li>0.5559</li> <li>Note: Ho = The data is from the Nor reject Ho.</li> </w<></li></w<></li></ul>	Goodness-of-Fit Test Shapiro-Wilk W Test U 0.924026 0.3918 Note: Ho = The data is from the Norma reject Ho. Total Cost Fitted Normal	<ul> <li>OneWayANOVA - Distribution - JMP</li> <li>Distributions Business=X1</li> <li>Distributions Business=X2</li> <li>Distributions Business=X3</li> <li>Distributions Business=X4</li> <li>Distributions Business=X4</li> <li>Oistributions Business=X5</li> <li>Cost</li> <li>Fitted Normal</li> <li>Parameter Estimates</li> <li>Goodness-of-Fit Test</li> <li>Shapiro-Wilk W Test</li> <li>W Prob<w< li=""> <li>0.920839</li> <li>0.1740</li> <li>Note: Ho = The data is from the Normal distribution. Small p-values reject Ho.</li> </w<></li></ul>	



.....

www.LeanSigmaCorporation.com

© Lean Sigma Corporation

- Null Hypothesis (H<sub>0</sub>): The data are normally distributed.
- Alternative Hypothesis  $(H_a)$ : The data are not normally distributed.
- Since the p-values of normality tests for the five data sets are higher than alpha level (0.05), we fail to reject the null hypothesis and claim that the startup costs for any of the five businesses are normally distributed.
- If any of the five data sets are not normally distributed, we need to use other hypothesis testing methods other than one way ANOVA.



- Step 2: Test whether the variance of the data for each level is equal to the variance of other levels.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma_1^2 = \sigma_2^2 = \sigma_3^2 = \sigma_4^2 = \sigma_5^2$
  - Alternative Hypothesis (H<sub>a</sub>): at least one of the variances is different from others.
    - 1. Click Analyze -> Fit Y by X
    - 2. Select "Cost" as "Y, Response"
    - 3. Select "Business" as "X, Factor"
    - 4. Click "OK"
    - 5. Click on the red triangle button next to "Oneway Analysis of Cost by Business
    - 6. Click "Unequal Variances"




🗴 Fit Y by X - Contextual - JMP		
Distribution of Y for each X. Modeling types determine a	nalysis.	
Select Columns	Cast Selected Columns into Roles	Action
Business     Cost     Cost centered by Business	Y, Response Cost optional	OK Cancel
Cost mean by Business Oneway	X, Factor Business optional	Remove Recall Help
Bivariate Oneway	Block optional	
	Weight optional numeric	
Logistic Contingency	Freq optional numeric By optional	



 $\bigcirc$ 

- Since there are more than two levels in the data and the data of each level are normally distributed, we use Barlett's test for testing the variances between the five levels.
- The p-value of Barlett's test is 0.7768, greater than the alpha level (0.05), so we fail to reject the null hypothesis and claim that the variances of five groups are equal.
- If the variances are not all equal, we need to use other hypothesis testing methods other than one way ANOVA.

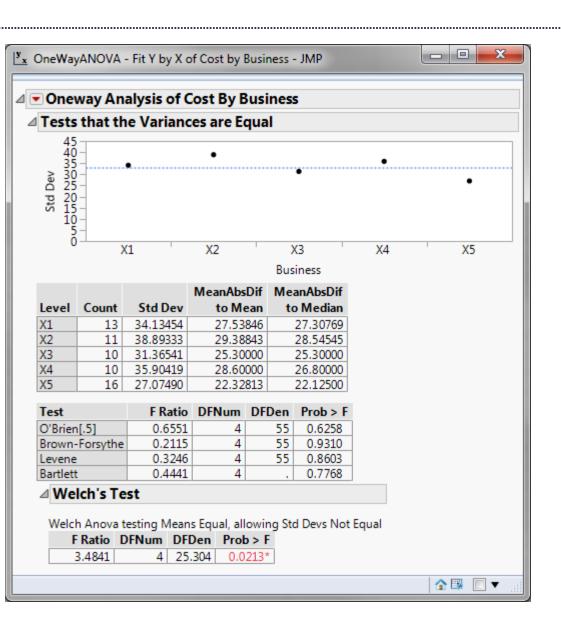



- Step 3: Test whether the mean of the data for each level is equal to the means of other levels.
  - Null Hypothesis (H<sub>0</sub>):  $\mu_1 = \mu_2 = \mu_3 = \mu_4 = \mu_5$
  - Alternative Hypothesis (H<sub>a</sub>): at lease one of the means is different from others.
  - Click on the red triangle button next to "Oneway Analysis of Cost by Business"
  - 2. Select "Means/Anova"



- Since the p-value of the F test is 0.0184, lower than the alpha level (0.05).
- The null hypothesis is rejected and we claim that the at least one of the means of the five groups is different from others.

	/ Anova							
Summ	nary of Fi	it						
Rsquare	2							
Adj Rsq			0.1	32166				
Root Me	ean Square	Error	3	3.1829				
	an of Response		75	.18333				
Observa	ations (or Su	um Wgts)		60				
Analy	sis of Va	riance						
-		Sum	of					
Source	DF	Squa	res	Mean	Square	FF	Ratio	Prob >
Busines	s 4	14298.2	224		3574.56	3.	2463	0.0184
Error	55	60560.7	759	1	1101.10			
C. Total	59	74858.9	983					
Mean	s for One	way An	ov	a				
Level	Number	Mean	St	d Error	Lower	95%	Upp	er 95%
X1	13	83.0000		9.203	64	.556		101.44
X2	11	92.0909		10.005	72	.040		112.14
X3	10	72.3000		10.493	51	.271		93.33
112	10	87.0000		10.493	65	.971		108.03
X4 X5	16	51.6250		8.296		.000		68.25





- Step 4: Save the residuals and predicted values after ANOVA. The predicted value for each level is the group mean.
  - 1. Click on the red triangle button next to "One-way Analysis of Cost by Business"
  - 2. Select Save -> Save Residuals
  - 3. Select Save -> Save Predicted



- Residuals and Predicted values are now stored in your data table
- We will use this data to validate our ANOVA conclusions by testing the residuals.

🔋 OneWayANOVA - JMI	)					x
File Edit Tables Ro	ws Cols DOE	Analyze	Graph	Tools View Wi	ndow Help	
i 🛤 🝋 💕 🖬   🐰 🖻	a 🛝 📕 i 🖶 🖩	<b>•••</b>	<u>x</u> 🏓 📝			
ConcinayAntoria	> < _ ▼			Cost centered		
Notes G:\ANALYZE2.x		Business	Cost	by Business	Cost mean by Business	-
		X1	80	-3	83	-
	2		125	42	83	_
	3		35	-48	83	_
	4		58	-25	83	_
	5		110	27	83	_
	6		140	57	83	_
	7		97	14	83	
<ul> <li>Columns (4/0)</li> </ul>	8		50	-33	83	_
Business	9	X1	65	-18	83	
🚄 Cost	10		79	-4	83	_
Cost centered by Busin		X1	35	-48	83	
Cost mean by Business	12	X1	85	2	83	
	13	X1	120	37	83	
	14	X2	150	57.9090909	92.0909091	
	15	X2	40	-52.090909	92.0909091	
	16	X2	120	27.9090909	92.0909091	
Rows	17	X2	75	-17.090909	92.0909091	
All rows 6	0 18	X2	160	67.9090909	92.0909091	
	19	X2	60	-32.090909	92.0909091	
Excluded	20	X2	45	-47.090909	92.0909091	
		X2	100	7.90909091	92.0909091	
Labelled	22	X2	86	-6.0909091	92.0909091	
	23	X2	87	-5.0909091	92.0909091	
	24	X2	90	-2.0909091	92.0909091	
	25	•		III		Þ.
evaluations done					<u>^</u>	,



www.LeanSigmaCorporation.com

- Step 5: Test whether the residuals are normally distributed with mean equal to zero.
  - 1. Click Analyze -> Distribution
  - 2. Select "Cost Centered by Business" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to"Cost Centered by Business" in the Distribution page
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"



8.276374

🏠 🖾 🔲 🔻

39.075912

 $\bigcirc$ 

Lean Sigma Corporation

Lean Six Sigma Training - JMF


697



- OneWayANOVA - Distribution of Cost centered by Busin...

# Use JMP to Run ANOVA


• The p-value of the normality test is 0.1034, greater than the alpha level (0.05) and we fail to reject the null hypothesis. As a result, the residuals are normally distributed.

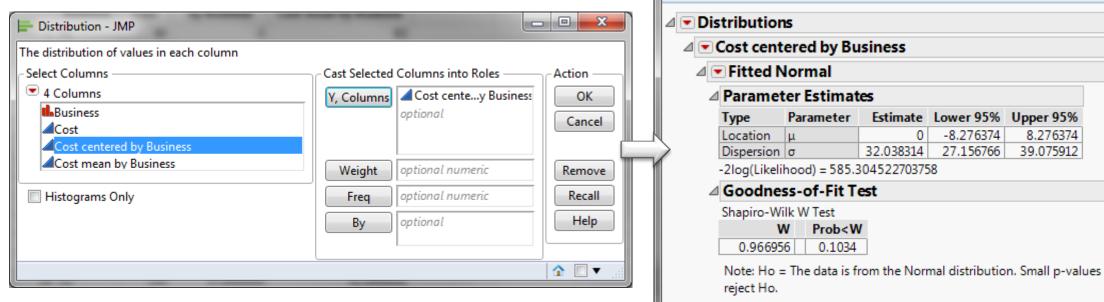



- Step 6: Check whether the residuals are independent of each other.
  1) If the data are in time order, then we can plot it in an IR chart to check the independence. When no data points on the IR chart fail any tests, the residuals are independent of each other.
  - 2) If the data are not in time order, the IR chart cannot deliver reliable conclusion on the independence.
    - 1. Click Analyze -> Quality & Process > Control Chart -> IR
    - 2. Select "Cost centered by Business" as "Process"
    - 3. Click "OK"
    - 4. Click on the red triangle button next to "Individual Measurements of Cost centered by Business"
    - 5. Select "Tests" -> "All Tests"



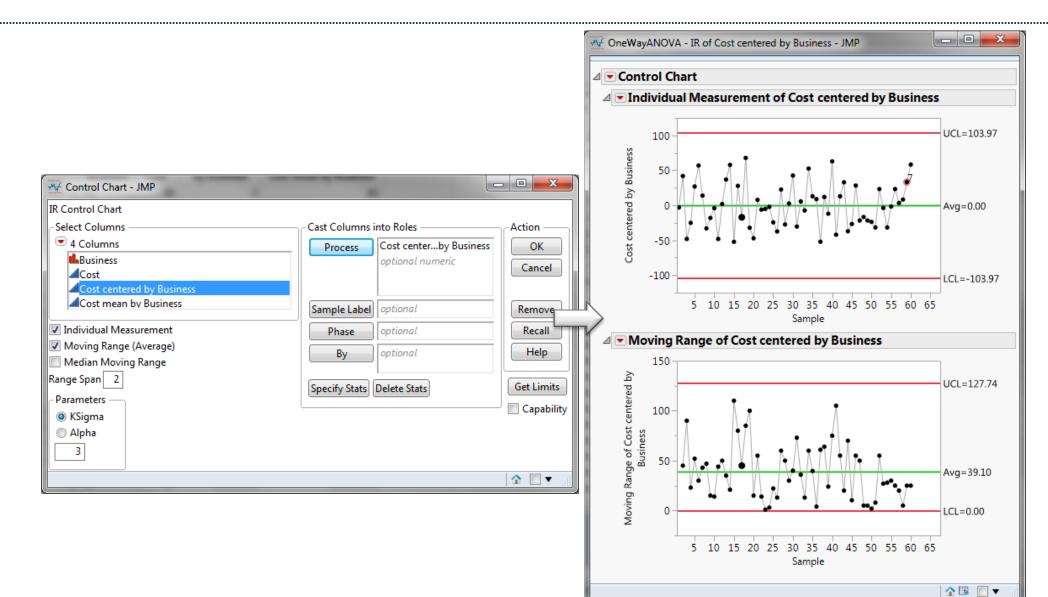



www.LeanSigmaCorporation.com

699


Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

- Step 7: Plot residuals versus fitted values and check whether there is any systematic pattern.
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Cost centered by Business" as "Y, Columns"
  - 3. Select "Cost mean by Business" as "X"
  - 4. Click "OK"



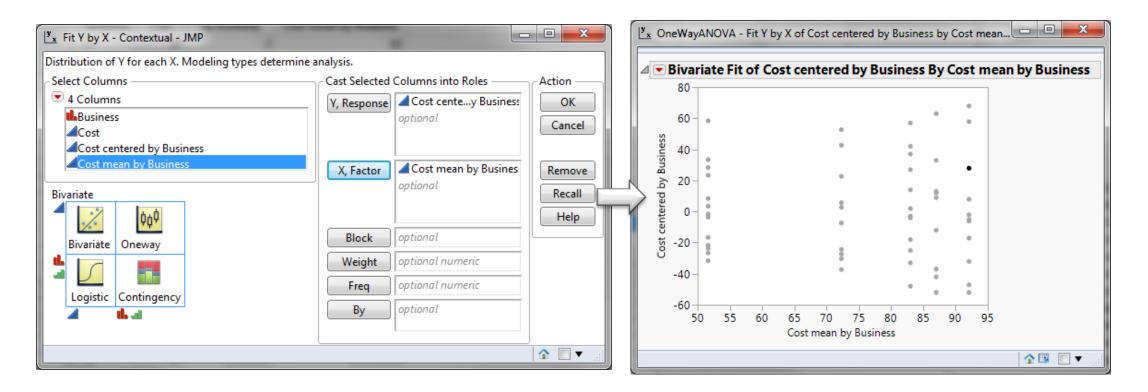

The data points are spread out evenly at any of the five levels.
 Therefore, we can claim that the residuals have equal variances across all five levels.





 $\bigcirc$ 

# 3.5 Hypothesis Testing: Non-Normal Data



### Black Belt Training: Analyze Phase

#### **3.1 Patterns of Variation**

- 3.1.1 Multi-Vari Analysis
- 3.1.2 Classes of Distributions

#### **3.2 Inferential Statistics**

3.2.1 Understanding Inference3.2.2 Sampling Techniques and Uses3.2.3 Sample Size3.2.4 Central Limit Theorem

#### 3.3 Hypothesis Testing

3.3.1 Goals of Hypothesis Testing3.3.2 Statistical Significance3.3.3 Risk; Alpha and Beta3.3.4 Types of Hypothesis Tests

3.4 Hypothesis Testing: Normal Data3.4.1 One and Two Sample T-Tests3.4.2 One sample variance3.4.3 One Way ANOVA

#### 3.5 Hypothesis Testing: Non-Normal Data

3.5.1 Mann-Whitney
3.5.2 Kruskal-Wallis
3.5.3 Moods Median
3.5.4 Friedman
3.5.5 One Sample Sign
3.5.6 One Sample Wilcoxon
3.5.7 One and Two Sample Proportion
3.5.8 Chi-Squared (Contingency Tables)
3.5.9 Test of Equal Variances



# 3.5.1 Mann-Whitney



### What is the Mann-Whitney Test?

- The **Mann-Whitney test** (also called Mann-Whitney U test or Wilcoxon rank-sum test) is a statistical hypothesis test to compare the medians of two populations that are not normally distributed.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\eta_1 \neq \eta_2$

where  $\eta_1$  is the median of one population and  $\eta_1$  is the median of the other population.



# Mann-Whitney Test Assumptions

- The sample data drawn from the populations of interest are unbiased and representative.
- The data of both populations are continuous or ordinal when the spacing between adjacent values is not constant.
- The two populations are independent to each other.
- The Mann-Whitney test is robust for the non-normally distributed population.
- The Mann-Whitney test can be used when shapes of the two populations' distributions are different.



# How Mann-Whitney Test Works

- Step 1: Group the two samples from two populations (sample 1 is from population 1 and sample 2 is from population 2) into a single data set and then sort the data in ascending order ranked from 1 to n, where n is the total number of observations.
- Step 2: Add up the ranks for all the observations from sample 1 and call it R<sub>1</sub>. Add up the ranks for all the observations from sample 2 and call it R<sub>2</sub>.



708

### How Mann-Whitney Test Works

• Step 3: Calculate the test statistics

 $U = \min(U_1, U_2)$ where  $U_1 = n_1 n_2 + \frac{n_1(n_1 + 1)}{2} - R_1$  $U_2 = n_1 n_2 + \frac{n_2(n_2 + 1)}{2} - R_2$ 

 $n_1$  and  $n_2$  are the sample sizes.

 $R_1$  and  $R_2$  are the sum of ranks for observations from sample 1 and 2 respectively.



### How Mann-Whitney Test Works

- Step 4: Make a decision on whether to reject the null hypothesis.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2$
  - Alternative Hypothesis (H<sub>a</sub>):  $\eta_1 \neq \eta_2$
- If both of the sample sizes are smaller than 10, the distribution of U under the null hypothesis is tabulated.
  - The test statistic is U and, by using the Mann-Whitney table, we would find the p-value.
  - If the p-value is smaller than alpha level (0.05), we reject the null hypothesis.
  - If the p-value is greater than alpha level (0.05), we fail to reject the null hypothesis.



### How Mann-Whitney Test Works

• If both sample sizes are greater than 10, the distribution of U can be approximated by a normal distribution. In other words,  $\frac{U-\mu}{\sigma}$  follows a standard normal distribution.

$$Z_{calc} = \frac{U - \mu}{\sigma}$$

where

$$\mu = \frac{n_1 n_2}{2} \qquad \sigma = \sqrt{\frac{n_1 n_2 (n_1 + n_2 + 1)}{12}}$$

When  $|Z_{calc}|$  is greater than Z value at  $\alpha/2$  level (e.g., when  $\alpha = 5\%$ , the z value we compare  $|Z_{calc}|$  to is 1.96), we reject the null hypothesis.



- Case study: We are interested in comparing customer satisfaction between two types of customers using a nonparametric (i.e., distribution-free) hypothesis test: Mann-Whitney test.
  - Data File: "Mann-Whitney.jmp"




- Null Hypothesis ( $H_0$ ):  $\eta_1 = \eta_2$
- Alternative Hypothesis (H<sub>a</sub>):  $\eta_1 \neq \eta_2$



- Steps to run a Mann-Whitney Test in JMP:
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Overall Satisfaction" as "Y, Response"
  - 3. Select "Customer Type" as "X, Factor"
  - 4. Click "OK"
  - Click on the red triangle button next to "Oneway Analysis of Overall Satisfaction by Customer Type"
  - 6. Click Nonparametric -> Wilcoxon Test

Note: when there are two groups, Wilcoxon Test under Nonparametric in JMP is equivalent to the Mann-Whitney.



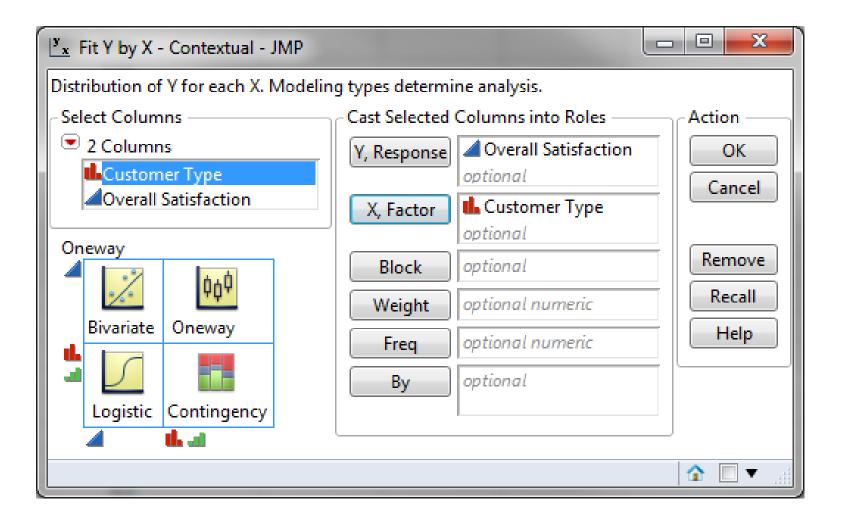




www.LeanSigmaCorporation.com

713

- Since there are two groups in comparison, we use the results shown in "2-Sample Test, Normal Approximation".
- The p-value of the test is lower than alpha level (0.05) and we reject the null hypothesis and claim that there is statistically significant difference between the overall satisfaction of the two customer types.

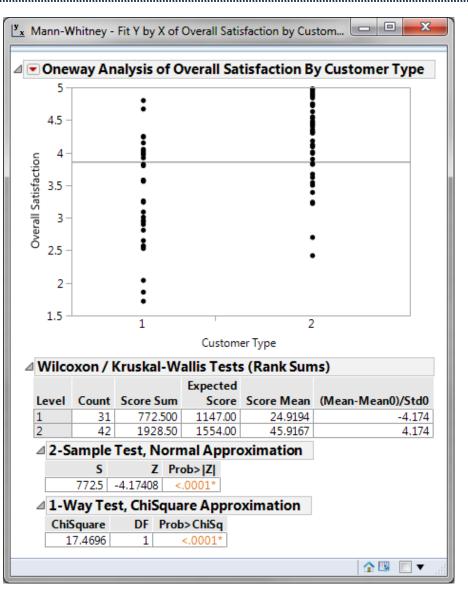



# 3.5.2 Kruskal-Wallis



### Kruskal-Wallis One-Way ANOVA

- The Kruskal-Wallis one-way analysis of variance is a statistical hypothesis test to compare the medians among more than two groups.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2 = ... = \eta_k$
  - Alternative Hypothesis (H<sub>a</sub>): at least one of the medians is different from others.
  - $\eta_i$  is the median of population i, and k is the number of groups of our interest.
- It is an extension of Mann-Whitney test.
- If the distributions of k populations are not identically shaped or there are outliers in the distribution, Mood's median test is a more robust than Kruskal-Wallis.



# Kruskal-Wallis One-Way ANOVA: Assumptions

- The sample data drawn from the populations of interest are unbiased and representative.
- The data of k populations are continuous or ordinal when the spacing between adjacent values is not constant.
- The k populations are independent to each other.
- The Kruskal-Wallis test is robust for the non-normally distributed population.



# How Kruskal-Wallis One-Way ANOVA Works

- Step 1: Group the k samples from k populations (sample i is from population i) into one single data set and then sort the data in ascending order ranked from 1 to N, where N is the total number of observations across k groups.
- Step 2: Add up the ranks for all the observations from sample i and call it r<sub>i</sub>, where i can be any integer between 1 and k.



### How Kruskal-Wallis One-Way ANOVA Works

• Step 3: Calculate the test statistic

$$T = (N-1) \frac{\sum_{i=1}^{k} n_i (\bar{r}_i - \bar{r})^2}{\sum_{i=1}^{k} \sum_{j=1}^{n_i} (r_{ij} - \bar{r})^2}$$

where

*k* is the number of groups.

 $n_i$  is the sample size of sample *i*.

*N* is the total number of all the observations across *k* groups.

 $r_{ij}$  is the rank (among all the observations) of observation *j* from group *i*.

$$\bar{r}_{i} = \frac{\sum_{j=1}^{n_{i}} r_{ij}}{n_{i}} \qquad \bar{r} = \frac{1}{2}(N+1)$$




719

# How Kruskal-Wallis One-Way ANOVA Works

- Step 4: Make a decision of whether to reject the null hypothesis.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2 = ... = \eta_k$
  - Alternative Hypothesis ( $H_a$ ): at least one of the medians is different from others.
- The test statistic follows chi-square distribution when the null hypothesis is true.
  - If T is greater than  $\chi^2_{k-1}$ , we reject the null and claim there is at least one median statistically different from other medians.
  - If T is smaller than  $\chi^2_{k-1}$ , we fail to reject the null and claim the medians of k groups are equal.



- *Case study:* We are interested in comparing customer satisfaction among three types of customers using a nonparametric (i.e., distribution-free) hypothesis test: Kruskal-Wallis one-way ANOVA.
  - Data File: "Kruskal-Wallis.jmp"

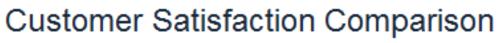




- Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2 = \eta_3$
- Alternative Hypothesis (H<sub>a</sub>): at least one of the customer types has different overall satisfaction levels from the others.



- Steps to run a Kruskal-Wallis One-Way ANOVA in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Overall Satisfaction" as "Y, Response"
  - 3. Select "Customer Type" as "X, Factor"
  - 4. Click "OK"
  - Click on the red triangle button next to "Oneway Analysis of Overall Satisfaction by Customer Type"
  - 6. Click Nonparametric -> Wilcoxon Test


Note: when there are more than two groups, Wilcoxon Test under Nonparametric in JMP displays a Kruskal-Wallis nonparametric one-way analysis of variance.



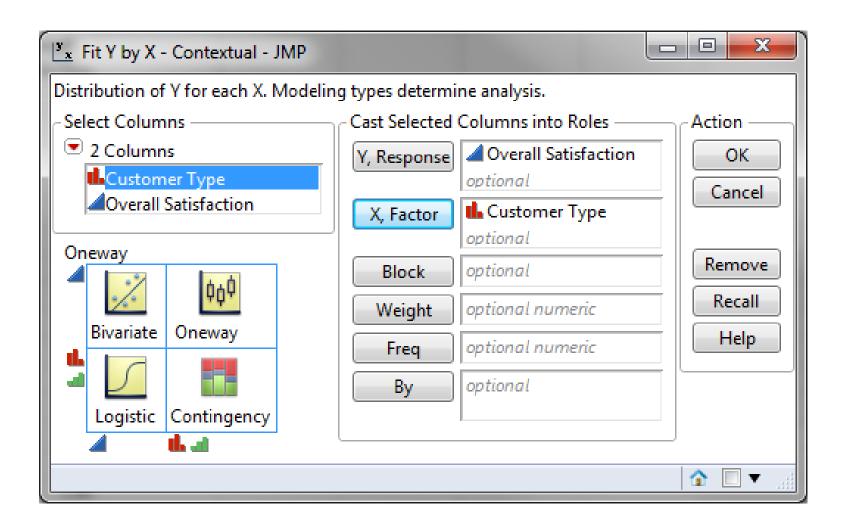



- Since there are three groups in comparison, we use the results shown in "1-Way Test, ChiSquare Approximation".
- The p-value of the test is lower than alpha level (0.05) and we reject the null hypothesis and claim that at least the overall satisfaction of one customer type is statistically different from the others.

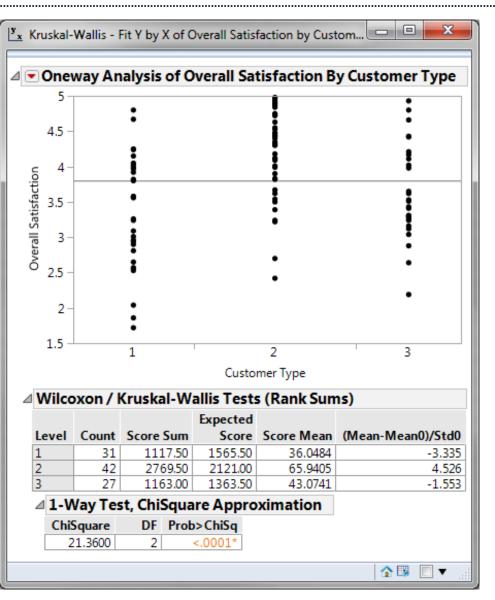



# 3.5.3 Mood's Median



#### What is Mood's Median Test?

- Mood's median test is a statistical test to compare the medians of two or more populations.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = ... = \eta_k$
  - Alternative Hypothesis (H<sub>a</sub>): at least one of the medians is different from the others.
  - k is the number of groups of our interest and is equal to or greater than two.
- Mood's median is an alternative to Kruskal-Wallis.
- It is the extension of one sample sign test.
- For the data with outliers, Mood's median test is more robust than the Kruskal-Wallis test.



### Mood's Median Test Assumptions

- The sample data drawn from the populations of interest are unbiased and representative.
- The data of k populations are continuous or ordinal when the spacing between adjacent values is not constant.
- The k populations are independent to each other.
- The distributions of k populations have the same shape.
- Mood's median test is robust for non-normally distributed populations.
- Mood's median test is robust for data with outliers.



#### How Mood's Median Test Works

- Step 1: Group the k samples from k populations (sample i is from population i) into one single data set and get the median of this combined data set.
- Step 2: Separate the data in each sample into two groups. One consists of all the observations with values higher than the grand median and the other consists of all the observations with values lower than the grand median.



#### How Mood's Median Test Works

- Step 3: Run a Pearson's chi-square test to determine whether to reject the null hypothesis.
  - Null Hypothesis (H<sub>0</sub>):  $\eta_1 = ... = \eta_k$
  - Alternative Hypothesis (H<sub>a</sub>): at least one of the medians is different from the others.
- If  $\chi^2_{calc}$  is greater than  $\chi^2_{crit}$ , we reject the null hypothesis and claim that at least one median is different from the others.
- If  $\chi^2_{calc}$  is smaller than  $\chi^2_{crit}$ , we fail to reject the null hypothesis and claim that the medians of k populations are not statistically different.



### Use JMP to Run a Mood's Median Test

- Case study: We are interested in comparing customer satisfaction among three types of customers using a nonparametric (i.e., distribution-free) hypothesis test: Mood's median test.
  - Data File: "Median Test.jmp"



- Null Hypothesis (H<sub>0</sub>):  $\eta_1 = \eta_2 = \eta_3$
- Alternative Hypothesis  $(H_a)$ : at least one customer type has different overall satisfaction from the others.




#### Use JMP to Run a Mood's Median Test

- Steps to run a Mood's median test in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Overall Satisfaction" as "Y, Response"
  - 3. Select "Customer Type" as "X, Factor"
  - 4. Click "OK"
  - Click on the red triangle button next to "Oneway Analysis of Overall Satisfaction by Customer Type"
  - 6. Click Nonparametric -> Median Test



#### Use JMP to Run a Mood's Median Test

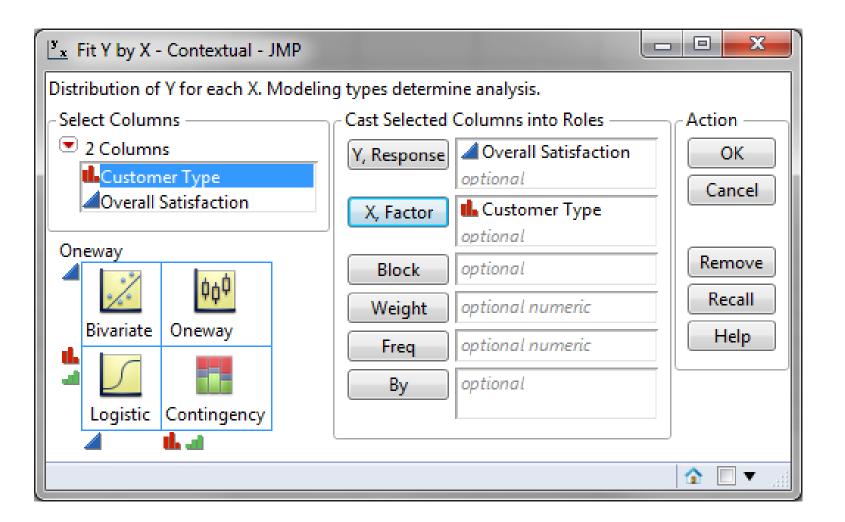




www.LeanSigmaCorporation.com

 $\odot$ 

# Use JMP to Run a Mood's Median Test


- Since there are three groups in comparison, we use the results shown in "1-Way Test, ChiSquare Approximation".
- The p-value of the test is lower than alpha level (0.05) and we reject the null hypothesis and claim that at least the overall satisfaction of one customer type is statistically different from the others.

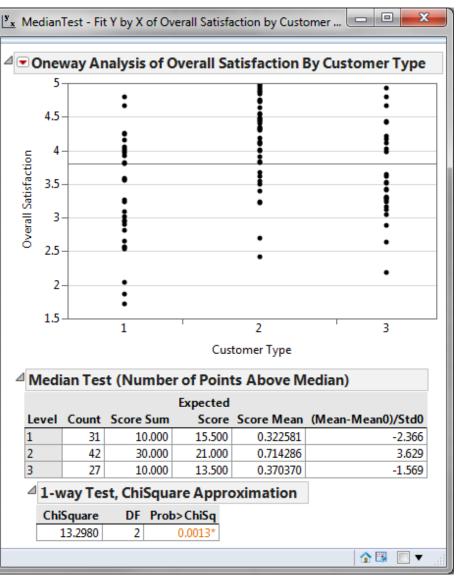



# 3.5.4 Friedman



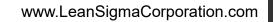

#### What is the Friedman Test?

- The **Friedman test** is a hypothesis test used to detect the differences in the medians of various groups across multiple attempts.
  - Null Hypothesis (H<sub>0</sub>): The treatments have identical effects (i.e.,  $\eta_1 = ... = \eta_k$ ).
  - Alternative Hypothesis (H<sub>a</sub>): At least one of the treatments has different effects from the others (i.e., at least one of the medians is statistically different from others).
- It is used as an alternative of the parametric repeated measures ANOVA when the assumption of normality or variance equality is not met.



#### **Friedman Test Assumptions**

- The sample data drawn from the populations of interest are unbiased and representative.
- The data are continuous or ordinal when the spacing between adjacent values is not constant.
- Results in one block are independent of the results in another.
- The Friedman test is robust for the non-normally distributed population.
- The Friedman test is robust for populations with unequal variances.




# How Friedman Test Works


- Step 1: Organize the data into a tabular view with n rows indicating the blocks and k columns indicating the treatments. Each observation x<sub>ij</sub> is filled into the intersection of a specific block i and a specific treatment j.
- Step 2: Calculate the ranks of each observation within each block.
- Step 3: Replace the values in the table created in step 1 with the order  $r_{ij}$  (within a block) of the corresponding observation  $x_{ij}$ .



• Step 4: Calculate the test statistic

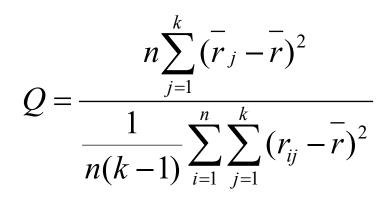



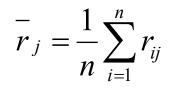

$$\overline{r} = \frac{1}{nk} \sum_{i=1}^{n} \sum_{j=1}^{k} r_{ij}$$



738

### How Friedman Test Works

- Step 5: Make a decision of whether to reject the null hypothesis.
  - When n > 15 or k > 4, the test statistic Q follows a chi-square distribution if the null hypothesis is true and the p-value is P(χ<sup>2</sup><sub>k-1</sub> ≥ Q)
  - When n < 15 and k < 4, the test statistic Q does not approximate a chisquare distribution and the p-value can be obtained from tables of Q for the Friedman test.
  - If p-value > alpha level (0.05), we fail to reject the null.



#### **Friedman Test Examples**

- A number of n water testers judge the quality of k different water samples, each of which is from a distinct water source. We will apply a Friedman Test to determine whether the water qualities of the k sources are the same.
- There are n blocks and k treatments in this experiment.
- One tester's decision would not have any influence on other testers.
- When running the experiment, each tester judges the water in a random sequence.







#### What is the One Sample Sign Test?

- The **one sample sign test** is a hypothesis test to compare the median of a population with a specified value.
  - Null Hypothesis (H<sub>0</sub>):  $\eta = \eta_0$
  - Alternative Hypothesis (H<sub>a</sub>):  $\eta \neq \eta_0$
- It is an alternative test of one sample t-test when the distribution of the data is non-normal. It is robust for the data with non-symmetric distribution.



# **One Sample Sign Test Assumptions**

- The sample data drawn from the population of interest are unbiased and representative.
- The data are continuous or ordinal when the spacing between adjacent values is not constant.
- The one sample sign test is robust for the non-normally distributed population.
- The one sample sign test does not have any assumptions on the distribution. It is a distribution-free test.



### How the One Sample Sign Test Works

- Step 1: Separate the sample set of data into two groups: one with values greater than and the other with values less than the hypothesized median  $\eta_0$ . Count the number of observations in each group.
- Step 2: Calculate the test statistic.
  - If the null hypothesis is true, the number of observations in each group should not be significantly different from half of the total sample size.
  - The test statistic follows a binomial distribution when the null is true. When n is large, we use the normal distribution to approximate the binomial distribution.



### How the One Sample Sign Test Works

#### **Test Statistic:**

$$Z_{calc} = \frac{n_+ - np}{\sqrt{np(1-p)}}$$

where

 $n_{\scriptscriptstyle +}$  is the number of observations with values greater than the hypothesized median.

n is the total number of observations .

p is 0.5.

• Step 3: Make a decision on whether to reject the null hypothesis. If the  $|Z_{calc}|$  is smaller than  $Z_{crit}$ , we fail to reject the null hypothesis and claim that there is no significant difference between the population median and the hypothesized median.



# 3.5.6 One Sample Wilcoxon



#### What is the One Sample Wilcoxon Test?

- The **one sample Wilcoxon test** is a hypothesis test to compare the median of one population with a specified value.
  - Null Hypothesis ( $H_0$ ):  $\eta = \eta_0$
  - Alternative Hypothesis (H<sub>a</sub>):  $\eta \neq \eta_0$
- It is an alternative test of one sample t-test when the distribution of the data is non-normal.
- It is more powerful than one sample sign test but it assumes the distribution of the data is symmetric.



### One Sample Wilcoxon Test Assumptions

- The sample data drawn from the population of interest are unbiased and representative.
- The data are continuous or ordinal when the spacing between adjacent values is not constant.
- The distribution of the data is symmetric about a median.
- The one sample Wilcoxon test is robust for the non-normally distributed population.



### How the One Sample Wilcoxon Test Works

- Step 1: Create the following columns one by one:
  - Column 1: all the raw observations (X)
  - Column 2: the differences between each observation value and the hypothesized median  $(X-\eta_0)$
  - Column 3: the signs (+ or –) of column 2
  - Column 4: the absolute value of column 2
  - Column 5: the ranks of each item in column 4 in ascending order
  - Column 6: the product of column 3 and column 5




#### How the One Sample Wilcoxon Test Works

- Step 2: Calculate the test statistic  $W_{calc}$ , which is the sum of all the non-negative values in column 6.
- Step 3: Make a decision on whether to reject the null hypothesis. Use the table of critical values for the Wilcoxon test to get the W<sub>crit</sub> with predetermined alpha level and number of observations.
  - If the  $W_{calc}$  is smaller than the  $W_{crit}$ , we fail to reject the null hypothesis and claim that there is no significant difference between the population median and the hypothesized median.



- Case study: We are interested in comparing the overall satisfaction of customer type 1 against a specified benchmark satisfaction (3.5) using a nonparametric (i.e., distribution-free) hypothesis test: one sample Wilcoxon test.
  - Data File: "OneSampleWilcoxon.jmp"

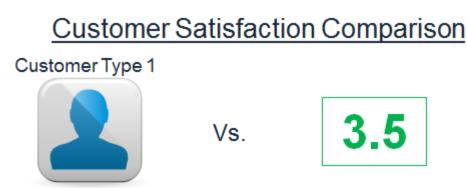

- Null Hypothesis ( $H_0$ ):  $\eta_1 = 3.5$
- Alternative Hypothesis (H<sub>a</sub>):  $\eta_1 \neq 3.5$



- Steps to run a one sample Wilcoxon test in JMP
  - 1. Click Analyze -> Distribution
  - 2. Select "Overall Satisfaction" as "Y, Columns"
  - 3. Click OK
  - 4. Click on the red triangle button next to "Overall Satisfaction"
  - 5. Click "Test Mean"
  - In the new pop-up window, enter the specified median (3.5) and check the box "Wilcoxon Signed Rank"
  - 7. Click OK




www.LeanSigmaCorporation.com

Distribution - JMP	-		- 0 X
The distribution of values in each column			
- Select Columns	Cast Selected Columns into Roles		
2 Columns	Y, Columns	Overall Satisfaction	ОК
Customer Type		optional	Cancel
	Weight	optional numeric	
Histograms Only	Freq	optional numeric	Remove
	Ву	optional	Recall
			Help
Frest Mean  Specify Hypothesized Mean  Enter True Standard Deviation to do z-test rather than t test  If you also want a nonparametric test:  Wilcoxon Signed Rank			
		OK Cancel	Help

753

 $\odot$ 

- The p-value of the one sample Wilcoxon test is 0.5587, higher than the alpha level (0.05) and we fail to reject the null.
- There is not any statistically significant difference between the overall satisfaction of customer type 1 and the benchmark satisfaction level.

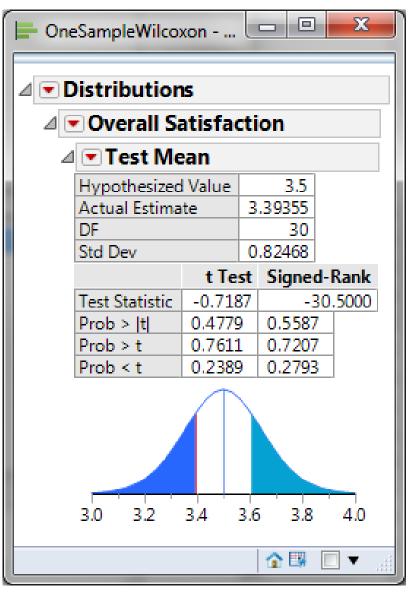



www.LeanSigmaCorporation.com

# 3.5.7 One & Two Sample Proportion



### What is the One Sample Proportion Test?

- One sample proportion test is a hypothesis test to compare the proportion of one certain outcome occurring in a population following the binomial distribution with a specified proportion.
  - Null Hypothesis  $(H_0)$ :  $p = p_0$
  - Alternative Hypothesis (H<sub>a</sub>):  $p \neq p_0$



## One Sample Proportion Test Assumptions

- The sample data drawn from the population of interest are unbiased and representative.
- There are only two possible outcomes in each trial: success/failure, yes/no, and defective/non-defective etc.
- The underlying distribution of the population is binomial distribution.
- When np ≥ 5 and np(1 p) ≥ 5, the binomial distribution can be approximated by the normal distribution.



## How the One Sample Proportion Test Works

 When np ≥ 5 and np(1 – p) ≥ 5, we use normal distribution to approximate the underlying binomial distribution of the population.

Test Statistic:

$$Z_{calc} = \frac{\hat{p} - p_0}{\sqrt{\frac{p_0(1 - p_0)}{n}}}$$

where

 $\hat{p}\,$  is the observed probability of one certain outcome occurring.


 $p_0$  is the hypothesized probability.

*n* is number of trials.

When  $|Z_{calc}|$  is smaller than  $Z_{crit}$ , we fail to reject the null hypothesis and claim that there is no statistically significant difference between the population proportion and the hypothesized proportion.



- Case study: We are interested in comparing the exam pass rate of a high school this month against a specified rate (70%) using a nonparametric (i.e., distribution-free) hypothesis test: one sample proportion test.
  - Data File: "OneSampleProportion.jmp"

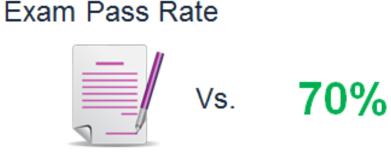

- Null Hypothesis  $(H_0)$ : p = 70%
- Alternative Hypothesis (H<sub>a</sub>):  $p \neq 70\%$



- Steps to run a one sample proportion test in JMP.
  - 1. Click Analyze -> Distribution
  - 2. Select "Result" as "Y, Columns"
  - 3. Select "Count" as "Freq"
  - 4. Click "OK"
  - 5. Click on the red triangle button next to "Result"
  - 6. Click "Test Probabilities"
  - 7. In the new pop-up window, enter the hypothesized passing rate and failing rate.
  - 8. Select the alternative hypothesis. In this case, we select "probabilities not equal to hypothesized value (two-sided chi-square test)
  - 9. Click "Done"



www.LeanSigmaCorporation.com

Distribution - JMP			
The distribution of values in each co	olumn		
Select Columns	Cast Selected	Columns into Roles —	Action
2 Columns     Result	Y, Columns	Result optional	OK Cancel
Count	Weight	optional numeric	
Histograms Only	Freq	Count	Remove
	Ву	optional	Recall
		P	Help
			🕜 🔲 ▼ 🔐

	utions						
🖉 💌 Resu	lt						
⊿ Frequ	encies		]				
Level	Count	Prob					
Fail	28 0.	26667					
Pass	77 0.	73333					
Total	105 1.	00000					
N Miss	ing 0						
2	Levels						
⊿ Test I	Probabiliti	ies					
Level	Estim Pro	b Hy	ooth Prob				
Fail	0.2666	7	0.30000				
Pass	0.7333	3	0.70000				
Click th	en Enter Hyp	othesia	zed Probab	ilities.			
Select a	n alternative	hypot	hesis for te	sting prok	abilities.		
	abilities not						
	ability great						
O proł	oability less t	han hy	pothesized	value (ex	act one-si	ded binomi	al test)




 $\odot$ 

Lean Sigma Corporation

Lean Six Sigma Training - JMP

- There are two p-values available in the results of test probabilities. Both p-values are higher than the alpha level (0.05) and we fail to reject the null hypothesis and claim that there is not any difference between the school's exam passing rate and 70%.
- Although both p-values work, we recommend to use Likelihood Ratio when the sample size is small.

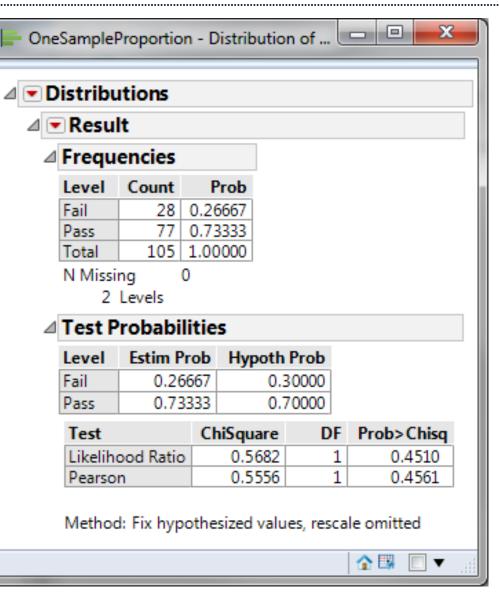



## What is the Two Sample Proportion Test?

- The **two sample proportion test** is a hypothesis test to compare the proportions of one certain event occurring in two populations following the binomial distribution.
  - Null Hypothesis ( $H_0$ ):  $p_1 = p_2$
  - Alternative Hypothesis (H<sub>a</sub>):  $p_1 \neq p_2$



## Two Sample Proportion Test Assumptions

- The sample data drawn from the populations of interest are unbiased and representative.
- There are only two possible outcomes in each trial for both populations: success/failure, yes/no, and defective/non-defective etc.
- The underlying distributions of both populations are binomial distribution.
- When np ≥ 5 and np(1 p) ≥ 5, the binomial distribution can be approximated by the normal distribution.



### How the Two Sample Proportion Test Works

 When np ≥ 5 and np(1 – p) ≥ 5, we use normal distribution to approximate the underlying binomial distributions of the populations.

Test Statistic:

$$Z = \frac{\hat{p}_1 - \hat{p}_2}{\sqrt{\hat{p}_0 \left(1 - \hat{p}_0\right) \left(\frac{1}{n_1} + \frac{1}{n_2}\right)}}$$

where  $\hat{p}_0 = \frac{x_1 + x_2}{n_1 + n_2}$ 

 $\hat{p}_1$  and  $\hat{p}_2$  are the observed proportions of events in the two samples.


 $n_1$  and  $n_2$  are the number of trials in the two samples respectively.

 $x_1$  and  $x_2$  are the number of events in the two samples respectively.

When  $|Z_{calc}|$  is smaller than  $Z_{crit}$ , we fail to reject the null hypothesis.



- Case study: We are interested in comparing the exam pass rates of a high school in March and April using a nonparametric (i.e., distribution-free) hypothesis test: two sample proportion test.
  - Data File: "TwoSampleProportion.jmp"

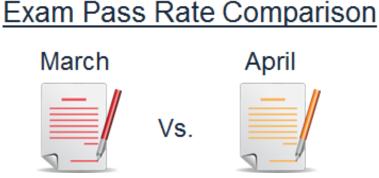


- Null Hypothesis ( $H_0$ ):  $p_{March} = p_{April}$
- Alternative Hypothesis (H<sub>a</sub>):  $p_{March} \neq p_{April}$



- Steps to run a two sample proportion test in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Results" as "Y, Responses"
  - 3. Select "Month" as "X, Factor"
  - 4. Click "OK"



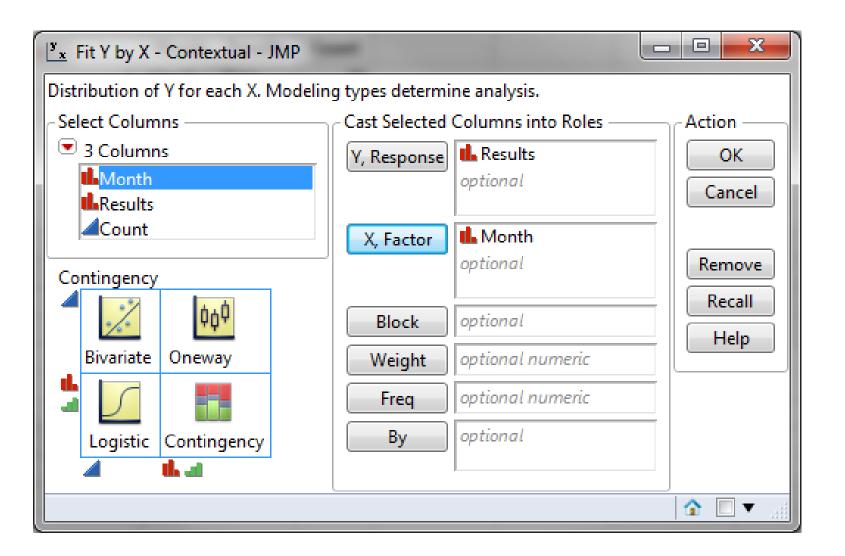



 $\bigcirc$ 

- There are two p-values available in the results of this two sample proportion test. Both p-values are higher than the alpha level (0.05) and we fail to reject the null hypothesis and claim that the exam pass rates in March and April are statistically identical.
- Although both p-values work, we recommend to use the p-value of Likelihood Ratio since it can be less affected by the small sample size.

TwoSampleProportion - Fit Y by X of Results by Month - JMP					
_	-	alysis of l	Results By N	/lonth	
Mosaic Ple	ot				
🛛 💌 Conting	jency T	able			
⊿ Tests					
N	DF	-LogLike	RSquare (U)		
4	1	0	0.0000		
Test			rob>ChiSq		
Likelihood R Pearson	atio	0.000	1.0000		
Warning: Ave	rage cell	count less t	han 5, LR ChiSq	uare suspect.	
Fisher's					
Exact Test	Prob	Alternativ	e Hypothesis		
Left	0.8333	Prob(Resu	lts=Pass) is gre	ater for Month	=March than April
Right	0.8333	Prob(Resu	lts=Pass) is gre	ater for Month	=April than March
2-Tail	1.0000	Prob(Resu	lts=Pass) is diff	erent across M	lonth
					🏠 🖾 🔲 🗸 🛛



# 3.5.8 Chi-Squared (Contingency Tables)



www.LeanSigmaCorporation.com

#### What is the Chi-Square Test?

- A chi-square test is a hypothesis test in which the sampling distribution of the test statistic follows a chi-square distribution when the null hypothesis is true.
- There are multiple chi-square tests available and in this module we will cover the Pearson's chi-square test used in contingency analysis.
  - Null Hypothesis ( $H_0$ ):  $p_1 = p_2 = ... = p_k$
  - Alternative Hypothesis (H<sub>a</sub>): at least on of the proportions is different from others.
  - k is the number of populations of our interest.  $k \ge 2$ .



#### What is the Chi-Square Test?

- The chi-square test can also be used to test whether two factors are independent of each other. In other words, it can be used to test whether there is any statistically significant relationship between two discrete factors.
  - Null Hypothesis (H<sub>0</sub>): Factor 1 is independent of factor 2.
  - Alternative Hypothesis ( $H_a$ ): Factor 1 is not independent of factor 2.



#### **Chi-Square Test Assumptions**

- The sample data drawn from the populations of interest are unbiased and representative.
- There are only two possible outcomes in each trial for an individual population: success/failure, yes/no, and defective/non-defective etc.
- The underlying distribution of each population is binomial distribution.
- When np ≥ 5 and np(1 p) ≥ 5, the binomial distribution can be approximated by the normal distribution.



#### How Chi-Square Test Works

Test Statistic

$$\chi_{calc}^{2} = \sum_{i=1}^{n} \frac{(O_{i} - E_{i})^{2}}{E_{i}}$$

 $O_i$  is an observed frequency.

 $E_i$  is an expected frequency.

*N* is the number of cells in the contingency table.

If  $\chi^2_{calc}$  is smaller than  $\chi^2_{crit}$ , we fail to reject the null hypothesis.



- Case study 1: We are interested in comparing the product quality exam pass rates of three suppliers A, B, and C using a nonparametric (i.e., distribution-free) hypothesis test: chi-square test.
  - Data File: "Chi Square Test1.jmp"
- Null Hypothesis (H<sub>0</sub>):  $p_A = p_B = p_C$
- Alternative Hypothesis (H<sub>a</sub>): at least one of the suppliers has different pass rates from the others.




- Steps to run a chi-square test in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Results" as "Y, Columns"
  - 3. Select "Supplier" as "X, Factor"
  - 4. Select "Count" as "Freq"
  - 5. Click "OK"



$\frac{y}{x}$ Fit Y by X - Contextual - JMP	-						
Distribution of Y for each X. Modeling types determine analysis.							
- Select Columns	- Cast Selected Columns into Role	esAction					
3 Columns	Y, Response 🖪 Results	ОК					
Supplier	optional	Cancel					
Results							
Count	X, Factor						
Contingency	optional	Remove					
¢¢¢	Block	Recall Help					
Bivariate Oneway	Weight optional numeric						
	Freq Count						
Logistic Contingency	By optional						
🔺 🔥 🖬							




- The Mosaic plot is a graphical tool to divide the frequency data into smaller segments each of which is represented by a rectangle with the area proportional to the frequency of a specific outcome.
- The Y axis displays the classification of response. In our example, Y has two possible values: pass or fail.
- The X axis displays the different levels of a factor "Supplier".
  - E.g. The lower left red rectangle represents the frequency or probability of supplier A failing the product quality exam.

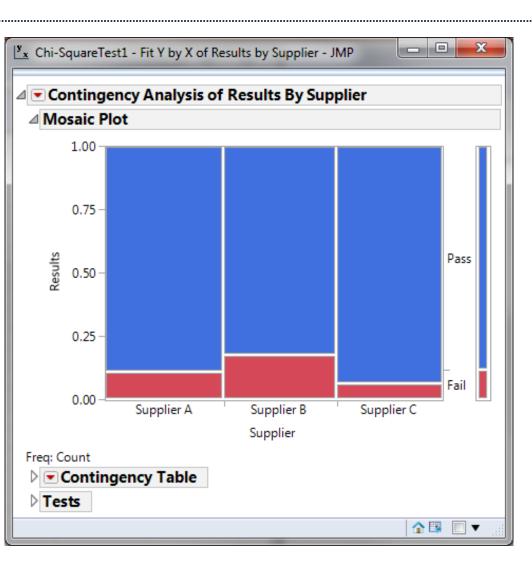



- The contingency table displays the two-way frequency distribution and is used to analyze the relationship between two or more discrete factors.
- Each level of the discrete factor has a row and each level of the discrete response has a column.
- The last row and column display the column totals and row totals respectively. The right bottom cell is the grand total.
- There are four values in each cell which is not on the border:
  - Count: cell frequency
  - Total %: percentage of cell frequency to the grand total count
  - Col %: percentage of cell frequency to its column total count
  - Row %: percentage of cell frequency to its row total count.

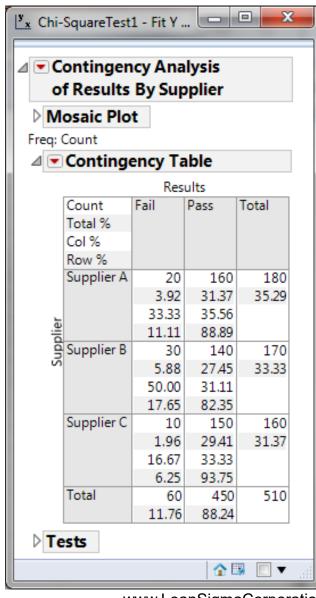

**Optional Step:** 

• To see more statistics in the contingency table, click on the red triangle button next to "Contingency Table" and select the statistics of interest.

- C	ontinae	ency Ta	able	_		
✓	Count					
✓	Total %					
✓	Col %					
✓	Row %					
	Expected	Expected				
	Deviatio	n		5.29		
	Cell Chi	Square				
	Col Cun	ı		170 3.33		
	Col Cun	Col Cum %				
	Row Cu	m				
	Row Cu	m %		160		
-		16.67	33.33	1.37		
		6.25	93.75			
		60	450	510		
		11.76	88.24			

1		Co	ontina	ency T	able		
1		1	Count				
		7	Total %				
	V	7	Col %				
	V	7	Row %				
	V	1	Expecte	d		180	
			Deviatio	on		5.29	
			Cell Chi Square				
			Col Cur	n			
			Col Cur	n %		170	
			Row Cu	m		3.33	
			Row Cu	m %			
	-	-		20	150	_	
		Su	ipplier C	10	150	160	
				1.96	29.41	31.37	
				16.67	33.33		
			6.25 93.7				
				18.8235	141.176		
				60	450	510	
				11.76	88.24		

						-		
•	C	ontinae	ency Ta	able				
•	1	Count						
•	1	Total %	Total %					
•	1	Col %			- 1			
•	1	Row %			- 1			
•	1	Expecte	d		- 1			
•	1	Deviatio	on		1	180		
		Cell Chi	Square		5	.29		
		Col Cur	n					
		Col Cur	n %					
		Row Cu	m		H			
		Row Cu	m %		- 6	170 .33		
			50.00	31.11				
			17.65	82.35				
			20	150				
			10	-10				
	S	upplier C	10	150		160		
			1.96		31	.37		
			16.67					
			6.25 93.75					
			18.8235					
			-8.8235					
			60	450	-	510		
			11.76	88.24				



www.LeanSigmaCorporation.com

- After performing the optional step, three more measurements appear in the cells of contingency table:
- Expected (E): expected cell frequency under the assumption that the null hypothesis is true. It is the product of the corresponding row and column total, divided by the grand total.
- Deviation: the difference between the observed cell frequency(O) and the expected cell frequency (E).

 Cell Chi Square: chi-square value for one cell. It is computed as (O-E)2/E.



	SquareTest		-			
	ontingen f Results	-	-			
⊳ M	osaic Plo	t				
Freq: (						
⊿ 💌	Conting	ency Ta	able			
			ults			
	Count Total % Col %	Fail	Pass	Total		
	Row % Expected					
	Deviation Cell Chi^2					
	Supplier A	20 3.92		180 35.29		
		33.33 11.11	35.56 88.89			
ier		21.1765 -1.1765 0.0654	158.824 1.17647 0.0087			
Suppl	Supplier B	30 5.88	140 27.45	170 33.33		
		50.00 17.65	31.11 82.35	00.00		
		20 10	150 -10			
		5.0000				
	Supplier C	10 1.96 16.67	150 29.41 33.33	160 31.37		
		6.25 18.8235	93.75			
		-8.8235 4.1360				
	Total	60 11.76	450 88.24	510		
⊳ Te	ests					
				☆ 🛤		ļ
	V	vww.L	.eanS	igma(	Corpora	tion.co

'81

- There are multiple tests available to test the significance of the difference among the proportions displayed in both the Mosaic plot and contingency table. For example, Pearson's chi-square test, Fisher's exact test, Barnard's test etc.
- We recommend using the p-value of the Likelihood Ratio when the sample size is small.
- Since both p-values are smaller than alpha level (0.05), we reject the null and claim that at least one supplier has different pass rate from others.

🗴 Chi-SquareTest1 - Fit Y by X of 💶 💷 💌							
Contingency	-						
of Results By	y Supplier						
Mosaic Plot							
Freq: Count							
👌 💌 Contingen	cy Table						
⊿ Tests							
NC	)F -LogL	ike	RSquare (U)				
510	2 5.3110	678	0.0288				
Test	Test ChiSquare Prob>ChiSq						
Likelihood Ratio	10.622	2	0.0049*				
Pearson	10.428	3	0.0054*				



- Case study 2: We are trying to check whether there is a relationship between the suppliers and the results of the product quality exam using nonparametric (i.e., distribution-free) hypothesis test: chi-square test.
  - Data File: "Chi Square Test2.jmp"
- Null Hypothesis (H<sub>0</sub>): product quality exam results are independent of the suppliers.
- Alternative Hypothesis (H<sub>a</sub>): product quality exam results depend on the suppliers.



- Steps to run a chi-square test in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Results" as "Y, Columns"
  - 3. Select "Supplier" as "X, Factor"
  - 4. Select "Count" as "Freq"
  - 5. Click "OK"





$\frac{y}{x}$ Fit Y by X - Contextual - JMP	🗽 Fit Y by X - Contextual - JMP						
Distribution of Y for each X. Modeling types determine analysis.							
- Select Columns	Cast Selected Columns into F	Roles Action					
<ul> <li>3 Columns</li> <li>Supplier</li> <li>Results</li> </ul>	Y, Response	OK Cancel					
Count	X, Factor Supplier optional	Remove					
Bivariate Oneway	Block optional Weight optional nume	Recall Help					
	Freq Count						
Logistic Contingency	By						



www.LeanSigmaCorporation.com

- The p-values of both Likelihood Ratio and Pearson are smaller than the alpha level (0.05) and we reject the null hypothesis.
- The product quality exam results are not independent of the suppliers.

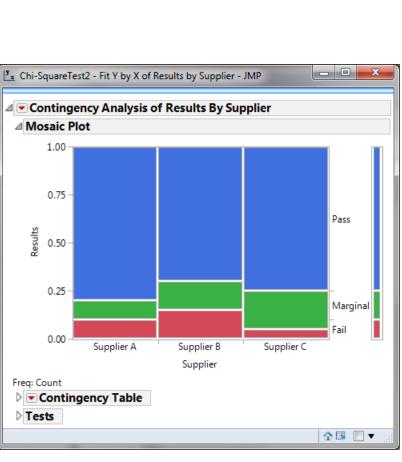

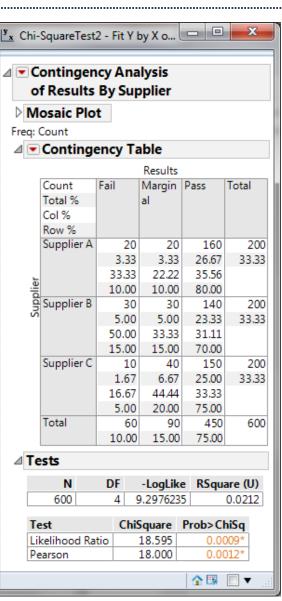



www.LeanSigmaCorporation.com

# 3.5.9 Tests of Equal Variance



#### What are Tests of Equal Variance?

- **Tests of equal variance** are a family of hypothesis tests used to check whether there is a statistically significant difference between the variances of two or more populations.
  - Null Hypothesis (H<sub>0</sub>):  $\sigma_1^2 = \sigma_2^2 = ... = \sigma_k^2$
  - Alternative Hypothesis (H<sub>a</sub>): at least the variance of one population is different from others.
  - k is the number of populations of interest.  $k \ge 2$ .
- A tests of equal variance can be used alone but most of the time it is used with other statistical methods to verify or support the assumption about the variance equality.





- The F-test is used to compare the variances between two normally distributed populations.
- It is extremely sensitive to non-normality and serves as a preliminary step for two sample t-test.
- Test Statistic:

 $F_{calc} = \frac{{S_1}^2}{{S_2}^2}$ , where s<sub>1</sub> and s<sub>2</sub> are the sample standard deviations.

The sampling distribution of the test statistic follows F distribution when the null is true.



790

#### **Bartlett's Test**

- **Bartlett's test** is used to compare the variances among two or more normally distributed populations.
- It is sensitive to non-normality and it serves as a preliminary step for ANOVA.
- Test Statistic:  $\chi^{2} = \frac{(N-k)\ln(S_{p}^{2}) - \sum_{i=1}^{k} (n_{i}-1)\ln(S_{i}^{2})}{1 + \frac{1}{3(k-1)} \left(\sum_{i=1}^{k} \left(\frac{1}{n_{i}-1}\right) - \frac{1}{N-k}\right)} \quad \text{, where } N = \sum_{i=1}^{k} n_{i} \text{ and } S_{p}^{2} = \frac{1}{N-k} \sum_{i} (n_{i}-1)S_{i}^{2}$

The sampling distribution of test statistic follows chi<sup>2</sup> distribution when the null is true.



#### Brown-Forsythe Test

- The **Brown-Forsythe test** is used to compare the variances between two or more populations with any distributions.
- It is not so sensitive to non-normality as Bartlett's test.
- The Test statistic is the model F statistic from the ANOVA on the transformed response  $z_{ij} = |y_{ij} \tilde{y}_i|$  where  $\tilde{y}_i$  is the median response at i<sup>th</sup> level.



#### Levene's Test

- Levene's test is used to compare the variances between two or more populations with any distributions.
- It is not so sensitive to non-normality as Bartlett's test.
- The test statistic is the model F statistic from the ANOVA on the transformed response  $z_{ij} = |y_{ij} \overline{y}_i|$  where  $\overline{y}_i$  is the mean response at i<sup>th</sup> level.



#### Brown-Forsythe Test vs. Levene's Test

$$F = \frac{(N-k)}{(k-1)} \frac{\sum_{i=1}^{k} N_i (Z_{i.} - Z_{..})^2}{\sum_{i=1}^{k} \sum_{j=1}^{N_i} (Z_{ij} - Z_{i.})^2}$$

#### where

Nis the total number of observations.

*k* is the number of groups.

 $N_i$  is the number of observations in the i<sup>th</sup> group.

 $Z_{i}$  is the group mean of the ith group.

 $Z_{...}$  is the grand mean of all the observations.

In Brown-Forsythe Test,  $Z_{ij} = |Y_{ij} - \widetilde{Y}_{ij}|$ , where  $\widetilde{Y}_{ij}$  is the group median of the i<sup>th</sup> group. In Levene's Test,  $Z_{ij} = |Y_{ij} - \overline{Y}_{ij}|$ , where  $\overline{Y}_{ij}$  is the group mean of the i<sup>th</sup> group.



793

- Case study: We are interested in comparing the variances of the retail price of a product in state A and state B.
  - Data File: "TwoSampleT-Test.jmp"
- Null Hypothesis (H<sub>0</sub>):  $\sigma_A^2 = \sigma_B^2$
- Alternative Hypothesis (H<sub>a</sub>):  $\sigma_A^2 \neq \sigma_B^2$



- Steps to run tests of equal variance in JMP
  - 1. Click Analyze -> Fit Y by X
  - 2. Select "Retail Price" as "Y, Response"
  - 3. Select "State" as "X, Factor"
  - 4. Click "OK"
  - Click on the red triangle button next to "Oneway Analysis of Retail Price By State"
  - 6. Select "Unequal Variances"




<sup>y</sup> <sub>x</sub> Fit Y by X - Contextual - JMP			
Distribution of Y for each X. Modelin	g types determi	ine analysis.	
- Select Columns	Cast Selected	Columns into Roles —	Action
2 Columns	Y, Response	ARetail Price	ОК
State		optional	Cancel
Retail Price	X, Factor	🖺 State	
Oneway		optional	
	Block	optional	Remove
¢¢¢	Weight	optional numeric	Recall
Bivariate Oneway	Freq	optional numeric	Help
	Ву	optional	
Logistic Contingency		I	
			🏠 🔲 🔻 🖽




 $\odot$ 

- JMP provides five tests of equal variance: O'Brien, Brown-Forsythe, Levene, Bartlett and F test.
- Depending on the number of groups and the normality of groups, we might consider different tests to check the variance equality.
- The p-value of each test is listed in the last column in the red box. When pvalue is greater than the alpha level (0.05), we fail to reject the null hypothesis and claim that the variances of different groups are identical.

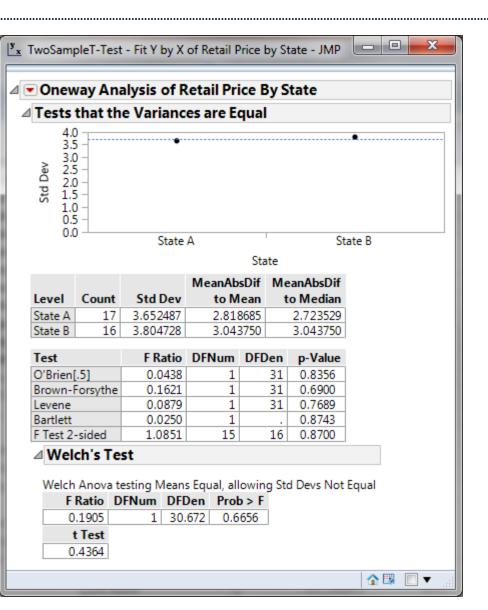



### Hypothesis Testing Roadmap: Putting it all together

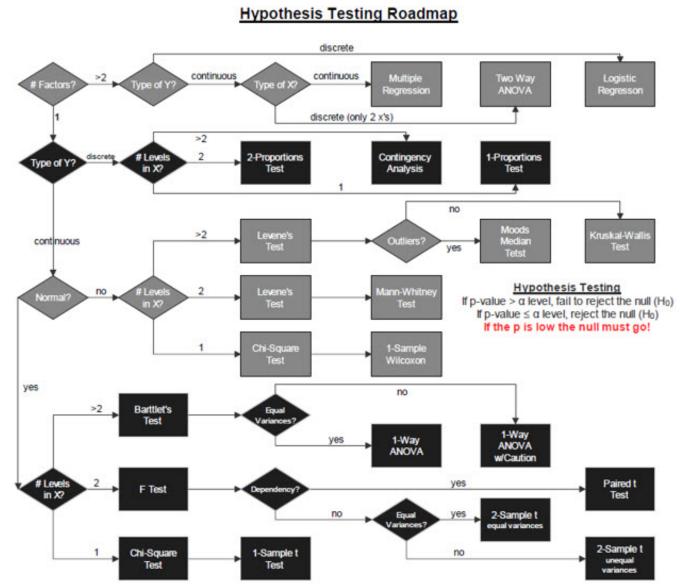

vww.LeanSigmaCorporation.com

798

Lean Six Sigma Training - JMP

 $\bigcirc$ 

Lean Sigma Corporation

# 4.0 Improve Phase



## Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

#### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

#### **4.3 Designed Experiments** 4.3.1 Experiment Objectives

4.3.2 Experimental Methods4.3.3 DOE Design Considerations

#### **4.4 Full Factorial Experiments**

4.4.1 2k Full Factorial Designs4.4.2 Linear and Quadratic Models4.4.3 Balanced and Orthogonal Designs4.4.4 Fit, Model, and Center Points

#### **4.5 Fractional Factorial Experiments**

4.5.1 Designs4.5.2 Confounding Effects4.5.3 Experimental Resolution



# 4.1 Simple Linear Regression



## Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

#### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

- 4.3 Designed Experiments4.3.1 Experiment Objectives4.3.2 Experimental Methods4.3.3 DOE Design Considerations
- 4.4 Full Factorial Experiments
  4.4.1 2k Full Factorial Designs
  4.4.2 Linear and Quadratic Models
  4.4.3 Balanced and Orthogonal Designs
  4.4.4 Fit, Model, and Center Points
- 4.5 Fractional Factorial Experiments
  - 4.5.1 Designs4.5.2 Confounding Effects4.5.3 Experimental Resolution



# 4.1.1 Correlation



#### What is Correlation?

- **Correlation** is a statistical technique that describes whether and how strongly two or more variables are related.
- **Correlation analysis** helps to understand the direction and degree of association between variables, and it suggests whether one variable can be used to predict another.
- Of the different metrics to measure correlation, Pearson's correlation coefficient is the most popular. It measures the linear relationship between two variables.



#### Pearson's Correlation Coefficient

- Pearson's correlation coefficient is also called:
  - Pearson's r or coefficient of correlation
  - Pearson's product moment correlation coefficient (r)
- "r" is a statistic measuring the linear relationship between two variables.
- Correlation coefficients range from -1 to 1.
  - If r = 0, there is no linear relationship between the variables.
  - The sign of r indicates the direction of the relationship:
    - If r < 0, there is a negative linear correlation.
    - If r > 0, there is a positive linear correlation.
  - The *absolute value* of r describes the *strength* of the relationship:
    - If  $|\mathbf{r}| \leq 0.5$ , there is a weak linear correlation.
    - If |r| > 0.5, there is a strong linear correlation.
    - If |r| = 1, there is a perfect linear correlation.



### Pearson's Correlation Coefficient

- When the correlation is *strong*, the data points on a scatter plot will be close together (tight).
  - The closer "r" is to -1 or 1, the stronger the relationship.
    - -1 Strong inverse relationship
    - +1 Strong direct relationship
- When the correlation is *weak*, the data points are spread apart more (loose).
  - The closer the correlation is to 0 the weaker the relationship.





www.LeanSigmaCorporation.com

#### Pearson's Correlation Coefficient

- Pearson's correlation coefficient is only sensitive to the *linear* dependence between two variables.
- It is possible that two variables have a perfect non-linear relationship when the correlation coefficient is low.
- Notice the scatter plots below with correlation equal to 0. There are clearly *relationships* but they are not linear and therefore can not be determined with Pearson's correlation coefficient.





#### **Correlation and Causation**

- Correlation does not imply causation.
- If variable A is highly correlated with variable B, it does not necessarily mean A causes B or vice versa. It is possible that an unknown third variable C is causing both A and B to change.
- For example, if ice cream sales at the beach are highly correlated with the number of shark attacks, it does not imply that increased ice cream sales causes increased shark attacks. They are triggered by a third factor: summer.



#### **Correlation and Dependence**

- If two variables are independent, the correlation coefficient is zero.
- WARNING! If the correlation coefficient of two variables is zero, it does not imply they are independent.
- The correlation coefficient only indicates the linear dependence between two variables. When variables are non-linearly related, they are not independent of each other but their correlation coefficient could be zero.



# Correlation Coefficient and X-Y Diagram

- The correlation coefficient indicates the direction and strength of the linear dependence between two variables but it does not cover all the existing relationship patterns.
- With the same correlation coefficient, two variables might have completely different dependence patterns.
- A scatter plot or X-Y diagram can help to discover and understand additional characteristics of the relationship between variables.
- Correlation coefficient is not a replacement for examining the scatter plot to study the variables' relationship.



### Statistical Significance of the Correlation Coefficient

- The correlation coefficient could be high or low by chance (randomness). It may have been calculated based on two small samples that do not provide good inference on the correlation between two populations.
- In order to test whether there is a statistically significant relationship between two variables, we need to run a hypothesis test to determine whether the correlation coefficient is statistically different from zero.
  - Hypothesis Test Statements
    - $H_0$ : r = 0: Null Hypothesis: There is *no* correlation.
    - $H_1$ :  $r \neq 0$ : Alternate Hypothesis: There is a correlation.



#### Statistical Significance of the Correlation Coefficient

- Hypothesis tests will produce p-values as a result of the statistical significance test on r.
  - When the p-value for a test is low (less than 0.05), we can reject the null hypothesis and conclude that "r" is significant; there is a correlation.
  - When the p-value for a test is > 0.05, then we fail to reject the null hypothesis; there is no correlation.

• We can also use the t statistic to draw the same conclusions regarding our test for significance of the correlation coefficient.



### Statistical Significance of the Correlation Coefficient

- Test Statistic:  $t = \frac{r}{\sqrt{\frac{1-r^2}{n-2}}}$ 
  - Critical Statistic: t-value in t-table with (n 2) degrees of freedom
  - If |t| ≤ t<sub>critical</sub>, we fail to reject the null. There is no statistically significant linear relationship between X and Y.
  - If |t| > t<sub>critical</sub>, we reject the null. There is a statistically significant linear relationship between X and Y.



### Using Software to Calculate the Correlation Coefficient

- We are interested in understanding whether there is linear dependence between a car's MPG and its weight and if so, how they are related.
- Data File: "Correlation Coefficient.jmp"
- We will discuss two ways to get the results.
  - Using Microsoft Excel
  - Using JMP



## Use Excel to Calculate the Correlation Coefficient

- The formula CORREL in Excel calculates the sample correlation coefficient of two data series.
- The correlation coefficient between the two data series is -0.83, which indicates a strong negative linear relationship between MPG and weight.

0	, 🛃	9 - (2 - )	÷							Воо
<u> </u>	Hor	ne Insert	Page L	ayout.	Formulas	Data	Review	View		
No	rmal Pag Layor		Views	Full Screen	<ul> <li>Ruler</li> <li>Gridlines</li> <li>Message</li> <li>Si</li> </ul>	√ н	ormula Bar eadings	9 Zoom	100% Zoom	Zoom to Selection
	SUM	1	• (• X •	/ fx	=CORREL(\$A	2:\$A399 <b>,</b> I				
	А	В	С			D	0	ORREL(a	array1, a	rray2)
1	MPG	weight		=CORR	EL(\$A2:\$A399	,B2:B399	Э)			
2	18	3504								
3	15	3693								
4	18	3436								
5	16	3433								
6	17	3449								
7	15	4341								
8	14	4354								
0	14	4212								



### Use JMP to Calculate the Correlation Coefficient

- Step 1: Analyze  $\rightarrow$  Multivariate Methods  $\rightarrow$  Multivariate.
- Step 2: Select the two variables of interest and click "OK."


Multivariate and Correlations - J	MP		- • ×
Pairwise and higher relationships am	ong a number	of columns	
- Select Columns	Cast Selected	Columns into Roles —	Action
2 Columns	Y, Columns	<b>⊿</b> MGP	ОК
MGP		<b>Weight</b>	Cancel
Weight	Weight	optional numeric	
Estimation Method Default 👻	Freq	optional numeric	Remove
	Ву	optional	Recall
			Help
			1 ■ 1



817

# Use JMP to Calculate the Correlation Coefficient

- JMP presents results in two ways: correlation matrix and scatterplot matrix.
- The correlation matrix quantitatively captures the linear relationship between variables.
- The scatter plot qualitatively depicts the characteristics of the association between variables.

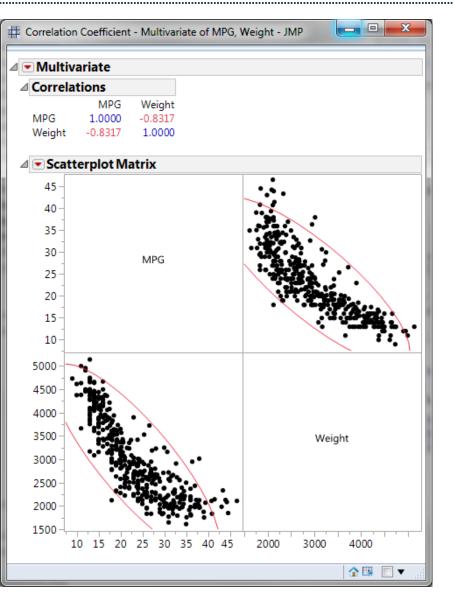



### **Interpreting Results**

- How do we interpret results and make decisions based Pearson's correlation coefficient (r) and p-values?
  - Let us look at a few examples:
    - r = -0.832, p = 0.000 (previous example). The two variables are inversely related and the linear relationship is strong. Also, this conclusion is significant as supported by p-value of 0.00.
    - **r = -0.832**, **p = 0.71**. Based on r, you should conclude the linear relationship between the two variables is strong and inversely related. However, with a p-value of 0.71, you should then conclude that r is not significant and that your sample size may be too small to accurately characterize the relationship.
    - r = 0.5, p = 0.00. Moderately positive linear relationship, r is statistically significant.
    - **r = 0.92, p = 0.61**. Strong positive linear relationship but r is not statistically significant. Get more data.
    - r = 1.0, p = 0.00. The two variables have a perfect linear relationship and r is significant.



#### **Correlation Coefficient Calculation**

Population Correlation Coefficient (ρ)

$$\rho_{X,Y} = \frac{\operatorname{cov}(X,Y)}{\sigma_X \sigma_Y} = \frac{E[(X - \mu_X)(Y - \mu_Y)]}{\sigma_X \sigma_Y}$$

• Sample Correlation Coefficient (r)

$$r = \frac{\sum_{i=1}^{n} (X_i - \bar{X})(Y_i - \bar{Y})}{\sqrt{\sum_{i=1}^{n} (X_i - \bar{X})^2} \sqrt{\sum_{i=1}^{n} (Y_i - \bar{Y})^2}}$$

- It is only defined when the standard deviations of both X and Y are non-zero and finite.
- When covariance of X and Y is zero, the correlation coefficient is zero.








www.LeanSigmaCorporation.com

- An X-Y diagram is a scatter plot depicting the relationship between two variables (i.e., X and Y).
- Each point on the X-Y diagram represents a pair of X and Y values, with X plotted on the horizontal axis and Y plotted on the vertical axis.
- With an X-Y diagram, you can qualitatively assess both the strength and direction of the relationship between X and Y.
- To quantitatively measure the relationship between X and Y, you may need to calculate the correlation coefficient.



### **Example 1: Perfect Linear Correlation**

- In the chart below, there are 10 data points depicted (10 pairs of X and Y values), and they were created using the equation Y = 2X.
- As a result, all the data points fall onto the straight line of Y = 2X.
- The chart demonstrates a perfect positive linear correlation between X and Y since the relationship between X and Y can be perfectly described by a linear equation in a format of Y = a × X + b where a ≠ 0.

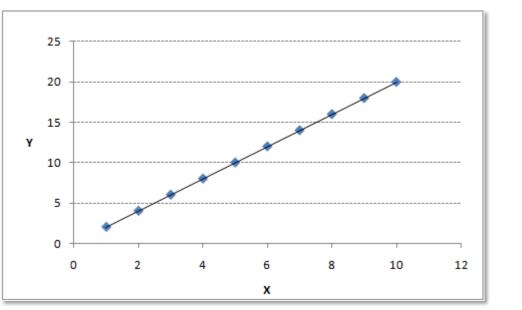

Х	Y
1	2
2	4
3	6
4	8
5	10
6	12
7	14
8	16
9	18
10	20



#### **Example 2: Strong Linear Correlation**

- In this chart, the data points scatter closely around a straight line.
- When X increases, Y increases accordingly.
- This chart demonstrates a strong positive linear correlation between X and Y.

Υ

2

5

6

7

10

13


15

16

19

22


• The straight line is the trend line showing how Y's trend goes with changes in X.

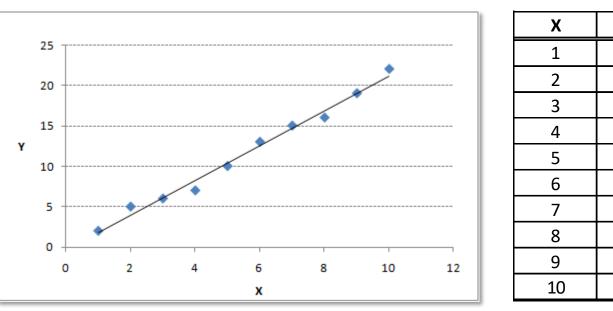



#### **Example 3: Weak Linear Correlation**


- In this chart, the data points scatter remotely around a straight line.
- When X increases, Y increases accordingly.
- This chart demonstrates a weak positive linear correlation between X and Y since the distance between the data points and the trend line is relatively far on average.

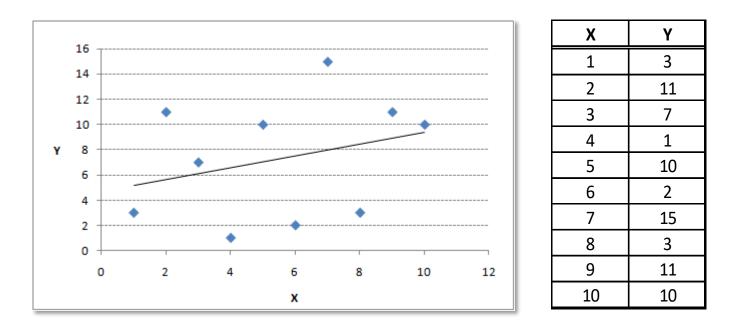



#### Example 4: Non-Linear Correlation

• The X-Y diagram also helps to identify any nonlinear relationship between X and Y.

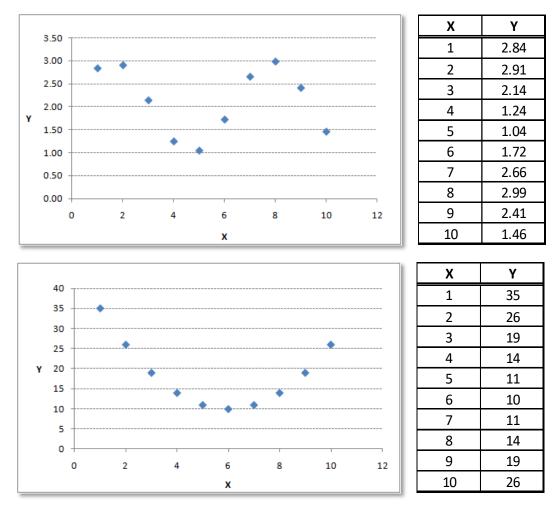




www.LeanSigmaCorporation.com

825

#### **Example 5: Uncorrelated**


- In this chart, the Y value of each data point is a constant regardless of what the X value is.
- Changes in X do not show any relative impact on Y. As a result, there is no correlation between X and Y.

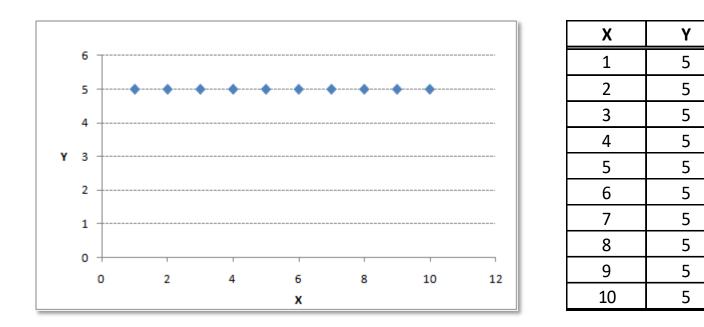



#### **Example 6: Outlier Identification**

- Using X-Y diagram, you may identify outliers in the data.
- In this chart, the last data point does not seem to follow the trend of other data points.
- This should require further investigation on the last data point to determine whether it is an outlier.

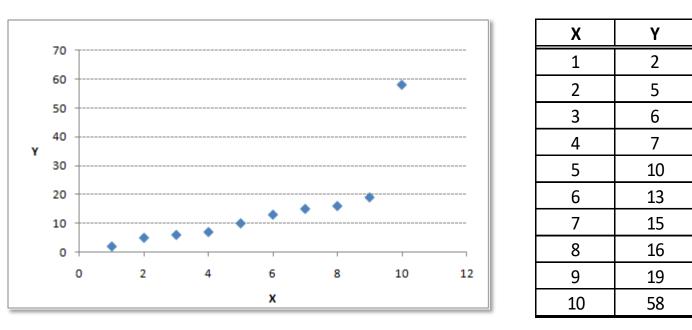



## Benefits of Using an X-Y Diagram

- An X-Y diagram graphically demonstrates the relationship between two variables.
- It suggests whether two variables are associated and helps to identify the linear or nonlinear correlation between X and Y.
- It captures the strength and direction of the relationship between X and Y.
- It helps identify any outliers in the data.



#### Limitations of the X-Y Diagram

- Although the X-Y diagram helps to "spot" interesting features in the data, it does not provide any quantitative conclusions about the data and further statistical analysis is needed to:
  - Assess whether the association between variables is statistically significant.
  - Measure the strength of the relationship between variables.
  - Determine whether outliers exist in the data.
  - Quantitatively describe the pattern of the data.



829

# 4.1.3 Regression Equations



#### **Correlation and Regression Analysis**

- The correlation coefficient answers the following questions:
  - Are two variables correlated?
  - How strong is the relationship between two variables?
  - When one variable increases, does the other variable increase or decrease?
- The correlation coefficient *cannot* address the following questions:
  - How much does one variable changes when the other variable changes by one unit?
  - How can we set the value of one variable to obtain a targeted value of the other variable?
  - How can we use the relationship between two variables to make predictions?
- The simple linear regression analysis helps to answer these questions.



#### What is Simple Linear Regression?

- **Simple linear regression** is a statistical technique to fit a straight line through the data points.
- It models the quantitative relationship between two variables.
- It describes how one variable changes according to the change of another variable.
- Both variables need to be continuous.
- It is simple because only one predictor variable is involved.



#### Simple Linear Regression Equation

• The simple linear regression analysis fits the data to a regression equation in the form

$$Y = \alpha \times X + \beta + e$$

where:

- Y is the dependent variable (the response) and X is the single independent variable (the predictor).
- *α* is the slope describing the steepness of the fitting line. β is the intercept indicating the Y value when X is equal to 0.
- e stands for error (residual). It is the difference between the actual Y and the fitted Y (i.e., the vertical difference between the data point and the fitting line).



#### **Ordinary Least Squares**

- The **ordinary least square** is a statistical method used in linear regression analysis to find the best fitting line for the data points.
- It estimates the unknown parameters of the regression equation by minimizing the sum of squared residuals (i.e. the vertical difference between the data point and the fitting line).
- In mathematical language, we look for  $\alpha$  and  $\beta$  that satisfy the following criteria:

$$\min_{\alpha,\beta} Q(\alpha,\beta) \text{ where } Q(\alpha,\beta) = \sum_{i=1}^{n} e_i^2 = \sum_{i=1}^{n} (y_i - \alpha - \beta x_i)^2$$



#### **Ordinary Least Squares**

• The actual value of the dependent variable:

 $Y_i = \alpha * X_i + \beta + e_i$  where i = 1, 2,..., n

• The fitted value of the dependant variable:

$$\hat{Y}_{i} = \alpha * X_{i} + \beta$$
 where *i* = 1, 2,..., n


 By using calculus, it can be shown the sum of squared error is minimal when

$$\beta = \frac{\sum_{i=1}^{n} (X_i - \bar{X})(Y_i - \bar{Y})}{\sum_{i=1}^{n} (X_i - \bar{X})^2} \qquad \alpha = \bar{Y} - \beta \bar{X}$$



835

#### **ANOVA in Simple Linear Regression**

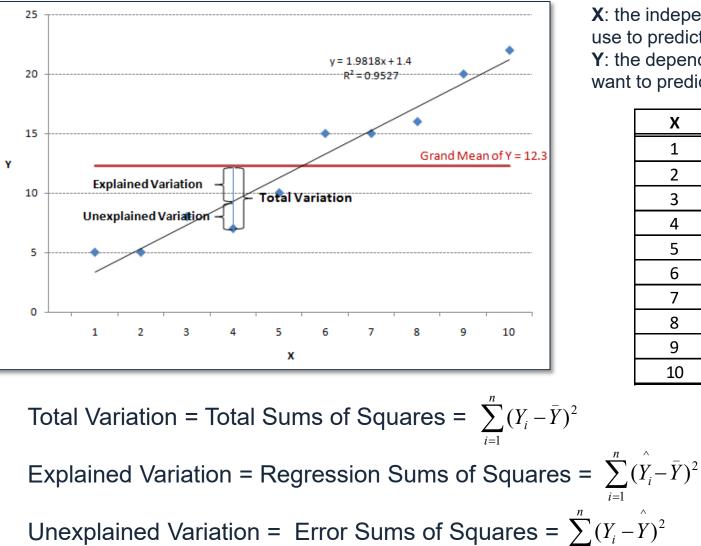

X: the independent variable that we use to predict;Y: the dependent variable that we

**Y**: the dependent variable that we want to predict.

X	Y
1	5
2	5
3	8
4	7
5	10
6	15
7	15
8	16
9	20
10	22

#### **ANOVA in Simple Linear Regression**

- Linear regression is also analysis of variance (ANOVA).
  - Variation Components:
    - Total Variation = Explained Variation + Unexplained Variation

i.e., Total Sums of Squares = Regression Sums of Squares + Error Sums of Squares

- Degrees of Freedom Components
  - Total Degrees of Freedom = Regression Degrees of Freedom + Residual Degrees of Freedom

i.e., n - 1 = (k - 1) + (n - k), where n is the number of data points, k is the number of predictors



#### ANOVA in Simple Linear Regression

- Whether the overall model is statistically significant can be tested by using Ftest of ANOVA.
  - H<sub>0</sub>: The model is not statistically significant.
  - H<sub>a</sub>: The model is statistically significant.

• Test Statistic: 
$$F = \frac{MSR}{MSE} = \frac{\sum_{i=1}^{n} (\hat{Y}_i - \bar{Y})^2}{\sum_{i=1}^{n} (\hat{Y}_i - \hat{Y}_i)^2} / (n-k)$$

- Critical Statistic: F value in F table with (k 1) degrees of freedom in the numerator and (n – k) degrees of freedom in the denominator.
- If F ≤ F<sub>critical</sub>, we fail to reject the null. There is no statistically significant relationship between X and Y.
- If F > F<sub>critical</sub>, we reject the null. There is a statistically significant relationship between X and Y.



#### **Coefficient of Determination**

- R<sup>2</sup> (also called coefficient of determination) measures the proportion of variability in the data that can be explained by the model.
- R<sup>2</sup> ranges from 0 to 1. The higher R<sup>2</sup> is, the better the model can fit the actual data.
- How to calculate R<sup>2:</sup>

$$R^{2} = \frac{SS_{regression}}{SS_{total}} = 1 - \frac{SS_{error}}{SS_{total}} = 1 - \frac{\sum_{i=1}^{n} (Y_{i} - Y)^{2}}{\sum_{i=1}^{n} (Y_{i} - \overline{Y})^{2}}$$

n

 $\wedge$ 



- Case study:
  - We want to see whether the score on exam one has any statistically significant relationship with the score on the final exam. If yes, how much impact does exam one have on the final exam?
  - Data File: "Simple Linear Regression.jmp"
- Step 1: Determine the dependent and independent variables. Both should be continuous variables.
  - Y (dependent variable) is the score of final exam.
  - X (independent variable) is the score of exam one.
  - Both variables are continuous.




- Step 2: Create a scatter plot to eyeball whether there seems to be a linear relationship between X and Y.
  - 1. Click Analyze -> Fit Y by X
  - 2. Select FINAL as "Y, Response" and EXAM1 as "X, Factor"

Click "OK"	<sup>y</sup> x Fit Y by X - Contextual - JMP		
	Distribution of Y for each X. Modeli	ng types determine analysis.	
	- Select Columns	Cast Selected Columns into Roles	Action
	Columns	Y, Response FINAL	ОК
	EXAM1	optional	Cancel
	FINAL	X, Factor AEXAM1	
	Bivariate	optional	
	φ <sub>φ</sub> φ	Block optional	Remove
	• <u>/</u> -	Weight optional numeric	Recall
	Bivariate Oneway	Freq Optional numeric	Help
		By optional	
	Logistic Contingency		



3.

- Based on the scatter plot, the relationship between exam one and final seems linear.
- The higher the score on exam one, the higher the score on the final.

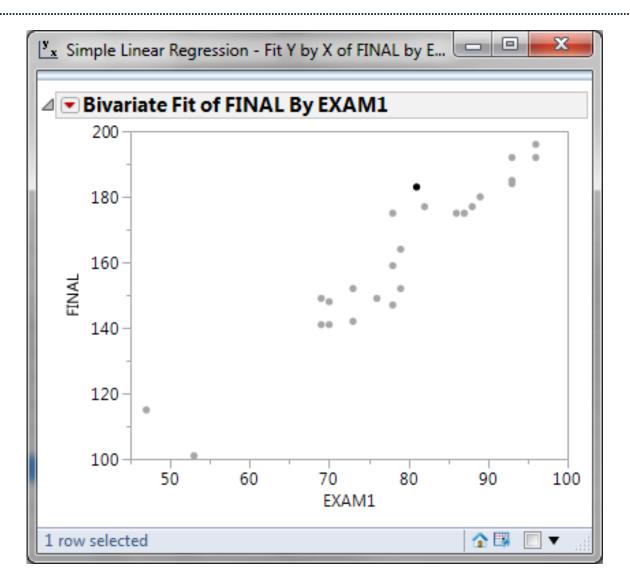



842

 $\odot$ 

Lean Sigma Corporation

- Step 3: Run the Simple Linear Regression analysis.
  - 1. Click Analyze -> Fit Model
  - 2. Select FINAL as Y and add EXAM1 to "Construct Model Effects"
  - 3. Click "Run"

Fit Model - JMP			
Model Specification			
Select Columns 2 Columns EXAM1 FINAL	Pick Role Variables	Personality: Emphasis:	Standard Least Squares
	Weight     optional numeric       Freq     optional numeric       By     optional	Help Recall Remove	Run Keep dialog open
	Construct Model Effects Add EXAM1 Cross Nest Macros Degree 2 Attributes Transform No Intercept	· 	




- Step 4: Check whether the model is statistically significant. If not significant, we will need to re-examine the predictor or look for new predictors before continuing.
- The Summary of Fit section provides R2 which measures the percentage of variation in the data set which can be explained by the model.
- 89.5% of the variability in the data can be accounted for by this linear regression model.
- Analysis of Variance section provides a ANOVA table covering degrees of freedom, sum of squares and mean square information for total, regression and error.
- The p-value of the F-test is lower than α level (0.05) indicating that the model is statistically significant.

-	se FIN/						
Vhole N	lodel						⊿ 💌 EXAM1
Regres	sion Pl	ot					Leverage Plot
Actual	by Pre	dicted	Plo	t			
Effect	Summa	ary					
Lack O		•					
Residu		radict	od D	lat			
	•		a r	IOL			
Summ	ary of I	-It			1		
RSquare				0.89505			
RSquare			_	0.890487			
Root Me Mean of			- 1	162.04			
Observat			s)	25			
Analys	is of Va	ariance	•				
-			n of				
Source	DF	Squ	ares	Mean S	quare	F Ratio	2
Model	1	12418	.783	1	2418.8	196.152	0
Error	23	1456	.177		63.3	Prob >	F
C. Total	24	13874	.960			<.0001	*
Param	eter Es	timate	s				
Term	Estim	ate St	d Erre	or tRat	tio Pro	ob> t	
Intercept	15.621	969 1	0.574	48 1	48 0.	1532	



844

- Step 5: Display regression equation
  - 1. Click on the red triangle button next to "Response FINAL"
  - 2. Select "Estimates" and then "Show Prediction Expression"
- The Parameter Estimates section provides the estimates of parameters in the linear regression equation.

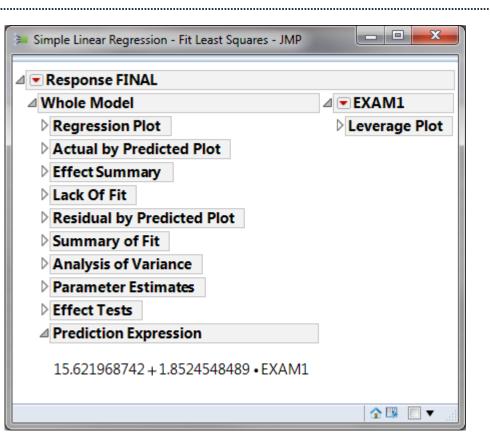



845

#### Interpreting the Results

- Rsquare Adj = 89.05%
  - 89% of the variation in FINAL can be explained by EXAM1
- P-value of the F-test = 0.000
  - We have a statistically significant model
- Prediction Equation: 15.6 + 1.85 × EXAM1
  - 15.6 is the Y intercept, all equations will start with 15.6
  - 1.85 is the EXAM1 Coefficient: multiply it by EXAM1 score



 Let us say you are the professor and you want to use this prediction equation to estimate what two of your students might get on their final exam.



#### Interpreting the Results

- Let us assume the following:
  - Student "A" exam 1 results were: 79
  - Student "B" exam 1 results were: 94.
- Remember our prediction equation?
  - 15.6 + 1.85 × Exam1
  - Now apply the equation to each student
    - Student "A" Estimate: 15.6 + (1.85 × 79) = 161.8
    - Student "B" Estimate: 15.6 + (1.85 × 94) = 189.5




Now you can use your "magic" as the professor and allocate your time appropriately to the student(s) who you predict need the most help Nice Work!

## 4.1.4 Residuals Analysis



- What are Residuals?
  - **Residuals** are the vertical differences between actual values and the predicted values or the "fitted line" created by the regression model.

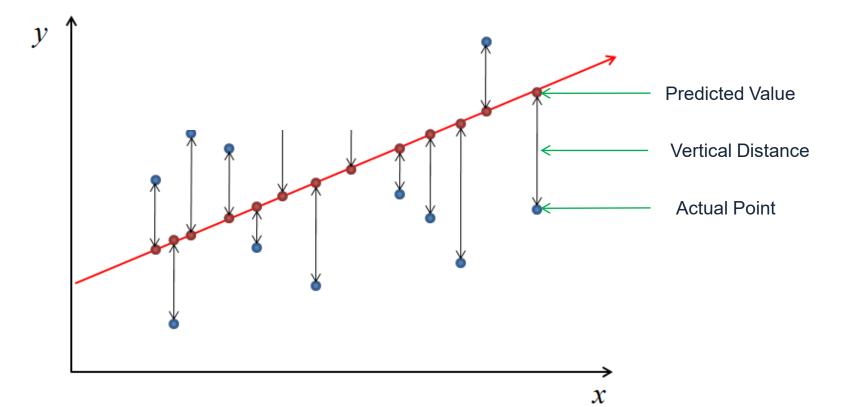





 $\odot$ 

Lean Sigma Corporation

#### Why Perform Residuals Analysis?

- *Regression equations* are generated on the basis of certain statistical assumptions.
- *Residuals analysis* helps to determine the validity of these assumptions. The *assumptions* are:
  - The residuals are normally distributed, mean equal to zero.
  - The residuals are independent.
  - The residuals have a constant variance.
  - The underlying population relationship is linear.
- If residuals performance does not meet the requirements, we will need to rebuild the model by replacing the predictor with a new one, adding new predictors, building non-linear models, and so on.



# $\odot$ Lean Sigma Corporation Lean Six Sigma Training - JMF

- Step 1: Generate the columns for residual analysis in your data set.
- Click on the red triangle button next to "Response FINAL"
- 2. Select "Save Columns" -> "Residuals"
- 3. Select "Save Columns -> "Predicted Values"
- A new column called "Residual FINAL" appears in the JMP data sheet along with a column labeled "PredictedFINAL"

File Edit Tables	Rows Cols	DOE Ana	alyze Graph	Tools View	Window Help
i 🔛 🦖 💕 🔛   🐰	· 🖻 🛍 📕 👭		🖹 🖾 🎘 🖉		
▼Simple Linear ▷		EXAM1	FINAL	Residual FINAL	Predicted FINAL
	1	73	152	1.1488272874	150.85117271
	2	93	185	-2.900269691	187.90026969
	3	89	180	-0.490450295	180.4904503
Columns (4/0)	4	96	196	2.5423657625	193.45763424
🚄 EXAM1	5	73	142	-8.851172713	150.85117271
FINAL	6	53	101	-12.80207573	113.80207573
Residual FINAL Predicted FINAL >>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>	7	69	149	5.558646683	143.44135332
	8	47	115	12.312653359	102.68734664
	9	87	175	-1.785540597	176.7855406
	10	79	164	2.034098194	161.96590181
Rows 25	11	69	141	-2.441353317	143.44135332
All rows 25 Selected 0	12	70	141	-4.293808166	145.29380817
Excluded 0	13	93	184	-3.900269691	187.90026969
Hidden 0	14	79	152	-9.965901806	161.96590181
Labelled 0	15	70	148	2.7061918341	145.29380817
	16	•			•



- Step 2: Check whether residuals are normally distributed around the mean of zero.
  - 1. Click Analyze -> Distribution
  - 2. Select Residual FINAL as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Residual FINAL"
  - 5. Select Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"




Distribution - JMP		
The distribution of values in each co	lumn	
- Select Columns	Cast Selected Columns into Roles —	Action —
<ul> <li>Columns</li> <li>EXAM1</li> <li>FINAL</li> </ul>	Y, Columns Residual FINAL optional	OK Cancel
Residual FINAL	Weight optional numeric	
Histograms Only	Freq optional numeric By optional	Remove Recall Help
		🟠 🔲 ▼:



 $\odot$ 

www.LeanSigmaCorporation.com

- The Parameter Estimates section provides the mean of residuals. In this case, it is small enough to be considered zero.
- The Goodness-of-Fit Test section provides the Normality Test results. Since the p-value (0.41) is greater than the alpha level (0.05), we fail to reject the null and the residuals are normally distributed.
  - H0: The residuals are normally distributed.
  - H1: The residuals are not normally distributed.

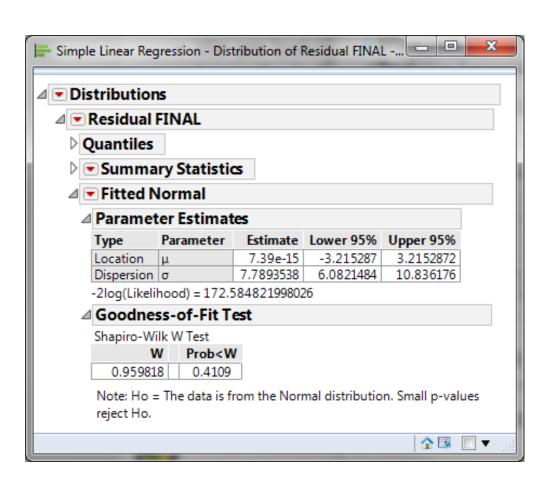



- Step 3: If the data are in time order, run the IR chart to check whether residuals are independent.
  - 1. Click Analyze -> Quality & Process -> Control Chart -> IR
  - 2. Select Residual FINAL as "Process"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Individual Measurement of Residual FINAL"
  - 5. Select Tests -> All Tests




😽 Control Chart - JMP		
IR Control Chart		
Select Columns	Cast Columns into Roles	Action
S Columns	Process Residual FINAL	ОК
EXAM1 FINAL	optional numeric	Cancel
Residual FINAL	Sample Label optional	Remove
Individual Measurement	Phase optional	
Moving Range (Average) Median Moving Range	By optional	Recall Help
Range Span 2	Specify Stats Delete Stats	
Parameters -		Get Limits
KSigma		🔲 Capability
O Alpha		
		▲ □ ▼



 $\odot$ 

- If no data points are out of control in both the I-Chart and MR charts, the residuals are independent of each other.
- If the residuals are not independent, it is possible that some important predicators are not included in the model.
- In this example, since the IR chart is in control, residuals are independent.

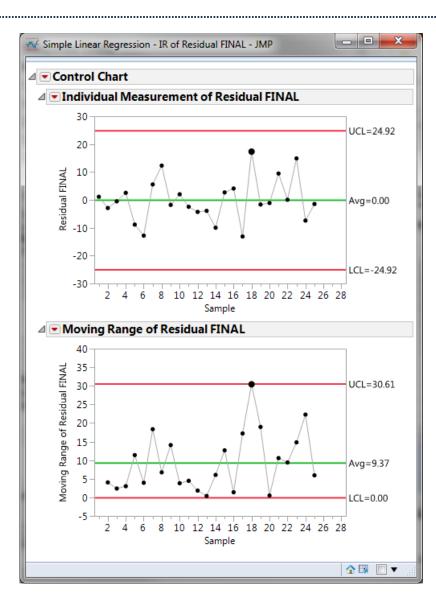




- Step 4: Check whether residuals have equal variance across the predicted responses.
  - 1. Click "Graph" -> "Scatterplot Matrix"
  - 2. A window named "Scatterplot Matrix" opens
  - 3. Select "Residuals FINAL" as "Y"
  - 4. Select "Predicted FINAL" as "X"
  - 5. Click "OK"

Scatterplot Matrix - JMP	-		- O X
Scatterplots of all pairs of Y variables, o	r all X-Y pairs if	X's specified	
Select Columns	Cast Selected	Columns into Roles —	Action —
<ul> <li>4 Columns</li> <li>EXAM1</li> <li>FINAL</li> <li>Residual FINAL</li> </ul>	Y, Columns	Residual FINAL optional	OK Cancel
Matrix Format Lower Triangular V	X	Predicted FINAL optional	Remove Recall
	Group	optional	Help
	Ву	optional	
			💁 🔲 🔻 💡



- We are looking for the pattern in which residuals spread out evenly around zero from the top to the bottom.
- When the assumption of constant variance is violated, a condition referred to as heteroscedasticity exists. (hetero = different, skedasis = dispersion)
- When heteroscedasticity exits, it can mislead us into believing an X variable is significant when it actually is not.

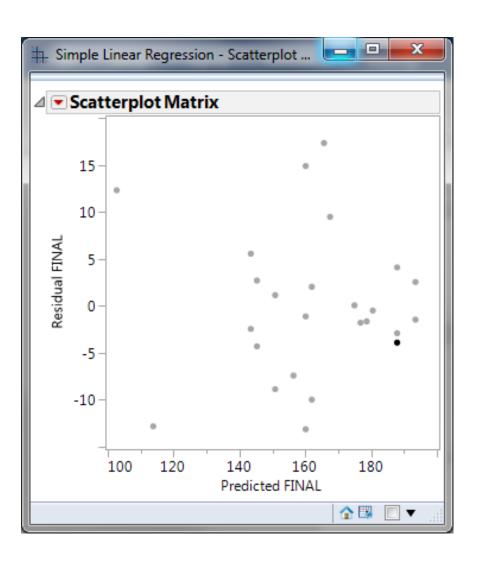







#### Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

#### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

- 4.3 Designed Experiments4.3.1 Experiment Objectives4.3.2 Experimental Methods4.3.3 DOE Design Considerations
- 4.4 Full Factorial Experiments
  4.4.1 2k Full Factorial Designs
  4.4.2 Linear and Quadratic Models
  4.4.3 Balanced and Orthogonal Designs
  4.4.4 Fit, Model, and Center Points
- **4.5 Fractional Factorial Experiments** 4.5.1 Designs
  - 4.5.2 Confounding Effects4.5.3 Experimental Resolution



# 4.2.1 Non-Linear Regression



#### Linear and Non-Linear

- The word *linear* originally comes from Latin word *linearis* meaning "created by lines."
- A linear function in mathematics follows the following pattern (i.e., the output is proportional to its input):

 $f(x) = \alpha * x + \beta$  $f(x_1, x_2, ..., x_n) = \alpha_1 * x_1 + \alpha_2 * x_2 + ... + \alpha_n * x_n + \beta$ 

 A non-linear function does not follow the above pattern. There are usually exponents, logarithms, power, polynomial components, and other non-linear functions of the independent variables and parameters.



#### Non-Linear Relationships Using Linear Models

- Many non-linear relationships can be transformed into linear relationships, and from there we can use linear regression methods to model the relationship.
- Some non-linear relationships cannot be transformed to linear ones and we need to apply other methods to build the non-linear models.
- In this section, we will focus on building non-linear regression models using linear transformation (i.e., transforming the independent or dependent variables or parameters to generate a linear function).



# Assumptions in Using Non-Linear Regression

- The population relationship is non-linear based on a reliable underlying theory.
- Across the range of all the possible values of the independent variables, the non-linear relationship applies. It is possible that at some extreme values the relationship between variables changes dramatically.



# Non-Linear Functions: Transforming to Linear

- Examples of non-linear functions that can be transformed to linear functions:
  - Exponential Function
  - Inverse Function
  - Polynomial Function
  - Power Function.



• Exponential Function

 $Y = a \times b^X$ 

• Transformation

 $\log Y = \log a + X \times \log b$ 



Inverse Function

$$Y = a + b \times \frac{1}{X}$$

• Transformation

$$Y = a + b \times Z$$
 where  $Z = \frac{1}{X}$ 



Polynomial Function

$$Y = a + b \times X + c \times X^2$$

• Transformation

$$Y = a + b \times X + c \times Z \quad \text{where} \quad Z = X^2$$



 $\odot$ 

Power Function

 $Y = a \times X^b$ 

• Transformation

 $\log Y = \log a + b \times \log X$ 







# What is Multiple Linear Regression?

- **Multiple linear regression** is a statistical technique to model the relationship between one dependent variable and two or more independent variables by fitting the data set into a linear equation.
- The difference between simple linear regression and multiple linear regression:
  - Simple linear regression only has one predictor.
  - Multiple linear regression has two or more predictors.



#### **Multiple Linear Regression Equation**

$$Y = \alpha_1 * X_1 + \alpha_2 * X_2 + ... + \alpha_p * X_p + \beta + e$$

- Y is the dependent variable (response).
- X<sub>1</sub>, X<sub>2</sub>, ..., X<sub>p</sub> are the independent variables (predictors). There are p predictors in total.
- Both dependent and independent variables are continuous.
- $\beta$  is the intercept indicating the Y value when all the predictors are zeros.
- $\alpha_1, \alpha_2, \ldots, \alpha_p$  are the coefficients of predictors. They reflect the contribution of each independent variable in predicting the dependent variable.
- *e* is the residual term indicating the difference between the actual and the fitted response value.



- Case study:
  - We want to see whether the scores in exam one, two, and three have any statistically significant relationship with the score in final exam. If so, how are they related to final exam score? Can we use the scores in exam one, two, and three to predict the score in final exam?
  - Data File: "Multiple Regression Analysis.jmp"
- Step 1: Determine the dependent and independent variables. All should be continuous.
  - Y (dependent variable) is the score of final exam.
  - X<sub>1</sub>, X<sub>2</sub>, and X<sub>3</sub> (independent variables) are the scores of exam one, two, and three respectively.
  - All the variables are continuous.



- Step 2: Start building the multiple linear regression model
  - Click Analyze -> Fit Model

Click "OK"

• Select FINAL as Y and EXAM1, EXAM2 and EXAM3 as predictors

Y       FINAL       Emphasis:       Effect Level         EXAM1       Optional       Emphasis:       Effect Level         EXAM2       Veight       Optional numeric       Help       Ru	mns       Y       Image: Final personality:       Standard Least Square         M1       optional       Emphasis:       Effect Leverage         M2       M3       Weight       optional numeric       Help       Run         Freq       optional numeric       Recall       Keep dialog open         By       optional       Remove         Construct Model Effects       Add       EXAM1         EXAM1       EXAM2       EXAM3	Model Specificatio		
EXAM1       optional       Effect Level         EXAM2       EXAM3       Weight       optional numeric       Help       Ru         FINAL       Freq       optional numeric       Recall       Keep di         By       optional       Remove       Remove         Construct Model Effects       Add       EXAM1         EXAM2       EXAM1       EXAM2         EXAM3       EXAM3       EXAM3	Al A2 A3 Weight optional numeric Freq optional numeric By optional Construct Model Effects Add EXAM1 EXAM2 EXAM2 EXAM3 Nest Degree 2			
Image: Second state	Weight     optional numeric     Help     Run       Freq     optional numeric     Recall     Keep dialog open       By     optional     Remove         Add     EXAM1       Cross     EXAM2       EXAM3     Nest       Macros ▼     Degree			Emphasis: Effect Leverage
By optional Remove Construct Model Effects Add EXAM1 EXAM2 EXAM3	By optional Remove Construct Model Effects Add EXAM1 EXAM2 Cross EXAM3 Nest Degree 2		Weight optional numeric	Help
Construct Model Effects Add EXAM1 EXAM2 EXAM3	Construct Model Effects Add EXAM1 EXAM2 Cross EXAM3 Nest Degree 2			
Add EXAM1 EXAM2 EXAM3	Add     EXAM1       Cross     EXAM2       Cross     EXAM3       Nest     Degree		By optional	Remove
Cross EXAM2 EXAM3	Cross     EXAM2       Macros ▼     Degree		Construct Model Effects	
Cross EXAM3	Cross EXAM3		Add	
EXAMS	Nest Degree 2		Constant	
Nest	Macros Degree 2		EXAIVIS	
	Degree 2		Nest	
Macros 🕶			Macros 🕶	
Degree 2	Attributes 💌		Degree 2	
Attributes 💌			Attributes 💌	
Transform 💌			No Intercept	



- Step 3: Check whether the whole model is statistically significant. If not, we need to re-examine the predictors or look for new predictors before continuing.
  - H<sub>0</sub>The model is not statistically significant (i.e. all the parameters of predictors are not significantly different from zeros).
  - H<sub>1</sub>: The model is statistically significant (i.e. at least one predictor parameter is significantly different from zero).
- In this example, p-value is much smaller than alpha level (0.05), hence we reject the null and conculed the model is statistically significant.

<ul> <li>Respons</li> </ul>	e FIN/	AL										
Whole M	odel									$\triangleright$	$\triangleright$	$\triangleright$
Actual	by Pre	dict	ted Pl	ot								
Effect S	•		1		1					EXAMI	EXAM2	EXAM3
		•	i ette el	DI						Ś	Ś	Ś
Residua	-		icted	PIO	τ					-	N	ω
⊿ Summa	ry of I	Fit										
RSquare					39662							
RSquare A					38185							
Root Mea			or		13565							
Mean of R Observation			(Mate)	1	62.04 25							
					23							
	Analysis of Variance											
c .			Sum of									
Source Model	<b>DF</b> 3		Squares 731.519	_	lean S	<b>qua</b> 577.		F Ra	_			
Error	21		143.44	-			7.17 670.0860 6.83 Prob > F		1			
C. Total	21		145.44. 874.960	-		<.00						
							l	~.001	1			
⊿ Parame												
Term		nate Std E										
Intercept		4.336102 3.764			-1.1			2623				
EXAM1	0.3559				2.9	-		0080*				
EXAM2 EXAM3	0.5425				 11.3	38	_	0001* 0001*				
Effect T			0.105	014	11	10	24	1001				



- Step 4: Check whether multicollinearity exists in the model.
  - 1. Right click in the Parameter Estimates table.
  - 2. Select Columns -> VIF
  - A new column with the heading "VIF" will appear in the table of Parameter Estimates.

Respons	e FINA	L												
/hole M	odel									$\triangleright$	$\triangleright$	$\triangleright$		
Actual	by Pre	dict	ted Plo	t										
Effect S	•		1							Ă	Ă	Ă		
Residua		•	icted P	lo	t					EXAM1	EXAM2	EXAM3		
Summa	•													
RSquare	-		0	.98	39662									
RSquare A	١dj		0	).98	38185									
Root Mea	n Square	Erro	or 2	2.61	13565									
Mean of R	lesponse			1	62.04									
Observatio	ons (or S	um	Wgts)		25									
Analysi	s of Va	ria	nce											
			Sum of											
Source	DF	- 5	quares	M	lean Squ	Jare	F Ra	ntio						
Model	3	13	731.515		457	7.17	670.0	860						
Error	21		143.445			6.83	Prob	> F						
C. Total	24	13	874.960				<.00	01*						
Parame	ter Est	im	ates											
Term	Estima	ate	Std Err			Error t Ratio Pro		Prob> t			VIF			
Intercept	-4.336	102	3.7642					0.	2623					
EXAM1	0.3559	382	0.1213	89	2.93	0.			068347					
EXAM2	0.5425	188	0.1008	49	5.38	<.			869025					
EXAM3	1.1674	442	0.1030	14	11.33	<.	0001*	5.1	512787					



#### **Multicollinearity**

- **Multicollinearity** is the situation when two or more independent variables in a multiple regression model are correlated with each other.
- Although multicollinearity does not necessarily reduce the predictability for the model as a whole, it may mislead the calculation for individual independent variables.
- To detect multicollinearity, we use VIF (Variance Inflation Factor) to quantify its severity in the model.



#### Variance Inflation Factor

- VIF quantifies the degree of multicollinearity for each individual independent variable in the model.
- VIF calculation:
  - Assume we are building a multiple linear regression model using p predictors.  $Y = \alpha_1 \times X_1 + \alpha_2 \times X_2 + ... + \alpha_n \times X_n + \beta$
  - Two steps are needed to calculate VIF for X<sub>1</sub>.
    - Step 1: Build a multiple linear regression model for X<sub>1</sub> by using X<sub>2</sub>, X<sub>3</sub>, ..., X<sub>p</sub> as predictors.  $X_1 = a_2 \times X_2 + a_3 \times X_3 + ... + a_p \times X_p + b$

 $VIF = \frac{1}{1 - R^2}$ 

- Step 2: Use the  $R^2$  generated by the linear model in step 1 to calculate the VIF for  $X_1$ .
- Apply the same methods to obtain the VIFs for other Xs. The VIF value ranges from one to positive infinity.



#### Variance Inflation Factor

- Rules of thumb to analyze variance inflation factor (VIF):
  - If VIF = 1, there is no multicollinearity.
  - If 1 < VIF < 5, there is small multicollinearity.
  - If VIF  $\geq$  5, there is medium multicollinearity.
  - If VIF  $\geq$  10, there is large multicollinearity.



#### How to Deal With Multicollinearity

- Increase the sample size.
- Collect samples with a broader range for some predictors.
- Remove the variable with high multicollinearity and high p-value.
- Remove variables that are included more than once.
- Combine correlated variables to create a new one.
- In this section, we will focus on removing variables with high VIF and high p-value.



- Step 5: Deal with multicollinearity:
  - Step 5.1: Identify a list of independent variables with VIF higher than 5. If no variable has VIF higher than 5, go to Step 6 directly.
  - Step 5.2: Among variables identified in Step 5.1, remove the one with the highest p-value.
  - Step 5.3: Run the model again, check the VIFs and repeat Step 5.1.
  - Note: we only remove one independent variable at a time.



- Step 6: Identify the statistically insignificant predictors. Remove one insignificant predictor at a time and run the model again. Repeat this step until all the predictors in the model are statistically significant.
  - Insignificant predictors are the ones with p-value higher than alpha level (0.05).
     When p > alpha level, we fail to reject the null hypothesis; the predictor is not significant.
    - H<sub>0</sub>: The predictor is not statistically significant.
    - H<sub>1</sub>: The predictor is statistically significant.
- As long as the p-value is greater than 0.05, remove the insignificant variables one at a time in the order of the highest p-value.
- Once one insignificant variable is eliminated from the model, we need to run the model again to obtain new p-values for other predictors left in the new model.



- In this example, all three predictors have VIF higher than 5. Among them, EXAM1 has the highest pvalue.
- We will remove EXAM1 from the equation and run the model again.

Itiple Reg	ression	Anal	ysis - Fi	t Lea	ast Squ	ares -	JMP					23
Respons	e FIN	AL										
Vhole M	odel									$\triangleright$	Þ	⊳
Actual	by Pre	dict	ted Pl	ot								
Effect S	umma	arv	1							EXAMI	EXAM2	EXAM3
Residua		•	icted	Dia	•					S	Š.	N.
	-		icteu	FIO						-		~
Summa	ary of	Fit										
RSquare					39662							
RSquare A		-			38185							
Root Mea			or		13565							
Mean of F Observati			Mate)	1	62.04 25							
					25				1			
Analysi	s of V	aria	nce									
			Sum of									
Source	DF		Squares		lean S	•	F Ra					
Model	3		731.515	-	45	577.17	670.0					
Error	21		143.445	5		6.83	Prob	> F				
C. Total	24	13	874.960	)			<.00	01*				
Parame	eter Es	tim	ates									
Term	Estim	ate	Std Er	ror	t Rati	io Pro	ob> t		VIF			
Intercept	-4.336	5102	3.764	226	-1.1	5 0.	2623					
EXAM1	0.3559		0.121	389	2.9	0.0			068347			
EXAM2	0.5425		0.100	849	5.3	8 <.	0001*		869025			
EXAM3	1.1674	442	0.103	014	11.3	3  <.	0001*	5.1	612787			
Effect T	ests											



- Run the new multiple linear regression with only two predictors (i.e., EXAM2 and EXAM3).
- Check the VIFs of EXAM2 AND EXAM3. They are both smaller than 5; hence, there is little multicollinearity existing in the model.




- In this example, both predictors' pvalues are smaller than alpha level (0.05).
- As a result, we do not need to eliminate any variables from the model.

Respons	se FIN/	٩L		_			_				_	
Whole N	lodel										$\triangleright$	Þ
Actual	by Pre	dict	ted Pl	ot							F	F
Effect S	Summa	ary	1								EXAM2	EXAM3
Residu	al by P	red	icted	Plo	t						12	Ľ
⊿ Summa	ary of	Fit										
RSquare	•			0.98	35429							
RSquare /					34104							
Root Mea			or		31463							
Mean of				1	62.04							
Observat	ions (or S	Sum	Wgts)		25							
⊿ Analys	is of Va	aria	nce									
			Sum o	f								
Source	DF	5	Square	s M	lean S	qu	are	F Ra	itio			
Model	2	13	672.78	5	6836.39 743.913				134			
Error	22		202.17	5	9.19 Prob				> F			
C. Total	24	13	874.96	0				<.00	01*			
⊿ Param	eter Es	tim	ates									
Term	Estim	Estimate Std Er			t Rat	io	Pro	b> t		VIF		
Intercept	-4.337	665			-0.9	99	0.	3313				
EXAM2	0.7221	585	0.092		7.	77	<.(	0001*	3.	525145		
EXAM3	1.3375	123	0.098	3747	13.	54	<.(	0001*	3.	525145		
Effect	Tests											



. . . . . . . . . . . . . . . . .

- Step 7: Display regression equation
  - 1. Click on the red triangle button next to "Response FINAL"
  - 2. Select "Estimates" and then "Show Prediction Expression"
- The Prediction Expression section provides the estimates of parameters in the linear regression equation.

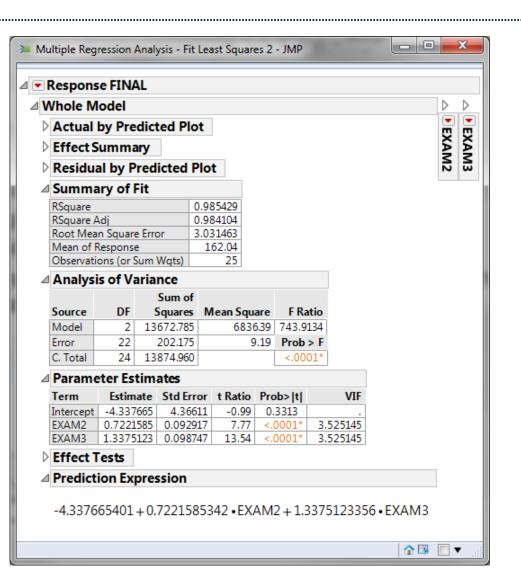



#### Interpreting the Results

- Rsquare Adj = 98.4%
  - 98% of the variation in FINAL can be explained by the predictor variables EXAM2 & EXAM3.
- P-value of the F-test = 0.000
  - We have a statistically significant model.
- Variables p-value:
  - Both are significant (less than 0.05).
- VIF
  - EXAM2 & EXAM3 are both below 5; we're in good shape!
- Equation: -4.34 + 0.722\*EXAM2 + 1.34\*EXAM3
  - -4.34 is the Y intercept, all equations will start with -4.34.
  - 0.722 is the EXAM2 coefficient; multiply it by EXAM2 score.
  - 1.34 is the EXAM3 coefficient; multiply it by EXAM3 score.



#### Interpreting the Results



- Let us say you are the professor again, and this time you want to use your prediction equation to estimate what one of your students might get on their final exam.
- Assume the following:
  - Exam 2 results were: 84
  - Exam 3 results were: 102.
- Use your equation: -4.34 + 0.722\*EXAM2 + 1.34\*EXAM3
- Predict your student's final exam score:
  - -4.34 + (0.722\*84) + (1.34\*102) = -4.34 + 60.648 + 136.68 = **192.988**



Nice work again! Now you can use your "magic" as the smart and efficient professor and allocate your time to other students because this one projects to perform much better than the average score of 162.

# 4.2.3 Confidence & Prediction Intervals



#### Prediction

- The purpose of building a regression model is not only to understand what happened in the past but more importantly to *predict* the future based on the past.
- By plugging the values of independent variables into the regression equation, we obtain the estimation/prediction of the dependent variable.



# **Uncertainty of Prediction**

- We build the regression model using the sample data to describe as close as possible the true population relationship between dependent and independent variables.
- Due to noise in the data, the prediction will probably differ from the true response value.
- However, the true response value might fall in a range around the prediction with some certainty.
- To measure the uncertainty of the prediction, we need confidence interval and prediction interval.



#### Confidence Interval

- The **confidence interval** of the prediction is a range in which the population mean of the dependent variable would fall with some certainty, given specified values of the independent variables.
- The width of confidence interval is related to:
  - Sample size
  - Confidence level
  - Variation in the data.
- We build the model based on a sample set  $\{y_1, y_2, ..., y_n\}$ . The confidence interval is used to estimate the value of the population mean  $\mu$  of the underlying population.
- The focus of the confidence interval are the unobservable population parameters.
- The confidence interval accounts for the uncertainty in the estimates of regression parameters.



#### **Prediction Interval**

- The prediction interval is a range in which future values of the dependent variable would fall with some certainty, given specified values of the independent variables.
- We build the model based on a sample set {y1, y2,..., yn}. The prediction interval is used to estimate the value of future observation  $y_{n+1}$ .
- The focus of the prediction interval are the future observations.
- Prediction interval is wider than confidence interval because it accounts for the uncertainty in the estimates of regression parameters and the uncertainty of the new measurement.



#### Use JMP to Obtain Prediction & Confidence Interval

- Steps in JMP to obtain prediction, confidence interval and prediction interval after running Regression tests.
  - 1. Click on the red triangle button next to "Response FINAL"
  - 2. Select Save Columns -> Prediction Formula
  - 3. Select Save Columns -> Mean Confidence Interval
  - 4. A new column named "Pred Formula FINAL" appears in the data table as well as two Confidence Interval columns for upper and lower 95% confidence intervals.



# Use JMP to Obtain Prediction & Confidence Interval

🙀 Multiple Regre	ssic	on Analysis - JMI	Р						x	
File Edit Table	es	Rows Cols	DOE	Analyze Grapł	n Tools Vie	ew Window Help				
📴 🤮 🛃	X	- 🗈 🚨 📕 🕴		📰 📄 🖳 😕						
💌 Multiple Reg	Þ		<b>M</b> 2	EXAM3	FINAL	Pred Formula FINAL	Lower 95% Mean FINAL	Upper 95% Mean FINAL		
		1	80	75	152	153.7484425	151.85711008	155.63977492	-	
		2	88	93	185	183.60093282	181.78825125	185.41361439		
		3	91	90	180	181.75487141	180.02372388	183.48601894		
Columns (7/0)		4	98	100	196	200.18510451	197.77880507	202.59140395		
EXAM1	^	5	66	70	142	136.95066135	135.07494337	138.82637932	:	
EXAM2 EXAM3		6	46	55	101	102.44480563	98.785617539	106.10399372		
FINAL	=	7	74	77	149	152.09051597	150.71287999	153.46815194		
📕 Pred Formula F	۳	8	56	60	115	116.35395265	113.57679605	119.13110925		
⊿ Lower 95% Με	•	9	79	90	175	173.088969	170.87377773	175.30416027		
<ul> <li>Rows</li> </ul>		10	70	88	164	163.91451752	160.62365761	167.20537744		
All rows	25	11	70	73	141	143.85183249	142.25060084	145.45306414		
Selected	0	12	65	74	141	141.57855215	139.4624097	143.69469461		
Excluded	0	13	95	91	184	185.98101789	183.8699806	188.09205517		
			0	14	80	73	152	151.07341783	148.85950387	153.28733179
labelleu	Ĭ	15	73	78	148	152.70586977	151.24239696	154.16934258		
evaluations done			-						·	

 $\odot$ 


www.LeanSigmaCorporation.com



4.2.4 Residuals Analysis

#### Remember what Residuals Are?

• **Residuals** are the vertical difference between actual values and the predicted values or the "fitted line" created by the regression model.

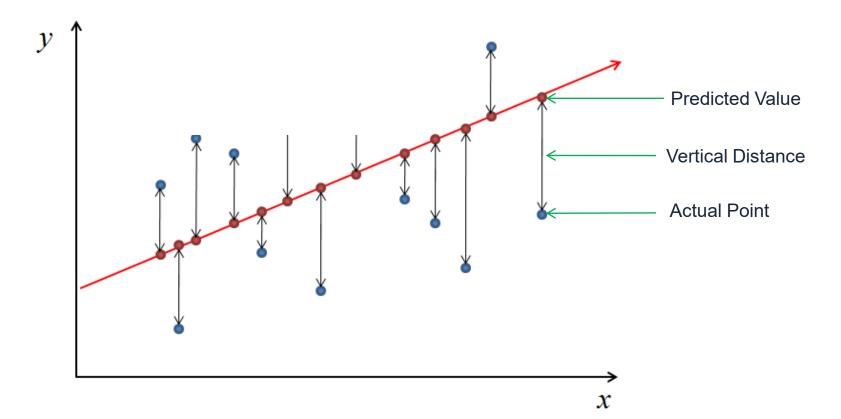



# Why Perform Residuals Analysis?

- The *regression equation* generated based on the sample data can make accurate statistical inference only if certain assumptions are met. Residuals analysis can help to validate these assumptions. The following assumptions must be met to ensure the reliability of the linear regression model:
  - The errors are normally distributed with mean equal to zero.
  - The errors are independent.
  - The errors have a constant variance.
  - The underlying population relationship is linear.
- If the residuals performance does not meet the requirement, we will need to rebuild the model by replacing the predictors with new ones, adding new predictors, building non-linear models, and so on.



#### Use JMP to Perform Residual Analysis

- Step 1: Create the column of residuals in the data set.
  - 1. Click on the red triangle button next to "Response FINAL"
  - 2. Select "Save Columns" -> "Residuals"
  - 3. Select "Save Columns" -> "Predicted Values"
  - 4. New columns "Residual FINAL" and "Predicted FINAL" add to your data.

🛄 Multiple	Regressi	on Analysis - JMI	р							x		
File Edit	Tables	Rows Cols	DOE Anal	yze Graph	Tools View	Window Help	)					
1 🚑 🔁 🛛												
<ul> <li>Multiple</li> </ul>	Reg ▷		EXAM1	EXAM2	EXAM3	FINAL	Pred Formula FINAL	Residual FINAL	Predicted FINAL			
Columns	(7/0)	1	73	80	75	152	153.7484425	-1.748442503	153.7484425			
A EXAM1		2	93	88	93	185	183.60093282	1.3990671826	183.60093282	=		
	*	3	89	91	90	180	181.75487141	-1.754871413	181.75487141			
Rows		4	96	98	100	196	200.18510451	-4.185104508	200.18510451			
All rows	25	5	73	66	70	142	136.95066135	5.0493386534	136.95066135			
Selected Excluded	0	6	53	46	55	101	102.44480563	-1.444805629	102.44480563			
Hidden	ő	7	69	74	77	149	152.09051597	-3.090515969	152.09051597			
Labelled	0	8	47	56	60	115	116.35395265	-1.353952649	116.35395265	-		
		9	•				·			•		
evaluations	done								🕜 🔲 ▼			



- Step 2: Check whether residuals are normally distributed around the mean of zero.
  - 1. Click Analyze -> Distribution
  - 2. Select Residual FINAL as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Residual FINAL"
  - 5. Select Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"




Distribution - JMP			
The distribution of values in each column			
Select Columns	Cast Selected	Columns into Roles —	Action
<ul> <li>Columns</li> <li>EXAM1</li> <li>EXAM2</li> <li>EXAM3</li> </ul>	Y, Columns	Residual FINAL optional	OK Cancel
FINAL Pred Formula FINAL	Weight	optional numeric	Remove
Residual FINAL Predicted FINAL	Freq By	optional numeric optional	Recall
Histograms Only	by	,	Help
			🟠 🔲 ▼:



 $\odot$ 

- The Parameter Estimates section provides the mean of residuals. In this case, it is small enough to be considered as zero.
- The Goodness-of-Fit Test section provides the Normality Test results. Since p-value (0.21) is greater than the alpha level (0.05), we fail to reject the null and the residuals are normally distributed.
  - H<sub>0</sub>: The residuals are normally distributed.
  - H<sub>1</sub>: The residuals are not normally distributed.

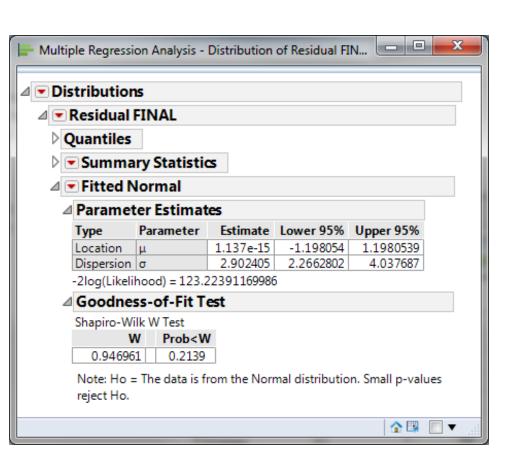



- Step 3: If the data are in the time order, run IR chart to check whether residuals are independent.
  - 1. Click Analyze -> Quality & Process -> Control Chart -> IR
  - 2. Select Residual FINAL as "Process"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Individual Measurement of Residual FINAL"
  - 5. Select Tests -> All Tests



😽 Control Chart - JMP		
IR Control Chart		
Select Columns	Cast Columns into Roles	Action
<ul> <li>Columns</li> <li>EXAM1</li> <li>EXAM2</li> <li>EXAM3</li> </ul>	Process Residual FINAL optional numeric	OK Cancel
<ul> <li>FINAL</li> <li>Pred Formula FINAL</li> <li>Residual FINAL</li> </ul>	Sample Label optional Phase optional	Remove
Predicted FINAL	Phase     optional       By     optional	Recall Help
<ul> <li>Individual Measurement</li> <li>Moving Range (Average)</li> <li>Median Moving Range</li> </ul>	Specify Stats Delete Stats	Get Limits
Range Span 2		Capability
Parameters KSigma Alpha 3		




905

 $\odot$ 

906

## Use JMP to Perform Residual Analysis

- If no data points are out of control in both I-Chart and MR chart, residuals are independent of each other.
- If residuals are not independent, it is possible that some important predicators are not included in the model.
- In this example, since the IR chart is in control, residuals are independent.

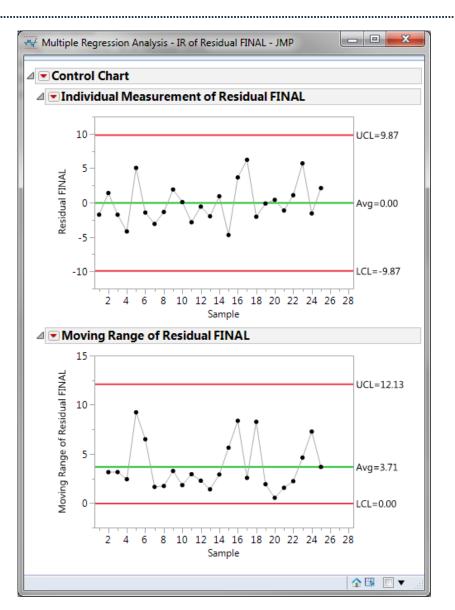




- Step 4: Check whether residuals have equal variance across the predicted responses.
  - Click "Graph" -> "Scatterplot Matrix" 1.
  - A window named "Scatterplot Matrix" opens 2.
  - Select "Residuals FINAL" as "Y" 3.
  - Select "Predicted FINAL" as "X" 4
  - Click "OK" 5.

Scatterplots of all pairs of Y variables, or a	II X-Y pairs if X's specified	
Select Columns	Cast Selected Columns into R	olesAction
<ul> <li>7 Columns</li> <li>EXAM1</li> <li>EXAM2</li> <li>EXAM3</li> <li>FINAL</li> <li>Pred Formula FINAL</li> </ul>	Y, Columns       Residual FIN.         optional         X       Predicted FIN.         optional	Cancel
A Residual FINAL Predicted FINAL Matrix Format Lower Triangular	Group	Recall Help
( <b>)</b> )	By optional	·



- We are looking for the pattern in which residuals spread out evenly around zero from the top to the bottom.
- When the assumption of constant variance is violated, a condition referred to as heteroscedasticity exists. (hetero = different, skedasis = dispersion)
- When heteroscedasticity exits, it can mislead us into believing an X variable is significant when it actually is not.

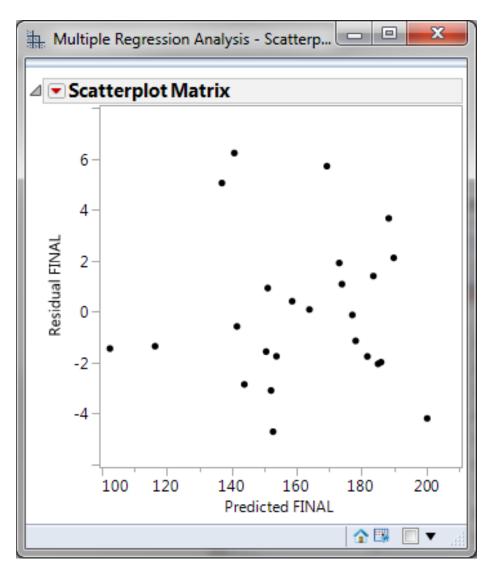



908

# Lean Six Sigma Training - JMP

# 4.2.5 Data Transformation



#### What is the Box-Cox Transformation?

- When a response does not fit the model well, sometimes using a transformation of the response can improve the fit.
- Power transformation is a class of transformation functions that raise the response to some power. For example, a square root transformation converts X to X<sup>1/2</sup>.
- **Box-Cox transformation** is a popular power transformation method developed by George E. P. Box and David Cox.



911

#### **Box-Cox Transformation Formula**

• The formula of the Box-Cox transformation is:

 $\begin{bmatrix} y = \frac{x^{\lambda} - 1}{\lambda} & \text{where } \lambda \neq 0 \\ y = \ln x & \text{where } \lambda = 0 \end{bmatrix}$ 

*y* is the transformation result. *x* is the variable under transformation.  $\lambda$  is the transformation parameter.



- JMP provides the best Box-Cox transformation with an optimal  $\lambda$  (lambda) for minimizing the model SSE (sum of squared error).
- Here is an example of how we transform the non-normally distributed response to normal data using Box-Cox method.
- Data File: "Box-Cox.jmp"



- Step 1: Test the normality of the original data set.
  - 1. Click Analyze -> Distribution
  - 2. Select Y as "Y, Column"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Y"
  - 5. Select Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"




Distribution - JMP		-									
The distribution of values in each column											
Select Columns	Cast Selected	l Columns into Roles —	Action								
8 Columns	Y, Columns	<u>⊿</u> Ү	ОК								
ARun		optional	Cancel								
I F I Ct											
<b>⊿</b> τ	Weight	optional numeric	Remove								
<b>⊿</b> Cn	Freq	optional numeric	Recall								
Pattern	By	optional	Help								
<u> </u>	· · ·										
Histograms Only											



 $\odot$ 

- Normality Test:
  - H0: The data is normally distributed.
  - H1: The data is not normally distributed.
- If p-value > alpha level (0.05), we fail to reject the null. Otherwise, we reject the null.
- In this example, p-value = 0.0394, less than the alpha level (0.05). The data is not normally distributed.

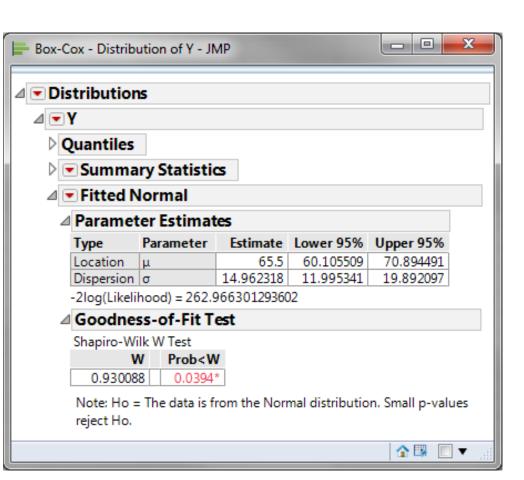



- Step 2: Run the Box-Cox Transformation:
  - 1. Click Analyze -> Fit Model
  - 2. Select Y as "Y"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Response Y"
  - 5. Select Factor Profiling -> Box Cox Y Transformation
  - 6. A chart of sum of squared error (SSE) and  $\lambda$  is plotted at the bottom of the analysis output.
  - 7. Click on the red triangle button next to "Box-Cox Transformations"
  - 8. Select "Save Best Transformation"
  - 9. A new column called "Y X" will be added to the data table.



			✓ Response Y ✓ Whole Model
🗯 Fit Model - JMP	1 1 -		Actual by Predicted Plot
Model Specificatio	on		Residual by Predicted Plot
- Select Columns	Pick Role Variables	Personality: Standard Least Squares 🔻	✓ ■ Box-Cox Transformations
B Columns     Run     F     Ct     A     T     Cn     Pattern     Y	Y optional Weight optional numeric Freq optional numeric By optional	Emphasis: Effect Leverage  Help Run Recall Keep dialog open Remove	$SSE \begin{array}{c} 10000 \\ 8000 \\ 4000 \\ 2000 \\ -2.0 \end{array} \begin{array}{c} -1.5 \\ -1.0 \end{array} \begin{array}{c} -1.0 \\ -0.5 \\ 0 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ 0 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ 0 \end{array} \begin{array}{c} 0.5 \\ -1.0 \\ -0.5 \end{array} \begin{array}{c} 0.0 \\ -1.5 \end{array} \begin{array}{c} 0.5 \\ -1.5 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ -0.5 \\ -0.5 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ -0.5 \\ -0.5 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ -0.5 \\ -0.5 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \end{array} \begin{array}{c} 0.0 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \\ -0.5 \end{array} \end{array}$
	Add Cross Nest Macros Degree 2		✓       Summary of Fit         RSquare       0         RSquare Adj       0         Root Mean Square Error       14.96232         Mean of Response       65.5         Observations (or Sum Wgts)       32
	Attributes 💌		⊿ Analysis of Variance
	Transform 💌 🔲 No Intercept		Source DF Squares Mean Square F Ratio
			Model         0         0.0000         0.0000         .           Error         31         6940.0000         223.871         Prob > F
			C. Total 31 6940.0000 .

📜 Box-Cox - Fit Least Squares - JMP

Parameter Estimates

evaluations done



🏠 🖾 🔲 🔻

х


Lean Six Sigma Training - JMP

 $\odot$ 

Lean Sigma Corporation

File Edit T	ables 🚽   🐰		DOE Analyz		ools View V	Vindow Help						
💌 Box-Cox	Þ		Run	F	Ct	A	т	Cn	Pattern	Y	YX	
		1	1	-1	-1	-1	-1	-1		61	763.13525495	
		2	2	1	-1	-1	-1	-1	+	53	753.66628128	
		3	3	-1	1	-1	-1	-1	-+	63	765.22626443	
		4	4	1	1	-1	-1	-1	++	61	763.13525495	
Columns (9/	0)	5	5	-1	-1	1	-1	-1	+	53	753.66628128	
Run	- / -	6	6	1	-1	1	-1	-1	+-+	56	757.44526732	
F F		7	7	-1	1	1	-1	-1	-++	54	754.9595495	
🚄 Ct		8	8	1	1	1	-1	-1	+++	61	763.13525495	
A	=	9	9	-1	-1	-1	1	-1	+-	69	770.96422941	
T Cn		10	10	1	-1	-1	1	-1	++-	61	763.13525495	
Pattern		11	11	-1	1	-1	1	-1	-+-+-	94	788.82459683	
∠ Y		12	12	1	1	-1	1	-1	++-+-	93	788.24675767	
<b>⊿</b> ∨ x 土	Ŧ	13	13	-1	-1	1	1	-1	++-	66	768.18935857	
<ul> <li>Rows</li> </ul>		14	14	1	-1	1	1	-1	+-++-	60	762.05226295	
All rows	32	15	15	-1	1	1	1	-1	-+++-	95	789.393633	
Selected	0	16	16	1	1	1	1	-1	++++-	98	791.05013066	
Excluded Hidden	0	17	17	-1	-1	-1	-1	1	+	56	757.44526732	
abelled	ŏ	18	18	1	-1	-1	-1	1	++	63	765.22626443	
	-	19	10	4	1	1	1	4		70	1 05070314	

- The Box-Cox Transformations chart presents how the sum of squared errors change across λ ranging from -2 to 2.
- Based on the chart, when λ is between -0.5 and 0.0, the transformation is the best with minimum SSE.

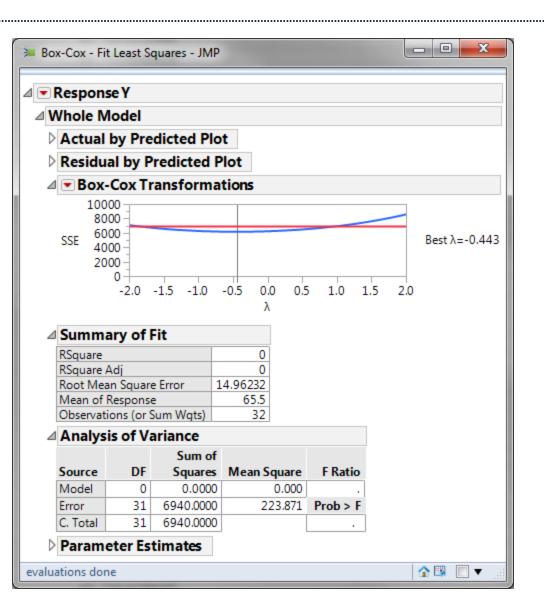




Lean Six Sigma Training - JMF

 $\bigcirc$ 

Lean Sigma Corporation

- Step 3: Test the normality of the newly transformed data set.
  - 1. Click Analyze -> Distribution
  - 2. Select "Y X" as "Y, Column"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Y X"
  - 5. Select Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"



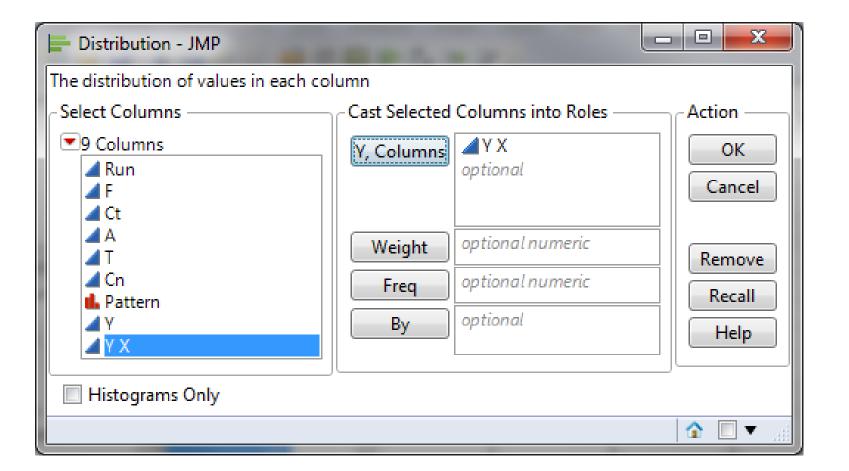




921

 $\odot$ 

- Normality Test:
  - H0: The data is normally distributed.
  - H1: The data is not normally distributed.
- If p-value > alpha level (0.05), fail to reject the null. Otherwise, reject the null.
- In this example, p-value = 0.496, greater than the alpha level (0.05). The data is normally distributed.

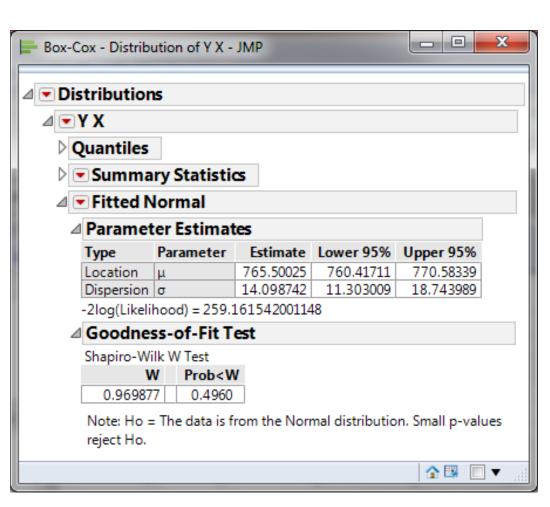



# 4.2.6 Stepwise Regression



#### What is Stepwise Regression?

- Stepwise regression is a statistical method to automatically select regression models with the best sets of predictive variables from a large set of potential variables.
- There are different statistical methods used in stepwise regression to evaluate the potential variables in the model:
  - F-test
  - T-test
  - R-square
  - AIC.



# Three Approaches to Stepwise Regression

- Forward Selection
  - Bring in potential predictors one by one and keep them if they have significant impact on improving the model.
- Backward Selection
  - Try out potential predictors one by one and eliminate them if they are insignificant to improve the fit.
- Mixed Selection
  - Is a combination of both forward selection and backward selection. Add and remove variables based on pre-defined significance threshold levels.



- Case study: We want to build a regression model to predict the oxygen uptake of a person who runs 1.5 miles. The potential predictors are:
  - Age
  - Weight
  - Runtime
  - Runpulse
  - RstPulse
  - MaxPulse.
- Data File: "Stepwise Regression.jmp"



• Sample Data Glance

				ze Graph Too	ols View Wind	dow Help						
				• 💆 🏓 🖉 📙								
<ul> <li>Stepwise Reg.</li> </ul>	Þ		Name	Sex	Age	Weight	Оху	Runtime	RunPulse	RstPulse	MaxPulse	
			Donna	F	42	68.15	59.571	8.17	166	40	172	
		2	Gracie	F	38	81.87	60.055	8.63	170	48	186	
	[	3	Luanne	F	43	85.84	54.297	8.65	156	45	168	
Columns (9/0	)	4	Mimi	F	50	70.87	54.625	8.92	146	48	155	
Name		5	Chris	M	49	81.42	49.156	8.95	180	44	185	
Sex		6	Allen	M	38	89.02	49.874	9.22	178	55	180	
🖌 Age		7	Nancy	F	49	76.32	48.673	9.4	186	56	188	
Weight	=	8	Patty	F	52	76.32	45.441	9.63	164	48	166	
🖌 Oxy 🔺 Runtime		9	Suzanne	F	57	59.08	50.545	9.93	148	49	155	
Runume		10	Teresa	F	51	77.91	46.672	10	162	48	168	
A RstPulse	Ŧ	11	Bob	M	40	75.07	45.313	10.07	185	62	185	
<ul> <li>Rows</li> </ul>		12	Harriett	F	49	73.37	50.388	10.08	168	67	168	
All rows	31	13	Jane	F	44	73.03	50.541	10.13	168	45	168	
Selected	0	14	Harold	M	48	91.63	46.774	10.25	162	48	164	
xcluded	0	15	Sammy	M	54	83.12	51.855	10.33	166	50	170	
Hidden .abelled	0	16	Buffy	F	52	73.71	45.79	10.47	186	59	188	
Cabenea	Ĭ	17	Trent	M	52	82.78	47 467 III	10.5	170	52	172	



 $\odot$ 

Lean Sigma Corporation

- Step 1:
  - 1. Click Analyze -> Fit Model
  - 2. Model Specification window appears.
  - 3. Select "Oxy" as the Y and add the 7 factors to the model effects box
  - 4. Select "Stepwise" in the "Personality" dropdown box
  - 5. Click "Run Model"



🏓 Fit Model - JMP	BRARK.	
Model Specification		
Model Specification Select Columns 9 Columns Sex Age Weight Oxy Runtime RunPulse RstPulse MaxPulse	Pick Role Variables Y Oxy optional Weight optional numeric Freq optional numeric By optional Construct Model Effects Add Sex Add Sex Age Weight Runtime RunPulse RstPulse Macros ▼ Degree 2 Attributes ▼ Transform ▼ No Intercept	Personality: Stepwise



929

 $\odot$ 

- Step 2:
  - 1. The "Stepwise Fit" page shows up
  - 2. Select P-value Threshold for the Stopping Rule
  - 3. Enter the "Prob to Enter" and "Prob to leave" thresholds into the corresponding text boxes, 0.25 to enter, 0.1 to leave.
  - 4. Select the stepwise regression direction, "Forward"
  - 5. Click "Go" button to let JMP automatically find the set of predictors satisfying the pre-defined significance probability thresholds



📁 Stepwise Regress	ion - Fit Step	wise - JMP					- 0 X			
Stepwise Fit	t for Oxy									
⊿ Stepwise Regression Control										
Stopping Rule:										
	Prob to Enter Prob to Leav			Rem	nove All R	un Model				
Direction:	Forward •	-								
Rules:	Combine	•								
Go	Stop St	tep								
SSE DF	E RMSE	RSquare	RSqua	re Adj	Ср	p AIC	c BIC			
851.38154 3	0 5.3272305	0.0000		0.0000 125	5.02784	1 195.101	8 197.5412			
Current Estin	mates									
Lock Entered	Parameter	Estimate	nDF	SS	"F Ratio"	"Prob>F"				
1	Intercept	47.3758065	1	0	0.000	1				
	Sex{M-F}	0	1		8.893	0.00575				
	Age	0	1	82.74954	3.122	0.08776				
	Weight	0	1	22.55181	0.789	0.38169				
	Runtime	0	1	632.9001	84.008	4.6e-10				
	RunPulse	0	1	134.8447	5.457	0.0266				
	RstPulse	0	1		5.503	0.02604				
	MaxPulse	0	1	47.71646	1.722	0.19975				
⊿ Step History										
		"Sig Prob"		A CC DC-			AICc BIC			
Step Param	eter Action	SIG Prob	- 56	eq SS RSq	uare C	РР	ALCC BIC			
							🏠 🐺 🔲 🔻 💡			



 $\odot$ 

- Stepwise Regression Results:
- Two of the seven potential factors are not statistically significant.
- Step History:
  - Step-by-step records on how to come up with the final model.

>= Stepwise	e Regressi	ion - Fit Stepv	wise - JMP											x
⊿ <b>▼</b> Step	wise Fit	for Oxy												
		gression Co	ontrol											
Stoppi	ng Rule: P-value Threshold  Prob to Enter 0.25 Prob to Leave 0.1 Enter All Make Model Remove All Run Model									5				
Directi	on:	Forward 🔻	•											
Rules:		Combine	•											
Go		Stop St	ep											
ss			RSquare R		ro Ad			p	-		AICc		BIC	
129.4235	-			-	0.8176	-		•	Р 6		1459	156		
⊿ Curre	nt Estin	nates							- 1					
Lock	Entered	Parameter	Estimate	nDF		SS	"F R	atio"	"F	Prob>	F"			
<b>V</b>	1	Intercept	93.008066	1		0		0.000			1			
		Sex{M-F}	-0.6580857	1	10.69	9236		2.065		0.163	308			
	/	Age	-0.1833162	1	20.2	8651		3.919		0.058	387			
		Weight	0	1	2.18	9863		0.413		0.526	551			
	/	Runtime	-2.5882143	1	268.	6248	5	1.889		1.516	e-7			
	/	RunPulse	-0.3454973	1				8.893		0.00				
		RstPulse	0	1				0.000		0.999				
	/	MaxPulse	0.2825372	1	23.7	4011		4.586		0.042	217			
⊿Steph	History													
Step	Parame	eter Action	"Sig Prob"	Se	eg SS	RSa	uare	C	p	р	A	ICc	В	IC
1	Runtim				.9001			12.52	•	2			158.	
2	Age	Entered					7648			3			159.5	46 🔘
3	RunPul	se Entered			.1688		8096	6.326		4			156.4	
4	MaxPul	lse Entered	0.0538	21.9	8663	0.	8354	4.349	91	5	150.	237	155.3	41 🔘
5	Sex{M-	F} Entered	0.1631	10.6	9236	0.	8480	4.414	47	6	151.	146	156.3	14 🔍
													3	



 $\bigcirc$ 


# 4.2.7 Logistic Regression



#### What is Logistic Regression?

- Logistic regression is a statistical method to predict the probability of an event occurring by fitting the data to a logistic curve using logistic function.
- The dependent variable in a logistic regression can be binary (e.g., 1/0, yes/no, pass/fail), nominal (blue/yellow/green), or ordinal (satisfied/neutral/dissatisfied).
- The independent variables can be either continuous or discrete.



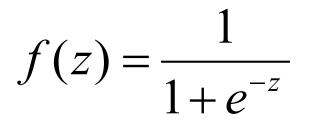

where *z* can be any value ranging from negative infinity to positive infinity.

The value of f(z) ranges from 0 to 1, which matches exactly the nature of probability (i.e.,  $0 \le P \le 1$ ).





 $\odot$ 

#### Logistic Regression Equation

• Based on the logistic function

$$f(z) = \frac{1}{1 + e^{-z}}$$

we define f(z) as the **probability** of an event occurring and z is the weighted sum of the significant predictive variables.

$$z = \beta_0 + \beta_1 \times x_1 + \beta_2 \times x_2 + \dots + \beta_k \times x_k$$



## Logistic Regression Equation

• Logistic Regression Y = F(x)

$$Y = \frac{1}{1 + e^{-(\beta_0 + \beta_1 \times x_1 + \beta_2 \times x_2 + \dots + \beta_k \times x_k)}}$$

where Y is the probability of an event occurring and x's are the significant predictors.

Note:


- When building the regression model, we use the actual *Y*, which is discrete (e.g. binary, nominal, ordinal).
- After completing building the model, the fitted Y calculated using the logistic regression equation is the probability ranging from 0 to 1. To transfer the probability back to the discrete value, we need SMEs' inputs to select the probability cut point.



937



• Logistic curve for binary logistic regression with one continuous predictor:

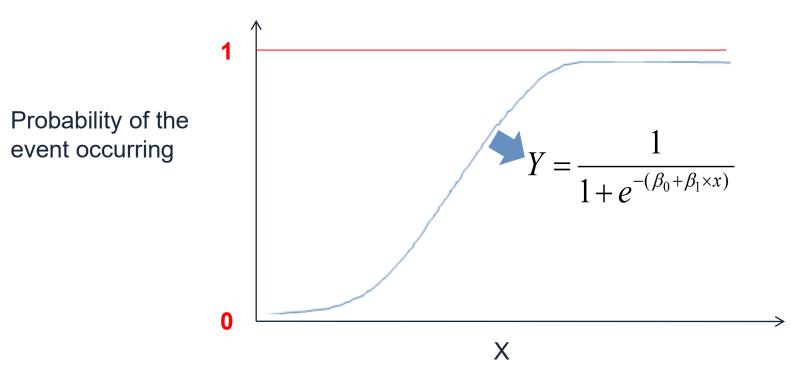



938



• **Odds** is the probability of an event occurring divided by the probability of the event not occurring.

$$Odds = \frac{P}{1-P}$$

• Odds range from 0 to positive infinity.



• Probability can be calculated using odds.

$$P = \frac{odds}{1 + odds} = \frac{e^{\ln(odds)}}{1 + e^{\ln(odds)}} = \frac{1}{1 + e^{-\ln(odds)}}$$

• Since in logistic regression model

$$P = \frac{1}{1 + e^{-(\beta_0 + \beta_1 \times x_1 + \beta_2 \times x_2 + \dots + \beta_k \times x_k)}}$$

therefore

$$\ln(odds) = \beta_0 + \beta_1 \times x_1 + \beta_2 \times x_2 + \dots + \beta_k \times x_k$$



940

 $\odot$ 

# Three Types of Logistic Regression

- Binary Logistic Regression
  - Binary response variable
  - Example: yes/no, pass/fail, female/male
- Nominal Logistic Regression
  - Nominal response variable
  - Example: set of colors, set of countries
- Ordinal Logistic Regression
  - Ordinal response variable
  - Example: satisfied/neutral/dissatisfied
- All three logistic regression models can use multiple continuous or discrete independent variables.
- All three logistic regression models can be developed in JMP using the same steps.



- Data File: "Logistic Regression.jmp"
- Response and potential factors
  - Response (Y): Female/Male
  - Potential Factors (Xs):
    - Age
    - Weight
    - Oxy
    - Runtime
    - RunPulse
    - RstPulse
    - MaxPulse
- We want to build a logistic regression model using the potential factors to predict the probability that the person measured is female or male.



- Step 1:
  - 1. Click Analyze -> Fit Model
  - 2. Select "Sex" as the Y and the 7 other factors into the model effects box
  - 3. Click "Run Model" button

🏓 Fit Model - JMP		
Model Specification		
Select Columns	Pick Role Variables	Personality: Nominal Logistic 🔹
Select Columns  9 Columns  Anne  Sex  Age  Weight  Oxy  RunTime RunPulse RstPulse MaxPulse	Y       Sex optional         Weight       optional numeric         Freq       optional numeric         By       optional         Construct Model Effects         Add       Age Weight Oxy RunTime	Personality: Nominal Logistic   Target Level:   Help Run  Recall Keep dialog open  Remove
	Nest     RunPulse       Macros ▼     RstPulse       Degree     2       Attributes     ▼       Transform     ▼       No Intercept	



- Step 2:
  - 1. The results of the regression model appear automatically
  - 2. Check the p-value of all the independent variables in the model
  - 3. Remove the insignificant independent variable one at a time from the model and rerun the model
  - 4. Repeat step 2.1 until all of the independent variables in the model are statistically significant.




- Since the p-values of all the independent variables are higher than the alpha level (0.05), we need to remove the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- MaxPulse has the highest p-value (0.9390), so it would be removed from the model first.

Logistic Reg	ression - Fit	Nominal Log	jisti	c - J 🕒								
⊿ 💌 Nomina	Nominal Logistic Fit for Sex											
Effect Su	Effect Summary											
Converged in	Converged in Gradient, 11 iterations											
Iterations												
	Vhole Model Test											
Fit Deta	ils											
⊿ Lack Of	Fit											
Source	DF -	LogLikelihoo	bd	ChiSqua	re							
Lack Of Fit		5.81019	_	11.62								
Saturated	30	0.00000	00	Prob>Cl								
Fitted	7	5.81019										
⊿ Paramet	ter Estima	tes										
Term	Estimate	Std Error	C	hiSquare	Pro	b>ChiSq						
Intercept	100.659111	79.712566		1.59		0.2067						
Age	-0.4939993			1.21		0.2713						
Weight	-2.2547881	1.5698096		2.06		0.1509						
	2.63827889			1.96		0.1618						
	1.97784786			0.64		0.4222						
	-0.0875632			0.04		0.8486						
	-0.4497319			1.07		0.3014						
MaxPulse	-0.0380525	0.4969179		0.01		0.9390						
For log odd	ls of F/M											
Covari	ance of Es	timates										
Effect	kelihood l	Ratio Test	5									
2 LINCOLLI			-	1								
				1								
and the second												



- Re-Open Your Last Dialog Box
  - 1. Click the red triangle next to "Nominal Logistic Fit for Sex"
  - 2. Select "Model Dialog"
  - 3. The dialog box used to create your last model opens.
  - 4. Remove the variable MaxPulse
  - Follow these same steps with each successive Logistic Regression output screen until you no longer have to remove variables.



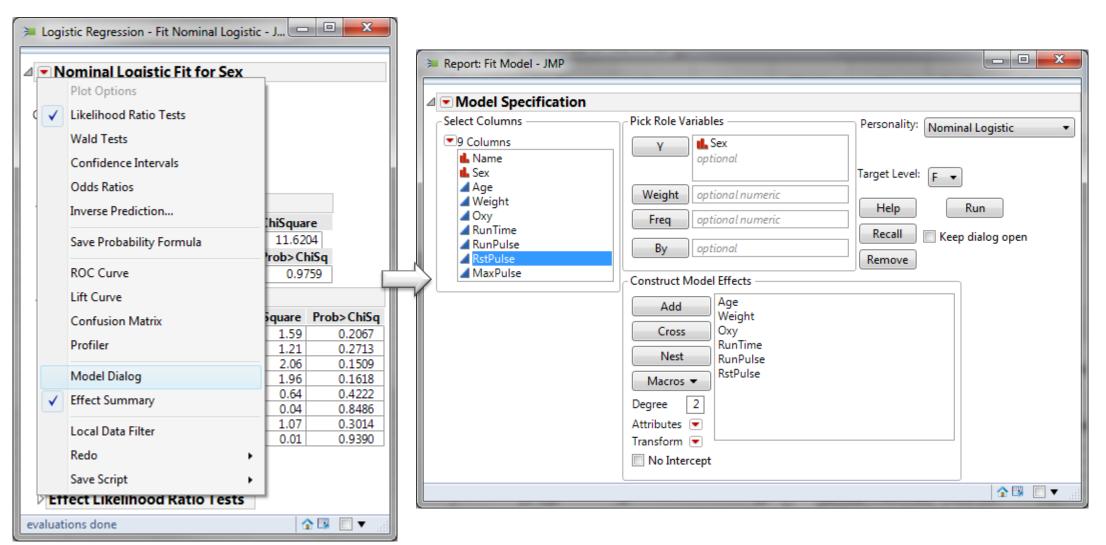



947

Lean Six Sigma Training - JMP

 $\bigcirc$ 

Lean Sigma Corporation

- After removing MaxPulse from the model, the p-values of all the independent variables are still higher than the alpha level (0.05), we need to continue removing the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- RunPulse has the highest p-value (0.4516), so it will be removed from the model next.

			x			
	ummary					
	Gradient, 1	1 iterations				
teratio	ns					
Nhole I	Model Tes	st				
it Deta	ils					
Lack Of	Fit					
ource	DF	-LogLikeliho	bo	ChiSqua	re	
ack Of Fit		5.81313	_	11.626		
aturated	30	0.00000	00	Prob>C		
itted	6	5.81313	13	0.9	838	
Parame	ter Estim	ates				
erm	Estimate		Ch	iSquare	Prot	>ChiSa
		81.034918		1.56		0.2122
\ge		0.4440978		1.27		0.2595
Veight	-2.27434	1.5757649		2.08		0.1489
Dxy	2.65448787	1.9076355		1.94		0.1641
lunTime	1.98520861	2.4287396		0.67		0.4137
RunPulse	-0.1208237	0.1604963		0.57		0.4516
stPulse	-0.4568973	0.419498		1.19		0.2761



- After removing RunPulse from the model, the p-values of all the independent variables are still higher than the alpha level (0.05), we need to continue removing the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- RunTime has the highest p-value (0.2684), so it would be removed from the model next.

Logistic Regression - Fit Nominal Logistic 3												
Nominal Logistic Fit for Sex												
Effect S	Effect Summary											
Converged in Gradient, 10 iterations												
▷ Iterations												
Whole	Model Tes	st										
Fit Deta												
⊿ Lack Of				CL IC								
Source	DF	-LogLikeliho		•								
Lack Of Fi		6.21408		12.42816								
Saturated Fitted	30	0.0000										
	-		022	0.9	020							
	ter Estima											
Term	Estimate		Ch	niSquare	Prot	o>ChiSq						
	66.5171786			1.72		0.1895						
-	-0.4557246			1.27		0.2604						
	-1.9109702			2.50		0.1138						
		1.4081799		2.49		0.1145						
	2.87015617	2.5933005		1.22		0.2684						
For log od		0.4024730		1,44		0.2293						
		atim star										
	iance of E			1								
Effect L	ikelihood	Ratio Test	s									
				1	s 💷							




- After removing Runtime from the model, the p-values of all the independent variables are still higher than the alpha level (0.05), we need to continue removing the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- Age has the highest p-value (0.3821), so it would be removed from the model next.

	-					
Logistic Re	gression - Fi	t Nominal Lo	gisti	ic 4 🕒		×
a 💌 Nomin	al Logisti	c Fit for Se	X			
Effect S	ummary					
Converged in	n Gradient, 9	iterations				
Iteratio	ns					
Whole	Model Tes	st				
Fit Deta	ails					
⊿ Lack Of						
				<b>CL 10</b>		
Source	DF	-LogLikeliho	14.58837			
Lack Of Fi Saturated	t 26 30					
Fitted	30	7.29418	Prob>C 0.9	<u> </u>		
			000	0.9	044	
⊿ Parame	ter Estim	ates				
Term		Std Error	Ch		Prot	o>ChiSq
	40.2907015			1.90		0.1685
-	-0.1689912			0.76		0.3821
Weight		0.5739394		2.77		0.0960
Oxy		0.6899718		2.41		0.1206
	-0.1516128	0.1291066		1.38		0.2403
For log od						
Covar	iance of E	stimates				
Effect L	ikelihood	Ratio Test	s			
				6		




- After removing Age from the model, the p-values of all the independent variables are still higher than the alpha level (0.05), we need to continue removing the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- RstPulse has the highest p-value (0.3857), so it would be removed from the model next.

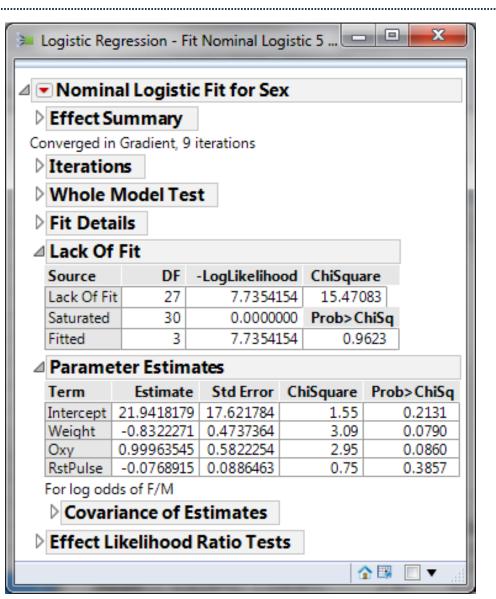




- After removing RstPulse from the model, the p-values of all the independent variables are still higher than the alpha level (0.05), we need to continue removing the insignificant independent variables one at a time from the model starting from the one with the highest p-value.
- Weight has the highest p-value (0.0755), so it would be removed from the model next.

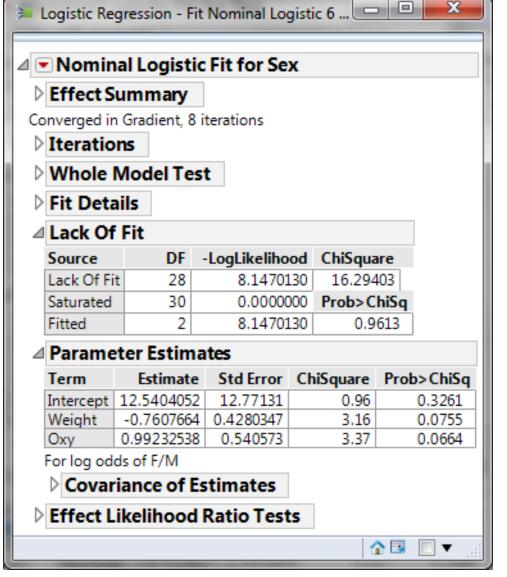




- Finally, after removing Weight from the model, the p-value of the only remaining independent variable "Oxy" is lower than the alpha level (0.05).
- There is no need to remove "Oxy" from the model.

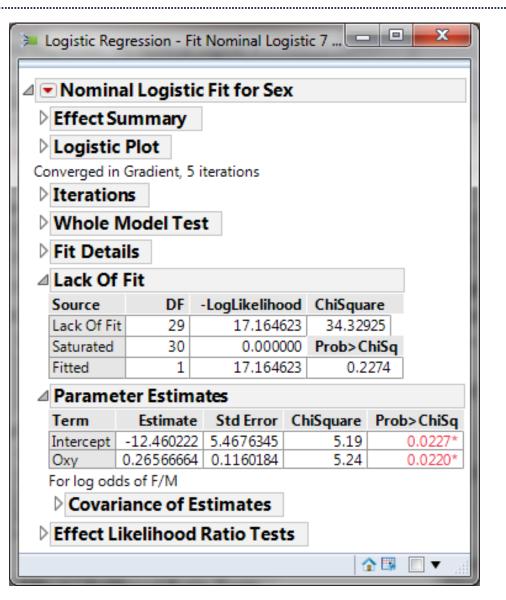



953

- Step 3:
  - Analyze the model results and see how the probability changes with the change of the independent variable
  - The Logistic Curve with Y axis indicates the probability of being male and the X axis indicating the value of oxygen uptake
  - When the amount of oxygen uptake increases, the probability of the person measured being male increases accordingly.
  - The R-squared is 20.06%. The R-squared of logistic regression is in general lower than the R-squared of the traditional multiple linear regression model

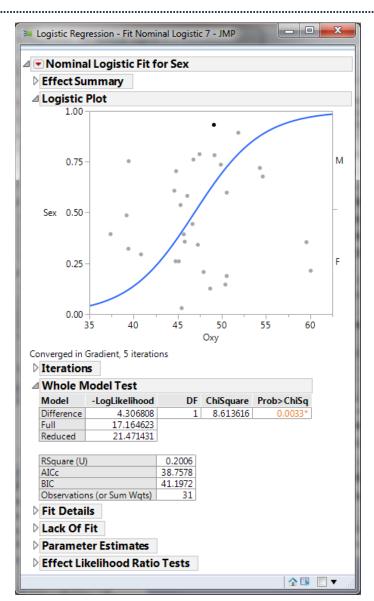



www.LeanSigmaCorporation.com

- Step 4:
  - 1. Click on the red triangle button next to "Nominal Logistic Fit for Sex" on the window of your last and "good" logistic regression.
  - 2. Click on "Save Probability Formula"
  - 3. The probabilities of the person measured being male and female are added to the right end of the data table.
  - 4. If the probability of a person measured being male is higher than 0.5, it is predicted that the person is male and the prediction is in the last column in the data table.




			Graph Tools			🖽 Logistic Regression - JMP										
i 🔛 🭋 🧀 🔒 🕺 🖣	à 🛍 📕 🗎		File Edit Tables Rows Cols DOE Analyze Graph Tools View Window Help													
■Logistic Regress ▷		Name	Sex	Age	Weight	Оху	RunTime	RunPulse	RstPulse	MaxPulse	Lin[F]	Prob[F]	Prob[M]	Most Likely Sex		
-		Donna	F	42	68.15	59.571	8.17	166	40	172	3.365805437	0.9666186095	0.0333813905	F		
-	2	Gracie	F	38	81.87	60.055	8.63	170	48	186	3.4943880891	0.9705276709	0.0294723291	F		
-	3	Luanne	F	43	85.84	54.297	8.65	156	45	168	1.9646795964	0.8770385004	0.1229614996	F		
	4	Mimi	F	50	70.87	54.625	8.92	146	48	155	2.0518182532	0.8861312142	0.1138687858	F		
	5	Chris	M	49	81.42	49.156	8.95	180	44	185	0.5988874184	0.6454017239	0.3545982761	F		
	6	Allen	M	38	89.02	49.874	9.22	178	55	180	0.7896360634	0.687753181	0.312246819	F		
Columns (13/0)	7	Nancy	F	49	76.32	48.673	9.4	186	56	188	0.470570433	0.6155187614	0.3844812386	F		
📕 Name 🔺	8	Patty	F	52	76.32	45.441	9.63	164	48	166	-0.388064136	0.4041834073	0.5958165927	Μ		
📕 Sex	9	Suzanne	F	57	59.08	50.545	9.93	148	49	155	0.9678983765	0.7247004015	0.2752995985	F		
Age Weight	10	Teresa	F	51	77.91	46.672	10	162	48	168	-0.061028506	0.484747607	0.515252393	M		
Oxy	11	Bob	M	40	75.07	45.313	10.07	185	62	185	-0.422069465	0.3960216514	0.6039783486	M		
✓ RunTime =	12	Harriett	F	49	73.37	50.388	10.08	168	67	168	0.9261887145	0.716301419	0.283698581	F		
🔺 RunPulse	13	Jane	F	44	73.03	50.541	10.13	168	45	168	0.9668357099	0.7244883386	0.2755116614	F		
RstPulse	14	Harold	M	48	91.63	46.774	10.25	162	48	164	-0.03393051	0.4915181863	0.5084818137	M		
MaxPulse	15	Sammy	M	54	83.12	51.855	10.33	166	50	170	1.3159216702	0.7885023785	0.2114976215	F		
▲ Lin[F] ♣ ★	16	Buffy	F	52	73.71	45.79	10.47	186	59	188	-0.29534648	0.426695467	0.573304533	M		
Most Likely Sev 🗐	17	Trent	M	52	82.78	47.467	10.5	170	53	172	0.1501764695	0.5374737152	0.4625262848	F		
<ul> <li>Rows</li> </ul>	18	Jackie	F	47	79.15	47.273	10.6	162	47	164	0.098637142	0.5246393118	0.4753606882	F		
All rows 31	19	Ralph	M	43	81.19	49.091	10.85	162	64	170	0.5816190871	0.6414398731	0.3585601269	F		
Selected 0	20	Jack	M	51	69.63	40.836	10.95	168	57	172	-1.611458997	0.1663861496	0.8336138504	M		
Excluded 0 Hidden 0	21	Annie	F	51	67.25	45.118	11.08	172	48	172	-0.47387446	0.3836996219	0.6163003781	M		
Labelled 0	22	Kate	F	45	66.45	44.754	11.12	176	51	176	-0.570577115	0.3611036692	0.6388963308	M		
	23	Carl	M	54	79.38	46.08	11.17	156	62	165	-0.218303155	0.4456399231	0.5543600769	M		
evaluations done		•												 ↑ 1 1 1 1 1 1 1 1 1 1 1 1 1		



 $\odot$ 

- Step 5:
  - 1. Click on the red triangle button next to "Nominal Logistic Fit for Sex"
  - 2. Select "Profiler"
  - 3. The Prediction Profiler appears
  - 4. Here you can see changing values of oxygen uptake, changes the probability of the person being male or female.

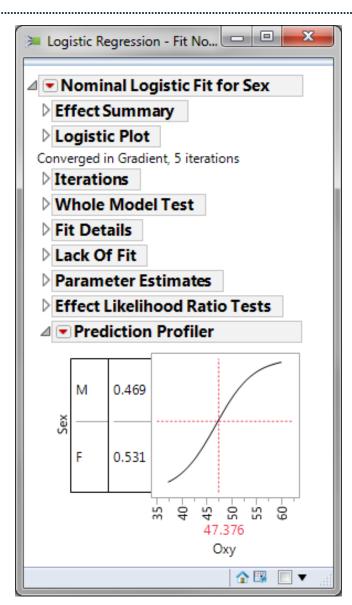



957

# 4.3 Designed Experiments



# Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

### **4.3 Designed Experiments** 4.3.1 Experiment Objectives 4.3.2 Experimental Methods

- 4.3.3 DOE Design Considerations
- 4.4 Full Factorial Experiments
  4.4.1 2k Full Factorial Designs
  4.4.2 Linear and Quadratic Models
  4.4.3 Balanced and Orthogonal Designs
  4.4.4 Fit, Model, and Center Points
- 4.5 Fractional Factorial Experiments
  - 4.5.1 Designs4.5.2 Confounding Effects4.5.3 Experimental Resolution



# © Lean Sigma Corporation





## What is an Experiment?

- An **experiment** is a scientific exercise to gather data to test a hypothesis, theory, or previous results.
- Experiments are planned studies in which data are collected actively and purposefully.
- A typical experiment follows this sequence:
  - A problem arises.
  - A hypothesis is stated.
  - An experiment is designed and implemented to collect data.
  - The analysis is performed to test the hypothesis.
  - Conclusions are drawn based on the analysis results.



# Why Use Experiments?

- Resolve Problems
  - Eliminate defects or defectives.
  - Shift performance means to meet customer expectations.
  - Squeeze variation, making process more predictable.
- Optimize Performance
  - Use statistical methods to get desired process response.
  - Minimize undesirable conditions, waste, or costs.
  - Reduce variation to eliminate out-of-spec conditions.
- Intelligent Design
  - Design processes around variables that have significant impact on process outputs.
  - Design processes around variables that are easier or more cost effective to manage.




# **Traditional Methods of Learning**

- Passive Learning
  - Study or observe events while they occur.
  - Study or analyze events after they occur.



- OFAT Experiment (One Factor at a Time)
- An experimental style limited to controlling one factor independently while others remain either static or are allowed to vary.

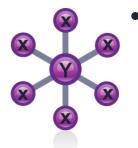

- Design of Experiments
  - Purposefully and proactively manipulate variables so their effect on the dependent variable can be studied.
  - Encourages an informative event to occur within specific planned parameters.



# What is the Design of Experiment (DOE)?

- **Design of experiment** (DOE) is a systematic and cost effective approach to plan the exercises necessary to collect data and quantify the cause-and-effect relationship between the response and different factors.

- In DOE, we observe the changes occurring in the output (i.e., response, dependent variable) of a process by changing one or multiple inputs (i.e., factors, independent variables).
- Using DOE we are able to manipulate several factors with every run and determine their effect on the "Y" or output.



# **Common DOE Terminology**

- **Response**: Y, dependent variable, process output measurement
- Effect: The change in the average response across two levels of a factor or between experimental conditions.
- Factor: X's, inputs, independent variables
- Fixed Factor: Factor that can be controlled during the study
- Random Factor: Factor that cannot be controlled during the study
- Level: factor settings, usually high and low, + and -, 1 and -1
- Treatment Combination: setting of all factors to obtain one response measurement (also referred to as a "run")
- **Replication**: Running the same treatment combination more than once (sequence of runs is typically randomized)
- Repeat: Non-randomized replicate of all treatment combinations
- Inference Space: Operating range of factors under study





- In Design of Experiments (DOEs);
  - X<sub>1</sub>, X<sub>2</sub>, ..., X<sub>k</sub> are the inputs of the process. They can be either continuous or discrete variables.
  - Y is the output of the process. Y is a continuous variable.
  - A single X or a group of Xs potentially have statistically significant impact on the Y with different levels of influence.

Note: DOE for discrete Y is not covered in this module.



966

 $\odot$ 

# **Objectives of Experiments**

- Active Learning:
  - Learn as much as possible with as little resources as possible. Efficiency is the name of the game.
- Identify Critical X's:
  - Identify the critical factors that drive the output or dependent variable ("Y").
- Quantify Relationships:
  - Generate an equation that characterizes the relationship between the X's and the Y.
- Optimize:
  - Determine the required settings of all the X's to achieve the optimal output or response.
- Validate:
  - Prove results through confirmation or pilot implementation before fully implementing solutions.



## **Principle of Parsimony**

- The ultimate goal of DOE is to use the minimum amount of data to discover the maximum amount of information.
- The experiment is designed to obtain data as parsimoniously as possible to draw as much information about the relationship between the response and factors as possible.
- DOE is often used when the resources to collect the data and build the model are limited.





- The objective of a specific DOE study should be determined by the team.
- The more complex the objective is, the more data are required. As a result, more time and money are needed to collect the data.
- By prioritizing the objectives and filtering factors which obviously do not have any effect on the response, a considerable amount of cost of running the DOE would be reduced.



970

# 4.3.2 Experimental Methods



# Planning a DOE

- 1. Problem Statement: Quantifiably define the problem
- 2. Objective: State the objective of the experiment
- 3. Primary Metric: Determine the response variable or "Y"
- 4. Key Process Input Variables (KPIV): Select the input variable(s) or X's
- 5. Factor Levels: Determine level settings for all factors
- 6. Design: Select the experimental design for your DOE
- **7. Project Plan**: Prepare a project plan for your experiment human and capital resource allocation, timing, duration etc.
- 8. Gain Buy-in: Your experiment will need support and buy-in from several places, get it!
- 9. Run the experiment
- **10.** Analyze, Interpret, and Share Results:



# **DOE Problem Statement**

- Much like the overall problem statement discussed in the Define phase, a DOE problem statement should specific and have quantifiable elements.
- Make sure your problem statement ties to a business goal or business performance indicator.
- Problem statements should not include:
  - Conclusions
  - Solutions
  - Causes.



# **DOE** Objectives

### State the objective of the experiment

- DOE Objective Examples:
  - "To determine the effects of tire pressure on gas mileage"
  - "To determine which factors have the most impact on gas mileage"
  - "To determine the effects of a pick-up truck's tailgate (up vs. down) on the truck's gas mileage"
  - "To determine which HVAC and Lighting factors are contributing most to Kwh consumption"
- DOE objective statements should:
  - Clearly define what you want to learn from the experiment
  - Declare study parameters or scope.





# DOE Primary Metric

- Recall our discussion of primary metrics in the Define phase?
  - We said something to this effect: "the primary metric is the most important measure of success."
- This statement still holds true when discussing the primary metric for a DOE.
- The primary metric for a DOE is your experiment's output or response under study.
- It is the "Y" in your transfer function Y = f(x).
- It is critical to understand the following things about your metric:
  - Measurement accuracy, R&R, and/or bias
  - Measurement frequency
  - Measurement resolution.





# **DOE Primary Metric**



- Before embarking on a design of experiment you should have validated your measurement system.
- If you have not, now would be a wise time to back track and do so.
- DOEs can be costly on a firm's time and resources.
- DOEs not planned and run properly will create waste and defective products because treatment combinations should "test" boundaries.
- Do not allow your entire study to be wasted because of a poor measurement system or one that can not respond frequently enough for your test.
- Measurement resolution is another key factor to consider for your DOE. Make sure your primary metric can decipher the size of the main effects and interactions you are looking for.



# **DOE Primary Metric**



- There is still even more to understand about your primary metric before jumping into a DOE.
- Be sure to answer these questions before proceeding:

- Is it discrete or continuous?
- Do you want to shift its mean?
- Do you want to squeeze variation?
- What is the baseline?
- Is it in control?
- Is there seasonality, trending, or any cycle?
- How much change do you want to detect?
- Is your metric normally distributed?



# DOE Input Variables – KPIVs (key process input variables)

- Factor selection is an important element in planning for a design of experiment.
- Factors are the "things" or metrics that your study responds to.
- Factors can be discrete or continuous.
- Factors should have largely been determined through the use of tools and analytics used throughout the DMAIC roadmap.
  - Failure modes and effects analysis
  - Cause and effect diagram (fishbone)
  - X-Y matrix


etc.

- Process mapping
- Planned studies
- Passive analytics



# **DOE Factor Settings**

- Factor settings are the range of values selected for each factor.
- Factor settings need to be predetermined before every experiment.
  - Let us use this paper airplane as an example. Our factors under study for max distance as a response might be:
    - 1. Number of folds
    - 2. Paper weight
    - 3. Paperclip (yes or no)
    - 4. Thrust
    - 5. Launch height
    - 6. Launch angle etc.

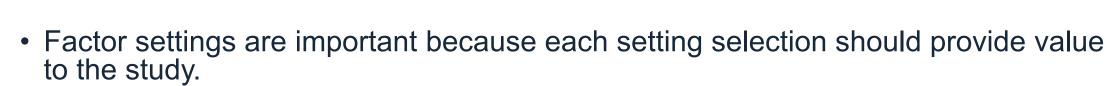

- Understanding the "margin" where that value can be found is where an experienced Black Belt will earn their keep.
- For example, what would we learn if we chose the test two levels for "number of folds" and we tested zero folds and 80 folds as our two settings for that factor? Right, nothing!



www.LeanSigmaCorporation.com


### DOE – Design Considerations

- Design selection is an aspect of properly planned design of experiments.
- High-level overview of design types (you will learn more about these in later modules)
  - Screening Designs:
    - Fractional factorials
    - Intended to narrow down the many factors to the vital few
    - Screening designs enable many factors to be evaluated at a lower cost because of the nature of the design (main effects)
  - Characterization Designs:
    - Higher resolution fractional factorials
    - Full factorials with fewer variables
    - Main effect and interactions
  - Optimization Designs:
    - Full factorials
    - Response surface designs.



# DOE Project Plan

- DOEs can require a fair amount of coordination between human and capital resources.
- Preparing a DOE project plan is a wise step.
- Make sure you identify critical dependencies like interfering with production or operating hours etc.
- Use project management software or, at a minimum, a Gantt chart to help you identify *critical path items*.

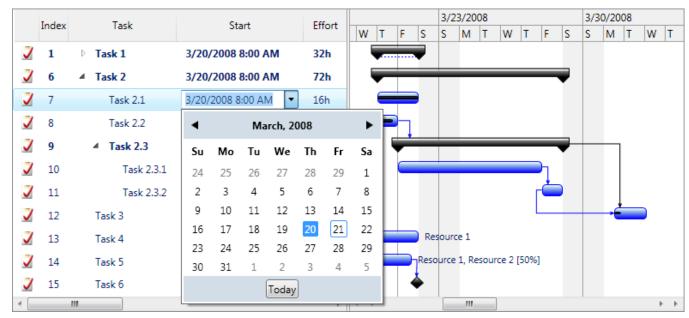



# DOE – Getting Support


• By running a DOE you are about to "discover" something new and better or validate an existing belief or assumption.

(If you do not believe this you should not be running your DOE)

- You are also about to cost your firm money or disrupt someone's routine...Get everyone on the same page before moving forward!
- Hopefully, you have already established the framework for the following items. If not, follow these steps:
  - **1.** Business Case and Justification
  - Stakeholder Analysis figure out who is with you and your project and who is not
  - **3.** Communication Plan build and execute your communication plan based on the first two items.




### **Run Your Experiment**

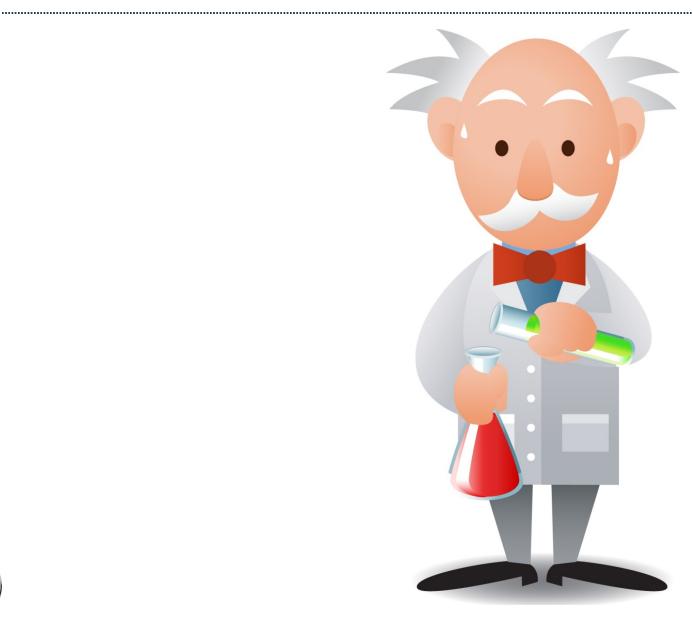



www.LeanSigmaCorporation.com

### Analyze, Interpret, and Share Your DOE Results

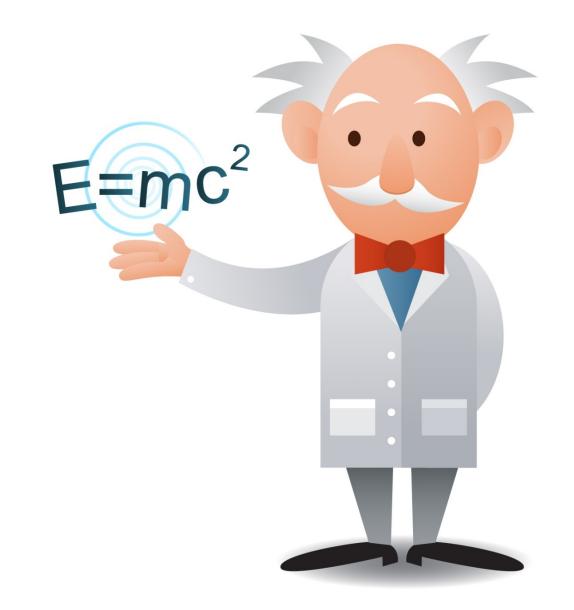




984

# **DOE Iterations**

- One single DOE might not be enough to completely answer the questions due to the following reasons:
  - None of the potential factors identified are statistically significant to the response.
  - More factors need to be included in the model.
  - Residuals of the model are not performing well.
  - The objectives of DOE changes due to business reasons.

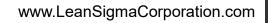



# 4.3.3 Experiment Design Considerations



# **Considerations of Experiments**

- Objectives of the experiments
- Resource availability to run the experiments
- Potential costs to implement the experiments
- Stakeholders' support for successful experiments
- Accuracy and precision of the measurement system
- Statistical stability of the process
- Unexpected plans or changes
- Sequence of running the experiments
- Simplicity of the model
- Inclusion of potential significant factors
- Settings of factors
- Well-behaved residuals



# 4.4 Full Factorial Experiments



# Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

#### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

4.3 Designed Experiments4.3.1 Experiment Objectives4.3.2 Experimental Methods4.3.3 DOE Design Considerations

#### 4.4 Full Factorial Experiments

- 4.4.1 2k Full Factorial Designs4.4.2 Linear and Quadratic Models4.4.3 Balanced and Orthogonal Designs4.4.4 Fit, Model, and Center Points
- 4.5 Fractional Factorial Experiments
  4.5.1 Designs
  4.5.2 Confounding Effects
  4.5.3 Experimental Resolution



# 4.4.1 2k Full Factorial Designs



# DOE Key Terms

- Response: Y, dependent variable, process output measurement
- Effect: The change in the average response across two levels of a factor or between experimental conditions
- Factor: X's, inputs, independent variables
- Fixed Factor: Factor that can be controlled during the study
- Random Factor: Factor that cannot be controlled during the study
- Factor Levels: Factor settings, usually high and low, + and -, 1 and -1
- Treatment Combination: setting of all factors to obtain one response measurement (also referred to as a "run")
- Replication: Running the same treatment combination more than once (sequence of runs is typically randomized)
- Repeat: Non-randomized replicate of all treatment combinations
- Inference Space: Operating range of factors under study
- Main Effect: The average change from one level setting to another for a single factor
- Interaction: The combined effect of two factors independent of the main effect of each factor



### More About Factors

- Factors in DOE are the potential causes that might have significant impact on the outcome of a process or a product.
- Factors are the inputs of a process or system and the response is the output of it.
- Factors can be continuous or discrete variables.
- Most experiments use two or more factors. Ask subject matter experts' opinions for main factors selection. The more factors in DOE, the more costs triggered.



### More About Factors

- The goal of a DOE is to measure the effects of factors and interactions of factors on the outcome.
- In DOE:
  - First, we create a set of different combinations of factors each at different levels.
  - Second, we run the experiment and collect the response values in different scenarios.
  - Third, we analyze the results and test how the response changes accordingly when factors change.






- Factor levels are the selected settings of a factor we are testing in the experiment.
- The more levels a factor has, the more scenarios we have to create and test. As a result, more resources are required to collect samples and the model is more complicated.
- The most popular DOE is two-level design, meaning only two levels for each factor.



### **Factor Levels**

- Code of factor levels
  - High vs. Low
  - (+1) vs. (-1)
  - (+) vs. (-)
- Example of factor levels
  - A study on how two factors affect the taste of cakes.

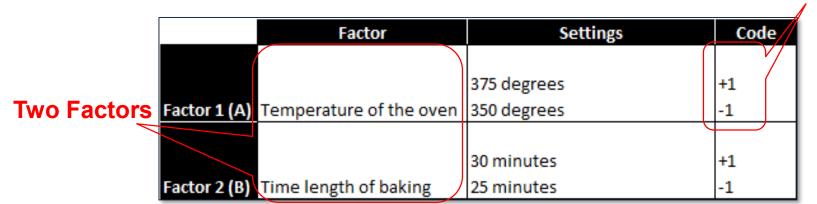



**Two Levels** 

## **Treatment Combination**

- A treatment is a combination of different factors at different levels.
- It is a unique scenario setting in an experiment.
- Coding treatments:
  - If there are two factors in an experiment, we name one factor A and the other factor B.
  - A single treatment in an experiment is named for each factor:
    - --, +-, -+ and ++
    - I, a, b and ab



## **Treatment Combination**

- Example of treatment
  - A study on how two factors affect the taste of cakes.

	Fac	tors				
Treatment	Temperature of	Time length of				
	the oven 350	baking 25				
a	375	25		Treatment	Factors	
b	350	30 4	-	Treatment	Factor A	Factor B
ab	375	30	(	I	-1	-1
				а	+1	-1
	Four treat	ments 🧹			+1	
	i vui tivut		$\neg \uparrow$	ab	+1	+1





- A response is the output of a process, a system, or a product.
- It is the outcome we are interested to improve by optimizing the settings of factors.
- In an experiment, we observe, record, and analyze the corresponding changes occurring in the response after changing the settings of different factors.



### Response

- Example of treatment
  - A study on how two factors affect the taste of cakes. We use a predefined metric to measure the cake's tastiness.
  - After running each treatment, we obtain and record the resulting response value.

	Factors						
Treatment	Temperature of	Time length of	Response	Treatment	Factors		Posponso
	the oven	baking			Factor A	Factor B	Response
I	350	25			-1	-1	20
а	375	25	18	а	+1	-1	18
b	350	30	22	b	-1	+1	22
ab	375	30	12	ab	+1	+1	12

One response /



### Main Effect

- Main effect is the average change in the response resulting from the change in the levels of a factor.
- It captures the effect of a factor alone on the response without taking into consideration other factors.
- In the baking cake example, the main effects of temperature and time length are

$$MainEffect_{A} = \frac{18 + 12}{2} - \frac{20 + 22}{2} = -6$$

$$MainEffect_{B} = \frac{22 + 12}{2} - \frac{20 + 18}{2} = -2$$



www.LeanSigmaCorporation.com

### Main Effect

- Interpretation of main effect in the example:
  - By changing the temperature level of the oven from high to low, the response (i.e., tastiness of the cake) increases by 6 measurement units.
  - By changing the time length of baking from high to low, the response (i.e., tastiness of the cake) increases by 2 measurement units.



### Interaction Effect

- Interaction effect is the average change in the response resulting from the change in the interaction of multiple factors.
- It occurs when the change in the response triggered by one factor depends on the change in other factor(s).



• Example of interaction effect

			$\frown$		
Treatment	Factors		Interaction	Response	
meatment	Factor A	Factor B	(A*B)	кезропзе	
I	-1	-1	+1	20	One interaction
а	+1	-1	-1	18	<b>One interaction</b>
b	-1	+1	-1	22	
ab	+1	+1	+1	12	

InteractionEffect = 
$$\frac{20+12}{2} - \frac{22+18}{2} = -4$$

• By changing the interaction from high to low, the response (i.e., tastiness of the cake) increases by 4 measurement units.



 $\odot$ 

# 2k Full Factorial DOE

- In a full factorial experiment, all of the possible combinations of factors and levels are created and tested.
- For example, for two-level design (i.e., each factor has two levels) with k factors, there are 2k possible scenarios or treatments.
  - 2 factors, each with 2 levels, we have 22 = 4 treatments
  - 3 factors, each with 2 levels, we have 23 = 8 treatments
  - k factors, each with 2 levels, we have 2k treatments



# 2k Full Factorial DOE

- Full factorial DOE is used to discover the cause-and-effect relationship between the response and both individual factors and the interaction of factors.
- Generate an equation to describe the relationship between Y and the important Xs:

$$Y = \alpha_0 + \alpha_1 X_1 + \alpha_2 X_2 + \dots + \alpha_p X_1 X_2 \cdots X_k + \varepsilon$$

where

Y is the response and  $X_1, X_2, ..., X_k$  are the factors.  $\alpha_0$  is the intercept and  $\alpha_1, \alpha_2, ..., \alpha_p$  are the coefficients of the factors and interactions.

 $\varepsilon$  is the error of the model.



### **Two-Level Two-Factor Full Factorial**

• Below is a design pattern of a two-level two-factor full factorial experiment:

Run	Treatment	Fact	tors
Null	meauneni	Α	В
1		-1	-1
2	а	+1	-1
3	b	-1	+1
4	ab	+1	+1



# **Two-Level Three-Factor Full Factorial**

• Below is a design pattern of a two-level three-factor full factorial experiment

Run	Treatment	Factors					
hull		Α	В	С			
1		-1	-1	-1			
2	а	+1	-1	-1			
3	b	-1	+1	-1			
4	ab	+1	+1	-1			
5	с	-1	-1	+1			
6	ac	+1	-1	+1			
7	bc	-1	+1	+1			
8	abc	+1	+1	+1			



### **Two-Level Four-Factor Full Factorial**

Below is a design pattern of a two-level four-factor full factorial experiment

Bus	Treatment	Factors					
Run		Α	В	С	D		
1		-1	-1	-1	-1		
2	а	+1	-1	-1	-1		
3	b	-1	+1	-1	-1		
4	ab	+1	+1	-1	-1		
5	С	-1	-1	+1	-1		
6	ac	+1	-1	+1	-1		
7	bc	-1	+1	+1	-1		
8	abc	+1	+1	+1	-1		
9	d	-1	-1	-1	+1		
10	ad	+1	-1	-1	+1		
11	bd	-1	+1	-1	+1		
12	abd	+1	+1	-1	+1		
13	cd	-1	-1	+1	+1		
14	acd	+1	-1	+1	+1		
15	bcd	-1	+1	+1	+1		
16	abcd	+1	+1	+1	+1		



www.LeanSigmaCorporation.com

## **Two-Level Five-Factor Full Factorial**

 At right is a design pattern of a two-level five-factor full factorial experiment

Run	Treatment			Factors		
i ann	incutinent	Α	В	С	D	E
1	1	-1	-1	-1	-1	-1
2	а	+1	-1	-1	-1	-1
3	b	-1	+1	-1	-1	-1
4	ab	+1	+1	-1	-1	-1
5	с	-1	-1	+1	-1	-1
6	ac	+1	-1	+1	-1	-1
7	bc	-1	+1	+1	-1	-1
8	abc	+1	+1	+1	-1	-1
9	d	-1	-1	-1	+1	-1
10	ad	+1	-1	-1	+1	-1
11	bd	-1	+1	-1	+1	-1
12	abd	+1	+1	-1	+1	-1
13	cd	-1	-1	+1	+1	-1
14	acd	+1	-1	+1	+1	-1
15	bcd	-1	+1	+1	+1	-1
16	abcd	+1	+1	+1	+1	-1
17	e	-1	-1	-1	-1	+1
18	ae	+1	-1	-1	-1	+1
19	be	-1	+1	-1	-1	+1
20	abe	+1	+1	-1	-1	+1
21	ce	-1	-1	+1	-1	+1
22	ace	+1	-1	+1	-1	+1
23	bce	-1	+1	+1	-1	+1
24	abce	+1	+1	+1	-1	+1
25	de	-1	-1	-1	+1	+1
26	ade	+1	-1	-1	+1	+1
27	bde	-1	+1	-1	+1	+1
28	abde	+1	+1	-1	+1	+1
29	cde	-1	-1	+1	+1	+1
30	acde	+1	-1	+1	+1	+1
31	bcde	-1	+1	+1	+1	+1
32	abcde	+1	+1	+1	+1	+1



#### Order to Run Experiments

- The four design patterns shown earlier are listed in the standard order.
- Standard order is used to design the combinations/treatments before experiments start.
- When actually running the experiments, randomizing the standard order is recommended to minimize the noise.



#### **Replication in Experiments**

- Each treatment can be tested multiple times in an experiment in order to increase the degrees of freedom and improve the capability of analysis. We call this method replication.
- Replicates are the number of repetitions of running an individual treatment.
- The order to run the treatments in an experiment should be randomized to minimize the noise.



- Case study: we are running a 22 full factorial DOE to discover the cause-and-effect relationship between the cake tastiness and two factors: temperature of the oven and time length of baking.
  - Each factor has two levels and there are four treatments in total.
  - We decide to run each treatment twice so that we have enough degrees of freedom to measure the impact of two factors and the interaction between two factors. Therefore, there are eight observations in response eventually.


	Factor	Settings	Code
		375 degrees	+1
Factor 1 (A)	Temperature of the oven	350 degrees	-1
		30 minutes	+1
Factor 2 (B)	Time length of baking	25 minutes	-1



• After running the four treatments twice in a random order, we obtain the following results

Treatment	Fac	tors	Interaction	Docponco
freatment	Factor A	Factor B	(A*B)	Response
	-1	-1	+1	20
а	+1	-1	-1	18
b	-1	+1	-1	22
ab	+1	+1	+1	12
	-1	-1	+1	21
а	+1	-1	-1	17
b	-1	+1	-1	22
ab	+1	+1	+1	13



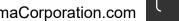


• The experiment results are consolidated into the following table

Fa		tors	Interaction	Response			
Treatment	Factor A	Factor B	(A*B)	Run 1	Run 2	Total	
I	-1	-1	+1	20	21	41	
а	+1	-1	-1	18	17	35	
b	-1	+1	-1	22	22	44	
ab	+1	+1	+1	12	13	25	



1013


• Main effect of factor A (temperature of the oven):

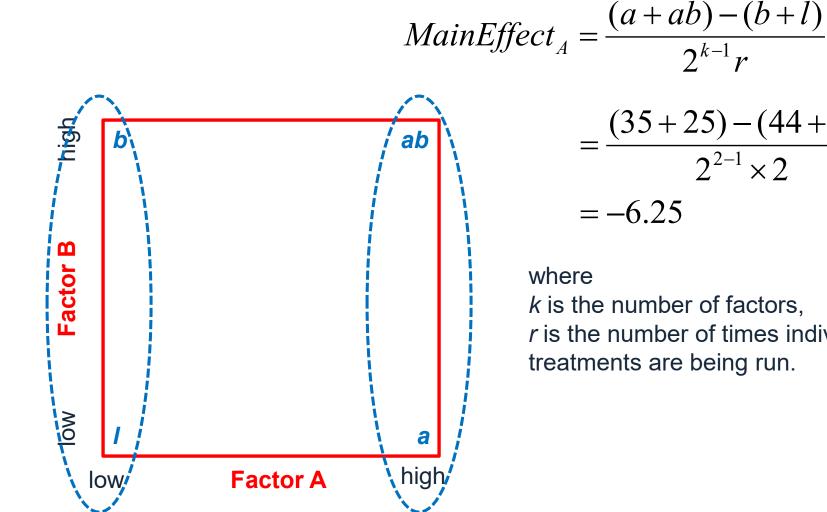

$$=\frac{(35+25)-(44+41)}{2^{2-1}\times 2}$$

k is the number of factors, r is the number of times individual treatments are being run.


• Main effect of factor B (time length of baking):

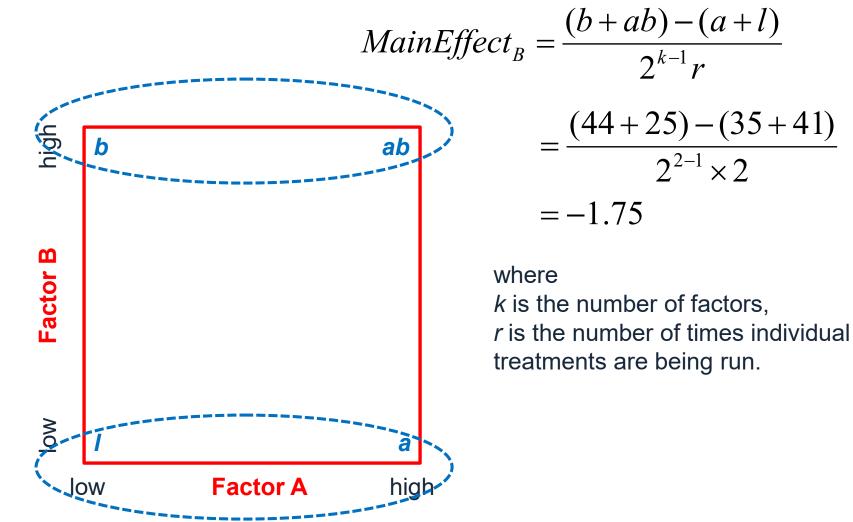

1015

 $\odot$ 

Interaction (i.e., A\*B) effect

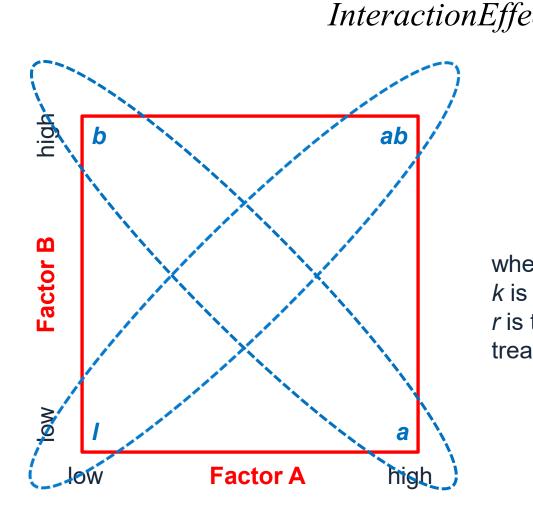

$$pct = \frac{(l+ab) - (a+b)}{2^{k-1}r}$$
$$= \frac{(41+25) - (35+44)}{2^{2-1} \times 2}$$
$$= -3.25$$

 $(l \pm ab) = (a \pm b)$ 

#### where

*k* is the number of factors, *r* is the number of times individual treatments are being run.

#### www.LeanSigmaCorporation.com

• Sum of squares of factors and interaction

$$SS_{A} = \frac{(a+ab-b-l)^{2}}{2^{k}r} = \frac{(35+25-44-41)^{2}}{2^{2}\times 2} = 78.125$$

$$SS_{B} = \frac{(b+ab-a-l)^{2}}{2^{k}r} = \frac{(44+25-35-41)^{2}}{2^{2}\times 2} = 6.125$$

$$SS_{Interaction} = \frac{(l+ab-a-b)^2}{2^k r} = \frac{(41+25-35-44)^2}{2^2 \times 2} = 21.125$$

where

*k* is the number of factors,

*r* is the number of times individual treatments are being run.



www.LeanSigmaCorporation.com

• Degrees of freedom of factors and interaction

$$df_{A} = 1$$
$$df_{B} = 1$$
$$df_{Interaction} = 1$$
$$df_{error} = 1$$

- Four degrees of freedom are required in the model because there are three independent variables (a, b, ab interaction) in the equation and one degree of freedom is required for the error:
  - $Y = \alpha 0 + \alpha 1 * A + \alpha 2 * B + \alpha 3 * A * B + Error$



1019

#### 2<sup>2</sup> Full Factorial DOE

• Mean squares of factors and interaction

$$MS_A = \frac{SS_A}{df_A} = \frac{78.125}{1} = 78.125$$

$$MS_{B} = \frac{SS_{B}}{df_{B}} = \frac{6.125}{1} = 6.125$$

$$MS_{Interaction} = \frac{SS_{Interaction}}{df_{Interaction}} = \frac{21.125}{1} = 21.125$$



- Step 1: Initiate the experiment design
  - 1. Click DOE -> Custom Design
  - A window named "DOE Custom Design" pops up. 2.
  - 3. Double-click the name box and enter "Tastiness" into the "Response Name" box.
  - Because the tastiness metric indicates how delicious the cake is. 4 we want to maximize it.
  - Click on the button "Add Factor" 5.
  - Click Categorical -> 2 Level 6.
  - Enter the factor name "Temp" in the name box 7.
  - 8. Enter the two levels' codes "Low" and "High" in the values boxes
  - 9. Repeat the same steps for the second factor "Time" with two levels "Short" and "Long"
  - 10. Click Continue



DOE - Custom Desig	n - JMP									
le Edit Tables R	ows Cols	DOE	Analyze	Graph	Tools	View	Window	Help		
Custom Desig	n									
Responses										
Add Response 💌	Remove	Number	of Respon	ses						
Response Nar	ne	Go		l	Lower Lim	nit	Upper Lim	it	Importance	
Tastiness		M	aximize							
optional item										
Factors										
Add Factor 💌 Re	move Add	N Factor	rs 1							
Name		Role		Chang	jes Va	alues				
✓ Temp		Categori		Easy	Lo	w			High	
✓ Time		Categori	ical	Easy	Lo	W			High	
Specify Factors										
					. ]					
Add a factor by clicki		Factor bu	itton. Dou	ble clic	k on a					
factor name or level t	o edit it.									
Continue										
										💁 🔲 🔻 🔡



 $\odot$ 

- Step 2: Select interaction between the two factors.
  - 1. Click on the drop down box of "Interactions"
  - 2. Select "2<sup>nd</sup>"
  - 3. The interaction variable "Temp\*Time" appears in the list of factors.



愛 DOE - Custom Design - JMP	🗖 💷 🗾 🍻 DOE - Custom Design - JMP	- 0 X
File Edit Tables Rows Cols DOE Analyze Graph Tools View Window Help	File Edit Tables Rows Cols DOE Analyze Graph Tools View Window Help	
⊿ 💌 Custom Design	Custom Design	
Responses	Responses	
⊿ Factors	⊿ Factors	
Add Factor  Remove Add N Factors 1	Add Factor  Remove Add N Factors 1	
Name Role Changes Values	Name Role Changes Values	
✓ Temp Categorical Easy Low High	→ Temp Categorical Easy Low High	
✓ Time Categorical Easy Low High	✓ Time Categorical Easy Low High	
<ul> <li>Define Factor Constraints</li> <li>Model</li> </ul>	Define Factor Constraints Model	
Main Effects Interactions  RSM Cross Powers  Remove Term	Main Effects Interactions  RSM Cross Powers  Remove Term	
Name 2nd Estimability		
Intercept	Name Estimability Intercept Necessary	
Temp 3rd Necessary	Temp Necessary	
Time 4th Necessary	Time Necessary	
5th	Temp*Time Necessary	
<ul> <li>Alias Terms</li> <li>Design Generation</li> </ul>	<ul> <li>Alias Terms</li> <li>Design Generation</li> </ul>	
		🟠 🔲 🔻 💡



1023

 $\odot$ 

- Step 3: Make the design and make the table
  - 1. Click on the "Make Design" button
  - 2. The design pattern of the experiment appears
  - 3. Keep "Randomize" in the "Run Order" box
  - 4. Click on "Make Table" button
  - 5. A table with pre-populated treatments in random run order is generated.



🔄 Custom Design - JMP								
File Edit Tables Row	s Cols DOE	Analyz	e Graph	n Tools View	Window Help			
: 🛤 🔁 💕 🛃   🐰 🗈 🛍 📙 : 🖴 🖩 🖽 🖛 🗁 📝 🖕								
▼Custom Design		_		_				
Design Custom Design		Temp	Time	Tastiness				
Criterion D Optimal	1	Low	Low	•				
Model	2	High	Low	•				
Evaluate Design	3	Low	High	•				
DOE Dialog	4	Low	High	•				
Columna (2/0)	5	Low	Low	•				
Columns (3/0)	6	High	Low	•				
∎ Temp ★ ∎ Time ★	7	High	High	•				
Tastiness 🗶	8	High	High	•				
Rows								
All rows 8								
Selected 0								
Excluded 0								
Hidden 0								
Labelled 0								
					🟠 🔲 ▼ 🔡			

 $\odot$ 

• Step 4: Run the experiment...In real life you would record the responses in the table created by JMP.

For this lesson, use the data file "DOE.jmp" with the Tastiness data already entered. If you do not use this file then you will not get the same results displayed during this lesson.

DOE - JMP				- • ×			
File Edit Tables Rows Cols DOE Analyze Graph Tools View Window							
Help	Help						
: 🛤 🐑 💕 🗔   🐰 🗈	🏝 📕 🖶 🖬		≖ ⊵				
💌 DOE 🛛 🖒							
Design Custom Design		Temperature	Time Length	Tastiness			
Criterion D Optimal	1	Low	Long	22			
Screening	2	Low	Long	22			
Model	3	High	Long	12			
DOE Dialog	4	Low	Short	20			
Columns (3/0)	5	High	Long	13			
💼 Temperature 🗚	6	High	Short	18			
📕 Time Length 🗶	7	Low	Short	21			
🚄 Tastiness 🛠	8	High	Short	17			
▼ Rows							
All rows 8							
Selected 0							
Excluded 0							
Hidden 0							
Labelled 0							
		4		•			
				🔂 🗖 🗸			



- Step 5: Analyze the experiment results
  - 1. Click Analyze -> Fit Model
  - A box named "Fit Model" pops up in which the response, the two factors and their interaction term are all pre-populated into the "Y" and "Construct Model Effects" boxes respectively
  - 3. Click on "Run" button
  - 4. The statistics of the model appear
  - 5. Analyze the model results



🏓 Fit Model - JMP	HE Calles Incar		
✓ ■ Model Specification			
Select Columns	Pick Role Variables	Personality:	Standard Least Squares 🔹
Temperature     Time Length     Tastiness	optional	Emphasis:	Effect Screening
	Weight         optional numeric           Freq         optional numeric	Help Recall	Run
	By optional	Remove	Keep dialog open
	Construct Model Effects		
	Time Length		
	Cross Temperature*Time Length		
	Nest		
	Macros Degree 2		
	Attributes 💌		
	Transform 💌		
	No Intercept		



 $\odot$ 

#### Use JMP to Run a 2k Full Factorial DOE

- Step 6: Analyze the experiment results
  - 1. Click the red triangle next to "Response Tastiness"
  - 2. Select "Regression Reports"
  - 3. Select "Summary of Fit"
  - 4. Select "Analysis of Variance"
  - 5. Now your "Summary of Fit" and "Analysis of Variance" tables appear.



## Use JMP to Run a 2k Full Factorial DOE

- High R<sup>2</sup> value shows around 98% of the variation in the response can be explained by the model.
- A p-value smaller than the alpha level (0.05) indicates that the model is statistically significant (e.g. at least one of the independent variables in the model has a coefficient statistically different from zero).

DOE - Fit L	east Squ	ares - JMP				
<ul> <li>Resport</li> </ul>	nse Tas	stiness				
		dicted Plo	ot		1	
Effect S	-					
		redicted F	lot			
	-		IOC			
Studen						
🖉 💌 Box-	Cox Tr	ansforma	itions			
4 Summa	ny of F	it				
RSquare		(	0.985965			
RSquare A			0.975439			
Root Mea			0.612372			
Mean of F			18.125			
Observation	ons (or S	um Wgts)	8			
Analysi	s of Va	riance				
		Sum of			-	
Source	DF	Squares	Mean Square	F Ratio		
Model	3	105.37500	35.1250	93.6667		
Error	4	1.50000	0.3750	Prob > F		
C. Total	7	106.87500		0.0004*		
Parame	eter Est	timates				
Effect T	ests					
Effect D	Details					
Pred	iction I	Profiler				
aluations do	one					🏠 🐺 📃



1030

 $\odot$ 

Lean Sigma Corporation

#### Use JMP to Run a 2k Full Factorial DOE


- The Parameter Estimates table shows the intercept and coefficients of independent variables in the model.
- Since p values of all the independent variables in the mode are smaller than alpha level (0.05), both factors and their interaction have statistically significant impact on the response.

DOE - Fit Least Squares - JMP						) <mark>- </mark>	٢
⊿							
Actual by Predicted Plot							
Effect Summary							
Residual by Predicted Plot							
Studentized Residuals							
Box-Cox Transformations							
Summary of Fit							
Analysis of Variance							
Parameter Estimates							
Term	Estimate	Std Error	t Ratio	Prob> t			
Intercept	18.125	0.216506	83.72	<.0001*			
Temperature[Low]	3.125	0.216506	14.43	0.0001*			
Time Length[Short]	0.875		4.04	0.0156*			
Temperature[Low]*Time Length[Short]	-1.625	0.216506	-7.51	0.0017*			
Effect Tests							
Effect Details							
Prediction Profiler							
evaluations done					<u>}</u> ₿		



## 4.4.2 Linear & Quadratic Models



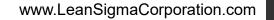

#### Linear DOE

- If we assume the relationship between the response and the factors is linear, we use a two-level design experiment in which there are two settings for individual factors.
- The linear model of a two-level design with three factors:

 $Y = \alpha_0 + \alpha_1 X_1 + \alpha_2 X_2 + \alpha_3 X_3 + \alpha_{12} X_1 X_2 + \alpha_{13} X_1 X_3$  $+ \alpha_{23} X_2 X_3 + \alpha_{123} X_1 X_2 X_3 + \varepsilon$ 

where *Y* is the response.  $X_1, X_2, X_3$  are the three two-level factors.  $\alpha_0$  is the intercept.  $\alpha_1, \alpha_2, ..., \alpha_{123}$  are the coefficients of the factors and interactions.  $\varepsilon$  is the error of the model.



#### **Quadratic DOE**

- It is possible that the relationship between the response and the factors is non-linear.
- To test the non-linear relationship between the response and the factors, we need at least a three-level design, i.e., quadratic design of experiment.
- The quadratic DOE adds the  $X_1^2$ ,  $X_2^2$ ,...,  $X_k^2$  and corresponding interactions into the model as potential significant factor of the response.



# 4.4.3 Balanced & Orthogonal Designs



www.LeanSigmaCorporation.com

#### Balanced Design

- In DOE, an experiment design is balanced if individual treatments have the same number of observations.
- In other words, if an experiment is balanced, each level of each factor is run the same number of times.
- The following design is balanced since the two factors are both run twice at each level.

Run	Treatment	Fac	tors
		Α	В
1		-1	-1
2	а	+1	-1
3	b	-1	+1
4	ab	+1	+1



#### Orthogonal Design

- In DOE, an experiment design is orthogonal if the main effect of one factor can be evaluated independently of other factors.
- In other words, for each level (high setting or low setting) of a factor, the number of high setting and low setting in any other factors must be the same.



#### Orthogonal Design

• In the following design, for the higher level (+1) of factor A, the number of "+1" in factor B is 2 but the number of "-1" in factor B is 0. Therefore, this is not an orthogonal design.

Run	Treatment	Factors		
null	freatment	Α	В	
1	- I	-1	-1	
2	а	-1	-1	
3	b	+1	+1	
4	ab	+1	+1	



1038

#### Orthogonal Design

 In the following design, for the higher level (+1) of factor A, the number of "+1" in factor B is 1 and the number of "-1" in factor B is 1 as well. Therefore, this is an orthogonal design.

	Run	Treatment	Factors	
			Α	В
	1		-1	-1
	2	а	+1	-1
	3	b	-1	+1
	4	ab	+1	+1



### Checking for an Orthogonal Design

- We can check to see if our design is orthogonal with some very simple math.
- In an orthogonal design, the sum of products for each run should equal zero.
- Let us check the earlier design that we said was orthogonal:
  - Run 1: -1 \* -1 = 1
  - Run 2: +1 \* -1 = -1
  - Run 3: -1 \* +1 = -1
  - Run 4: +1 \* +1 = 1
  - Sum = 0
  - Design is orthogonal

Run	Treatment	Factors	
NUII		Α	В
1		-1	-1
2	а	+1	-1
3	b	-1	+1
4	ab	+1	+1



www.LeanSigmaCorporation.com

#### Checking for an Orthogonal Design

- Now let us check the earlier design that we said was not orthogonal:
  - Run 1: -1 \* -1 = 1
  - Run 2: -1 \* -1 = 1
  - Run 3: +1 \* +1 = 1
  - Run 4: +1 \* +1 = 1
  - Sum = 4
  - Design is not orthogonal

Run	Treatment	Factors	
NUII		Α	В
1	- I	-1	-1
2	а	-1	-1
3	b	+1	+1
4	ab	+1	+1



# 4.4.4 Fit, Diagnosis and Center Points



www.LeanSigmaCorporation.com

#### Use JMP to Fit the Model of DOE

- If one of the factors or interactions has a p-value larger than alpha level (0.05), it indicates that the particular factor or interaction does *not* have statistically significant impact on the response.
- To fit the model better, we would need to remove the insignificant independent variables one at a time and run the model again until all the independent variables in the model are statistically significant (i.e. p-value smaller than alpha level).



1043

#### Use JMP to Diagnose the Model

- To ensure that the quality of the model is acceptable, we need to conduct the residuals analysis.
  - Residual is the difference between the actual response value and the fitted response value.
- Well-performing residuals:
  - Are normally distributed
  - Have a mean equal to zero
  - Are independent
  - Have equal variance across the fitted values.



- Step 1: Save the residuals in the data table
  - 1. Click on the red triangle button next to "Response Tastiness"
  - 2. Click "Save Columns" -> "Residuals"
  - 3. A new column of residuals would pop into the data table.

DOE - JMP		-					- O X
File Edit Tables	Row	s Cols DOE	Analyze Gr	aph Tools	View Window	Help	
🔛 🧉 💕 📕   🐰	Đ	🛝 <b></b> : 🖨 🗄		■ 🛛 📕			
DOE	$\triangleright$	<				Residual	
Design Custom Des	ign		Temperature	Time Length	Tastiness	Tastiness	
Criterion D Optin	nal	1	Low	Long	22	0	
Screening		2	Low	Long	22	0	
Model		3	High	Long	12	-0.5	
DOE Dialog		4	Low	Short	20	-0.5	
<ul> <li>Columns (4/0)</li> </ul>		5	High	Long	13	0.5	
📕 Temperature \star	*	6	High	Short	18	0.5	
📕 Time Length 🗶	Ξ	7	Low	Short	21	0.5	
Tastiness * Residual Tastiness	-	8	High	Short	17	-0.5	
Rows							
All rows	8						
Selected	0						
Excluded	0						
Hidden	0						
Labelled	0						
evaluations done							☆ 🔲 🔻



- Step 2: Check whether the mean of residuals is zero and residuals are normally distributed.
  - 1. Click Analyze -> Distribution
  - 2. Select "Residual Tastiness" as "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Residual Tastiness"
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Select "Goodness of Fit"



			DOE - Distribution of Residual Tastiness - JMP
Distribution - JMP		- <b>• ×</b>	<ul> <li>✓ ■ Distributions</li> <li>✓ ■ Residual Tastiness</li> </ul>
The distribution of values in each co	blumn		Quantiles
<ul> <li>Select Columns</li> <li>4 Columns</li> <li>Temperature</li> <li>Time Length</li> <li>Tastiness</li> <li>Residual Tastiness</li> </ul>	Cast Selected Columns into Roles Y, Columns Residual Tastiness optional Weight optional numeric	Action OK Cancel Remove	Image: Summary Statistics           Mean         0           Std Dev         0.46291           Std Err Mean         0.1636634           Upper 95% Mean         0.3870025           Lower 95% Mean         -0.387002           N         8           Image: Fitted Normal
Histograms Only	Freq optional numeric By optional	Recall Help	<ul> <li>▶ Parameter Estimates</li> <li>▲ Goodness-of-Fit Test</li> <li>Shapiro-Wilk W Test</li> <li>▶ Prob&lt;₩</li> <li>0.801503</li> <li>0.0297*</li> <li>Note: Ho = The data is from the Normal distribution. Small p-values reject Ho.</li> </ul>

 When the p-value of the normality test is greater than alpha level, the residuals are normally distributed. Here we see a low p-value but with a mean of zero. Therefore we will continue checking our residuals to see if there is any cause of concern regarding our model.


1047

 $\odot$ 

- Step 3: Check whether the residuals are independent.
  - 1. Click Analyze -> Quality & Process -> Control Chart -> IR
  - 2. Select "Residual Tastiness" as "Process"
  - 3. Click "OK"
  - 4. I-MR chart of residuals are generated.
  - 5. Click on the red triangle button next to "Individual Measurement of Residual Tastiness"
  - 6. Click Tests -> All Tests
  - 7. If no data points on the control charts fail any tests, the residuals are in control and independent of each other.
  - 8. Note: The prerequisite of plotting IR chart for residuals is that the residuals are in the time order.



www.LeanSigmaCorporation.com

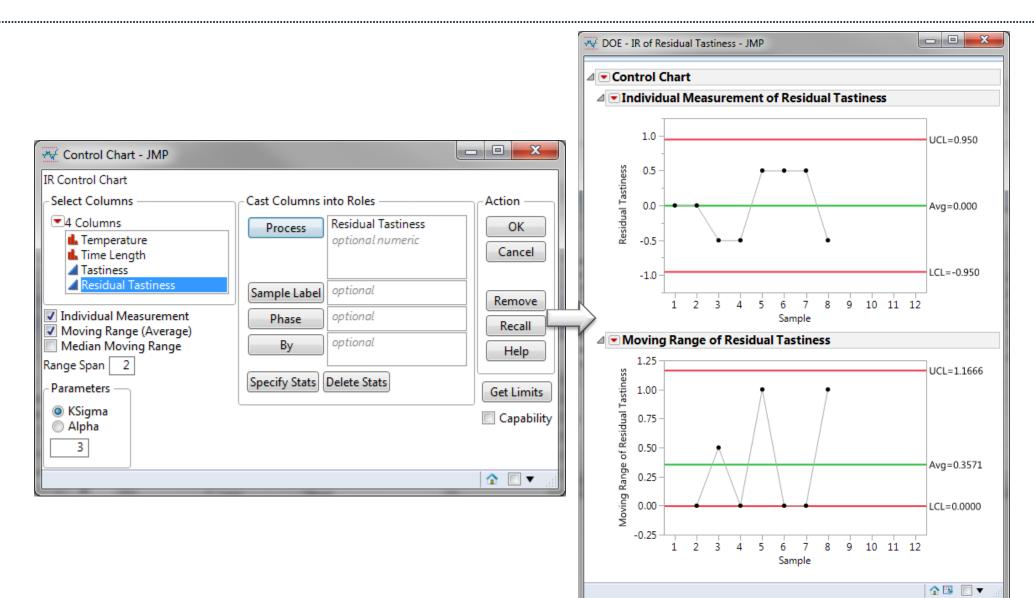


www.LeanSigmaCorporation.com

 $\bigcirc$ 


Lean Sigma Corporation

- Step 4: Check whether the residuals have equal variance across the predicted response values.
  - Within the analysis results page of fitting the DOE model is the "Residuals by Predicted Plot".
  - We look for patterns in which the residuals tend to have even variation across the entire range of the fitted response values.

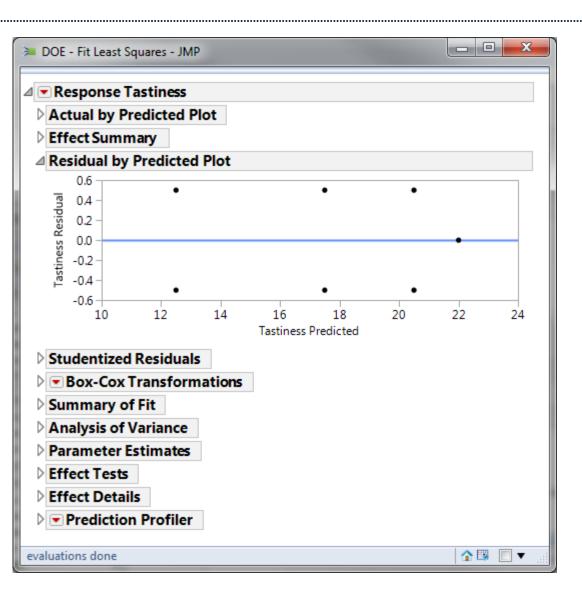



- Step 5: If the residuals are performing well, we can use the model to find the best settings of factors to maximize the tastiness of the cake.
  - 1. The "Prediction Profiler" already appears in the analysis results page

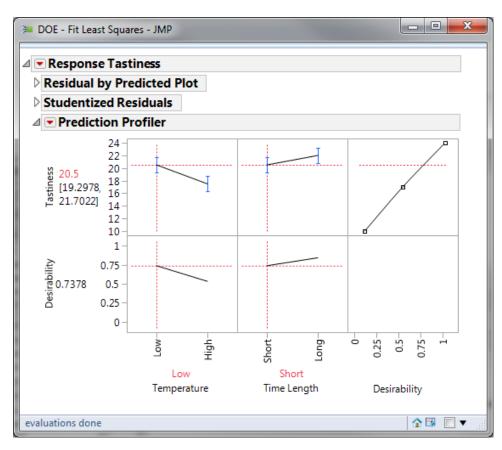




#### Center Points in DOE

- The two-level design of experiment assumes that the relationship between the response and the factors is linear.
- We can use center points to check whether the assumption is true by adding center point runs to the experiment.
- In each center point run, the factors are all set to be in the center setting (zero) between high (+1) and low (-1) settings.
  - Center points do not change the model to quadratic.
  - They allow a check for adequacy of linear model.
  - If a line connecting factor settings passes through the center of the design, the model is adequate to predict within the inference space.



## 4.5 Fractional Factorial Experiments



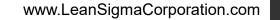

#### Black Belt Training: Improve Phase

#### 4.1 Simple Linear Regression

- 4.1.1 Correlation
- 4.1.2 X-Y Diagram
- 4.1.3 Regression Equations
- 4.1.4 Residuals Analysis

#### 4.2 Multiple Regression Analysis

4.2.1 Non-Linear Regression
4.2.2 Multiple Linear Regression
4.2.3 Confidence Intervals
4.2.4 Residuals Analysis
4.2.5 Data Transformation, Box Cox
4.2.6 Stepwise Regression
4.2.7 Logistic Regression

## 4.3 Designed Experiments4.3.1 Experiment Objectives4.3.2 Experimental Methods4.3.3 DOE Design Considerations

# 4.4 Full Factorial Experiments 4.4.1 2k Full Factorial Designs 4.4.2 Linear and Quadratic Models 4.4.3 Balanced and Orthogonal Designs 4.4.4 Fit, Model, and Center Points

#### **4.5 Fractional Factorial Experiments**

4.5.1 Designs4.5.2 Confounding Effects4.5.3 Experimental Resolution



## 4.5.1 Fractional Designs



#### What Are Fractional Factorial Experiments?

- In simple terms, a **fractional factorial experiment** is a subset of a full factorial experiment.
- Fractional factorials use fewer treatment combinations and runs.
- Fractional factorials are less able to determine effects because of fewer degrees of freedom available to evaluate higher order interactions.
- Fractional factorials can be used to screen a larger number of factors.
- Fractional factorials can also be used for optimization.



#### Why Fractional Factorial Experiments?

- To run a full factorial experiment for k factors, we need 2<sup>k</sup> unique treatments. In other words, we need resources that can afford at least 2<sup>k</sup> runs.
- With k increasing, the number of runs required in full factorial experiments rises dramatically even without any replications, and the percentage of degrees of freedom spent on the main effects decreases.
- The main effects and two-way interaction are the key effects we need to evaluate. The higher order the interaction is, the more we can ignore it.



#### Why Fractional Factorial Experiments?

Number of Factors	Number of Treatments
1	2
2	4
3	8
4	16
5	32
6	64
7	128
8	256
9	512
10	1024



 $\bigcirc$ 

- We are trying to find the cause-and-effect relationship between a response (Y) and three factors (factor A, B, and C) and their interactions (AB, BC, AC, and ABC).
  - As follows is the 2<sup>3</sup> full factorial design (2 level 3 factor).
  - There are eight treatment combinations (2 \* 2 \* 2).

Run	Treatment		Factor		2-W	ay Interac	tion	3-Way Interaction
Kull	meaument	Α	В	С	AB	BC	AC	ABC
1	I	-1	-1	-1	+1	+1	+1	-1
2	а	+1	-1	-1	-1	+1	-1	+1
3	b	-1	+1	-1	-1	-1	+1	+1
4	ab	+1	+1	-1	+1	-1	-1	-1
5	С	-1	-1	+1	+1	-1	-1	+1
6	ас	+1	-1	+1	-1	-1	+1	-1
7	bc	-1	+1	+1	-1	+1	-1	-1
8	abc	+1	+1	+1	+1	+1	+1	+1



- To perform a 2<sup>3</sup> full factorial experiment, we need to run at least eight unique treatments (2 \* 2 \* 2).
- What if we only have enough resources to run four treatments?
- As a result, we need to carefully select a subset from the eight treatments so that all of our main effects can be evaluated and the design can be kept balanced and orthogonal.



• Example of an invalid design

	Factor	
Α	В	С
-1	-1	-1
+1	-1	-1
-1	+1	-1
+1	+1	-1

Remember orthogonality?

This design is invalid because only the low setting of factor C is tested.

We cannot evaluate the main effect of factor C using this design.



• Example of an invalid design


	Factor	
Α	В	С
+1	+1	-1
+1	-1	-1
-1	+1	+1
+1	+1	+1

This design is also invalid because it is neither balanced nor orthogonal.

- Checking orthogonality: the sum of AC interaction signs should equal zero (0).
  - Run 1 (-)
  - Run 2 (-)
  - Run 3 (-)
  - Run 4 (+)



- To select the four treatments run in the 2<sup>3-1</sup> fractional factorial experiment, we start from the 2<sup>2</sup> full factorial design of experiment.
- If we replace the two-way interaction (AB) column with the factor C column, the design will be valid.

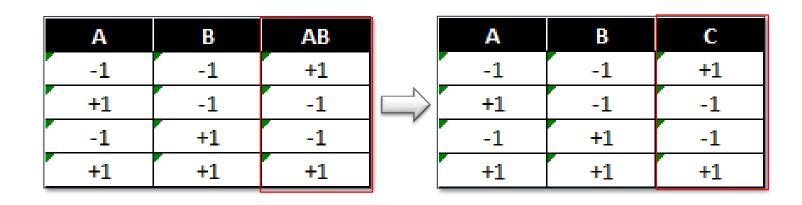



1063

- 2<sup>3-1</sup> Fractional Factorial Design Pattern
  - Three factors and four treatments

Run	Treatment		Factor		2-W	ay Interac	<b>3-Way Interaction</b>	
Kull	freatment	Α	В	С	AB	BC	AC	ABC
1	С	-1	-1	+1	+1	-1	-1	+1
2	а	+1	-1	-1	-1	+1	-1	+1
3	b	-1	+1	-1	-1	-1	+1	+1
4	abc	+1	+1	+1	+1	+1	+1	+1

- Note: We also call this kind of design a half-factorial design since we only have half of the treatments that we would have in a full factorial design.
- In 2<sup>3-1</sup> fractional factorial design of experiment, the effect of three-way interaction (ABC) is not measurable since it only has "+1".



- In the 2<sup>3-1</sup> fractional factorial design, we notice that the column of each main effect has identical "+1" and "-1" values with one two-way interaction column.
  - A and BC
  - B and AC
  - C and AB
- In this situation, we say that A is aliased with BC or A is the alias of BC.



- By multiplying any column with itself, we obtain the identity (I).
  - A \* A = I
  - The product of any column and the identity is the column itself.
  - A \* I = A
- Column ABC is called the generator.
  - By multiplying any column with the generator, we obtain its alias.
  - A \* ABC = (A\*A) \* BC = I \* BC = BC



- Step 1: Initiate the experiment design
  - 1. Click DOE -> Classical -> Screening Design
  - 2. A window named "DOE Screening Design" pops up.
  - 3. One response: Y
  - Add Three factors: A, B and C by clicking the
     "Categorical" button -> 2-Level, rename the factors A, B, and C
  - 5. Two-level design: each factor should have two settings, -1 and +1
  - 6. Click "Continue"
  - 7. Select "Choose from a list of Fractional Factorial Designs", click "Continue".
  - 8. Select "Fractional Factorial" and click "Continue"



-										-			x
Ø.	DOF - S		Design -	JWb		-							^
File	e Edit	Tables	Rows	Cols	DOE	Analyze	Graph	Tools	View	Window	Help		
⊿ 0	<ul> <li>Scre</li> </ul>	ening l	Design										
4	Resp	onses											
	Add R	esponse	- Rem	ove	Number	of Respon	ses						
	F	Response	Name		G	oal	L	ower Lin	nit	Upper Lim	it	Importance	
	Y				Ν	/laximize							
	option	al item											
4	Facto	ors											
	Contir	nuous	iscrete N	umeric	▼ Cat	egorical 🔻	Remo	ve Ado	d N Fact	ors 1			
	Nar	ne		Role			Values	5					
	L A			Categ			-1			+1 +1			
	B C			Categ Categ			- <u>1</u> -1			+1			
4		•	Modify		-								
	⊳ Cha	ange G	enerati	ng Ru	les								
	⊳ Alia	asing o	f Effect	s									
	Co	ded De	sign										
D	Desig	an Eval	uation										
4	Outp	ut Opt	ions	_									
	Run Or	-			Ran	domize		•					
	Makal		from de	tion of the		donnize							
		er of Repl	e from des icates:	agn plu	· · · ·	0							
	Make					-							
	_	_											
	Bac	ĸ											
												☆ 🗆	▼



 $\odot$ 

- Step 2: Select the number of replications, make design
  - In this case, we want each treatment to be run twice so that there are enough degrees of freedom to analyze the effects.
  - 2. Enter "1" in the box for "Number of Replicates"
  - 3. Click "Make Table" button

Fractional Factorial 2 - J File Edit Tables Row		Analyze	Graph	Tools	View	Window Help	
i 🛤 🐑 💕 🔛   🐰 🗈	a 📕 😥 🖬		<sup>y</sup> x >=	/ ]		-	
● Fractional Factorial 2 Design Fractional Factorial		Pattern	А	в	с	Y	
Screening	1	+	-1	-1	+1		•
Model	2	-+-	-1	+1	-1	•	•
Evaluate Design	3	+++	+1	+1	+1	•	•
DOE Dialog	4	+	+1	-1	-1	•	•
Columns (5/0)	5	+	+1	-1	-1	•	•
🔥 Pattern 🔎	6	-+-	-1	+1	-1	•	•
L A *	7	+	-1	-1	+1		•
<b>止</b> B ★	8	+++	+1	+1	+1		•
<b>止</b> ⊂ <b>*</b> ⊿ Y <b>*</b>							
<ul> <li>Rows</li> </ul>							
All rows 8							
Selected 0							
Excluded 0 Hidden 0							
Labelled 0							
capened 0							
		1				1	☆ 🗖 🔻



www.LeanSigmaCorporation.com

• Step 3: Implement the experiment and record the results in the table

For this lesson, use the data file "Fractional Factorial.jmp" with the 'Y' data already entered. If you do not use this file then you may not get the same results displayed during this lesson.

拱 Fractional Factorial - JM	Р						- • ×
File Edit Tables Row	s Cols DOE	Analyze	Graph	n Tools	View	Window He	elp
🚑 🍋 💕 🗔   🐰 🗈	a <b>, i</b> e ii		⊻ <u>x</u> ≽■	2			
💌 Fractional Factorial 🛛 👂							
Design Fractional Factorial		Pattern	Α	В	C	Y	
Screening	1	+	+1	-1	-1	18	
Model	2	+	-1	-1	+1	20	
DOE Dialog	3	+++	+1	+1	+1	15	
Columns (5/0)	4	+++	+1	+1	+1	15	
L Pattern @	5	-+-	-1	+1	-1	23	
<b>L</b> A <b>*</b>	6	+	+1	-1	-1	17	
🔥 В 🗱	7	-+-	-1	+1	-1	22	
🔥 C 🛪	8	+	-1	-1	+1	21	
🔺 Y 🗶							
Rows							
All rows 8							
Selected 0							
Excluded 0							
Hidden 0							
Labelled 0							
							▼



- Step 4: Fit the model using the experiment results
  - 1. Click Analyze -> Fit Model
  - 2. The Y and the Xs have been pre-populated into their boxes.
  - 3. Click "Run Model"

🇯 Fit Model - JMP	a trans		
Model Specification			
Select Columns	Pick Role Variables	Personality: Emphasis:	Standard Least Squares    Fffect Screening
B L C ∠ Y	Weight         optional numeric           Freq         optional numeric	Help	Run
	By optional Construct Model Effects	Remove	Keep dialog open
	Add A Cross C Nest		
	Macros ▼       Degree     2       Attributes     ▼		
	Transform 💌 📃 🔲 No Intercept		



- Step 5: Analyze the model results
  - 1. Click on the red triangle next to "Response Y"
  - 2. Select "Regression Reports -> "Summary or Fit"
  - 3. Select "Regression Reports -> "Analysis of Variance"
  - 4. Check whether the model is statistically significant.
  - 5. Check which factors are insignificant.
  - 6. If any independent variables are not significant, remove them one at a time and rerun the model until all the independent variables in the model are significant.




 $\odot$ 

- The p-value of factor B is greater than the alpha level (0.05), so it is not statistically significant.
- Next we need to remove factor B and re-run the model.
  - 1. Click the red triangle next to "Response Y"
  - 2. Select "Model Dialog"
  - 3. Remove Factor B from the model
  - 4. Click "Run"

Respon		late of P		1				
Actual k	•		'l0t					
Effect Su				_				
Residua	I by Pro	edicted	l Plo	t				
Student	ized Re	sidual	s					
Box-(	Cox Tra	nsforn	natio	ons				
Summa	rv of Fi	t						
RSquare		-	0.9	97757				
RSquare A	dj			50748				
Root Mear	Square I	Error	0.6	12372				
Mean of R			_	8.875				
Observatio	ns (or Su	m Wqts)		8				
Analysis	s of Var	iance						
		Sum	of					
Source	DF	Squar		lean Squ		F Ra		
Model	3	65.3750		21.7		58.1	111	
Error	4	1.5000		0.3	750	Prob		
C. Total	7	66.8750	00			0.00	09*	
Parame	ter Esti	mates						
Term	Estimat	te Std	Error	t Ratio	Pro	b> t		
Intercept	18.87	75 0.21	6506	87.18	-	0001*		
A[-1]	2.62			12.12		0003*		
B[-1]	0.12			0.58	-	5946		
C[-1]	1.12	25 0.21	.6506	5.20	0.	0065*		
Effect T	ests							
Effect D	otaile							



- The p-values of the remaining independent variables are smaller than 0.05.
- There is no need to remove any more independent variables from the model.

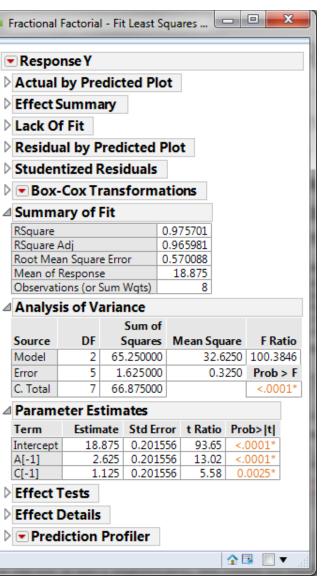



www.LeanSigmaCorporation.com

- Perform residual analysis to ensure that the residuals of the model satisfy the following criteria.
  - Mean is equal to zero.
  - Normally distributed
  - Independent
  - Equal variance across the fitted response values



- Step 6: Save residuals generated by the model
  - 1. Click on the red triangle button next to "Response Y"
  - 2. Click Save Columns -> Residuals
  - 3. A new column of residuals will appear in the data table

				-	-		View	Window He	lp	
: 🚟 🔁 🧭 🛃   🔉 🗣 🙈 📙 : 🌐 🛅 🔛 🖛 🖄 😕 🕅										
<ul> <li>Fractional Factorial</li> </ul>	Þ	۹								
Design Fractional Fact	torial	•		Pattern	Α	В	C	Y	Residual Y	
Screening			1	+	+1	-1	-1	18	0.625	
Model			2	+	-1	-1	+1	20	-0.375	
DOE Dialog			3	+++	+1	+1	+1	15	-0.125	
Columns (6/1)			4	+++	+1	+1	+1	15	-0.125	
Pattern 🚇			5	-+-	-1	+1	-1	23	0.375	
	<u> </u>		6	+	+1	-1	-1	17	-0.375	
L B *	=		7	-+-	-1	+1	-1	22	-0.625	
L C *			8	· +	-1	-1	+1	21	0.625	
🖌 Y \star	-		•	+	-1	-1	<del>+</del> 1	21	0.025	
Rows	_									
All rows	8									
Selected	1									
Excluded	0									
Hidden	0									
Labelled	0									



- Step 7: Check whether residuals are normally distributed with mean equal to zero.
  - 1. Click Analyze -> Distribution
  - 2. Select "Residual Y" in the "Y, Columns"
  - 3. Click "OK"
  - 4. Click on the red triangle button next to "Residual Y"
  - 5. Click Continuous Fit -> Normal
  - 6. Click on the red triangle button next to "Fitted Normal"
  - 7. Click "Goodness of Fit"
  - 8. If the p-value of the normality test is greater than the alpha level (0.05), the residuals are normally distributed.



Distribution - JMP								
The distribution of values in each column								
- Select Columns	Cast Selected	Columns into Roles -	Action					
Columns 6 Columns	Y, Columns	Aresidual Y	ОК					
Pattern		optional	Cancel					
d.A d.B								
LC.	Mainht	optional numeric	Remove					
Y	Weight	· ·						
Residual Y	Freq	optional numeric	Recall					
Histograms Only	Ву	optional	Help					
instograms only								

Fractional Factorial - Distribution of Residual Y - JMP										
Distributions										
🖉 💌 Residual Y										
Þ	Quantiles									
Summary Statistics										
✓ Fitted Normal										
⊿ Parameter Estimates										
	Туре	Parameter	Estimate	Lower 95%	Upper 95%					
	Location	μ	0	-0.402805	0.402805					
	Dispersion	σ	0.4818121	0.3185617	0.9806186					
-2log(Likelihood) = 10.0197978650859										
⊿ Goodness-of-Fit Test										
Shapiro-Wilk W Test										
	v v	V Prob <w< th=""><th>1</th><th></th><th></th><th></th></w<>	1							
	0.89201	4 0.2443								
Note: Ho = The data is from the Normal distribution. Small p-values reject Ho.										
					🏠 🖾 🖉	▼				



 $\odot$ 

Lean Sigma Corporation

Lean Six Sigma Training - JMP

- Step 8: Check if the residuals are independent.
  - 1. Click Analyze -> Quality & Process -> Control Chart -> IR
  - 2. Select "Residual Y" as "Process"
  - 3. Click "OK"
  - 4. I-MR chart of residuals are generated.
  - 5. Click on the red triangle button next to "Individual Measurement of Residual Tastiness"
  - 6. Click Tests -> All Tests
  - 7. If no data points on the control charts fail any tests, the residuals are in control and independent of each other.
  - 8. Note: The prerequisite of plotting an IR chart for residuals is that the residuals are in time order.



www.LeanSigmaCorporation.com





www.LeanSigmaCorporation.com


1080

 $\bigcirc$ 

Lean Sigma Corporation

## Use JMP to Run a Fractional Factorial Experiment

- Step 9: Check whether the residuals have equal variance across the predicted response values.
  - Within the analysis results page of fitting the DOE model is the "Residual by Predicted Plot.
  - We look for patterns in which the residuals tend to have even variation across the entire range of the fitted response values.

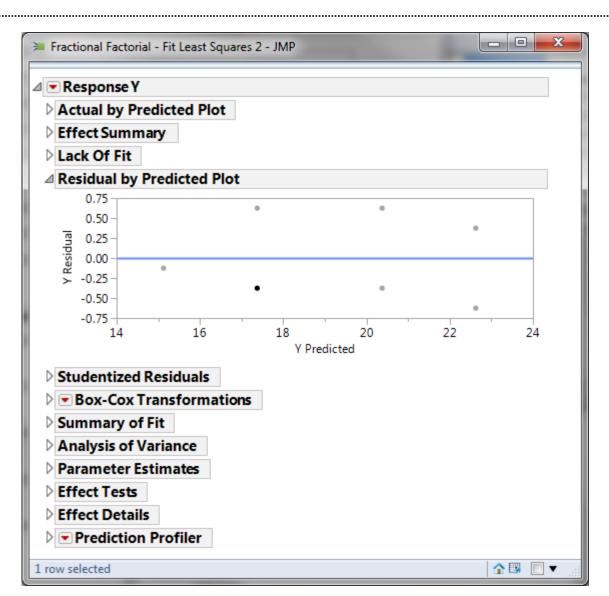



 $\bigcirc$ 

# 4.5.2 Confounding Effects



## **Confounding Effects**

- In full factorial experiments the effects of every factor and their interactions can be calculated because there is a degree of freedom for every treatment combination as well as the error term.
- Fractional factorial experiments, however, are designed with fewer runs or treatment combinations but will have the same number of input factors.
- As a result, the experimenter must understand the impact of these consequences.
- **Confounding** (or aliased factors) is that consequence.
- **Resolution** is a quantification or degree of confounding.

#### **Confounding Effects**



- When two input factors are aliases of each other, the effects they each have on the response cannot be separated.
  - In the 2<sup>3-1</sup> fractional factorial design, A and BC are aliases.
  - The main effect that A has on the response would be exactly the same as the interaction effect of BC. We cannot tell which one is truly significant.
- The effects of aliased factors are what is referred to as confounded.
- Due to the confounding nature of aliased factors, the effect we observe is the mixed effect of aliased factors.
  - A + BC
  - B + AC
  - C + AB



#### Resolution

- Resolution is the measure or degree of confounding.
- Higher resolution means less confounding or merely confounding main effects with higher order interactions.
- The resolution of a fractional factorial experiment will always be one number higher than the order of interactions that are confounded with main effects.
- **Resolution III**: Main effects are confounded with two-way interactions. If you are only interested in main effects, then resolution III is acceptable. Otherwise, resolution III is typically undesirable.
- Resolution IV: Main effect are confounded with three-way interactions.
- **Resolution V**: Main effects are confounded with four-way interactions.



#### **Consequences of Fractional Factorials**

- Benefits:
  - The primary benefits of properly designed fractional factorial experiments are achieved because of fewer runs.
  - You may have limited time, resources, or capital and cannot run a full factorial.
- Disadvantages:
  - Confounding (a.k.a. aliasing)
- Mitigation Option
  - **Replications**: by adding replicates you can introduce more study runs and increase the resolution of your experiment.
  - Replications, however, will also increase the number of trials or runs sometimes, defeating the purpose of running a fractional factorial experiment.



# 4.5.3 Experimental Resolution



#### Alias in 2<sup>3-1</sup> Fractional Factorial Experiment

- In the 2<sup>3-1</sup> fractional factorial design of experiment, the main factor is aliased or confounded with two-way interactions.
  - A is the alias of BC.
  - B is the alias of AC.
  - C is the alias of AB.



#### Alias in 2<sup>4-1</sup> Fractional Factorial Experiment

- In the 2<sup>4-1</sup> fractional factorial design of experiment, the main factor is aliased with three-way interaction and two-way interaction is aliased with two-way interaction.
  - A is the alias of BCD.
  - B is the alias of ACD.
  - C is the alias of ABD.
  - D is the alias of ABC.
  - AB is the alias of CD.
  - AC is the alias of BD.
  - AD is the alias of BC.



#### **Design Resolution**

- Design resolution (i.e., experimental resolution) refers to the confounding patterns indicating how the effects are confounded with others.
- If two factors are aliases, they have confounded effect on the response. There is no need to consider both factors in the model due to the redundancy. Only one factor needs to be included in the model for simplicity.
- Most popular resolutions are resolution III, IV, and V.
  - Resolution III: Main effects are aliased with two-way interactions.
  - Resolution IV: Main effects are aliased with three-way interactions. Twoway interactions are aliased with other two-way interactions.
  - Resolution V: Main effects are aliased with four-way interactions. Two-way
    interactions are aliased with three-way interactions.



#### **Determine Aliases**

- To find the alias of a particular factor, we only need to multiply the factor of interest with the identity (I) of the design.
  - In 2<sup>3-1</sup> fractional factorial design, ABC is the identity. To find the alias of factor A, we use A \* ABC = BC.
  - In 2<sup>4-1</sup> fractional factorial design, ABCD is the identity. To find the alias of factor A, we use A \* ABCD = BCD.
  - In 2<sup>5-1</sup> fractional factorial design, ABCDE is the identity. To find the alias of factor A, we use A \* ABCDE = BCDE.



## **5.0 Control Phase**



#### Black Belt Training: Control Phase

#### 5.1 Lean Controls

- 5.1.1 Control Methods for 5S
- 5.1.2 Kanban
- 5.1.3 Poka-Yoke (Mistake Proofing)

#### **5.2 Statistical Process Control (SPC)**

- 5.2.1 Data Collection for SPC
- 5.2.2 I-MR Chart
- 5.2.3 Xbar-R Chart
- 5.2.4 U Chart
- 5.2.5 P Chart
- 5.2.6 NP Chart

5.2.7 X-S chart
5.2.8 CumSum Chart
5.2.9 EWMA Chart
5.2.10 Control Methods
5.2.11 Control Chart Anatomy
5.2.12 Subgroups, Variation, Sampling

#### 5.3 Six Sigma Control Plans

5.3.1 Cost Benefit Analysis5.3.2 Elements of the Control Plan5.3.3 Elements of the Response Plan



# 5.1 Lean Controls



#### Black Belt Training: Control Phase

#### 5.1 Lean Controls

- 5.1.1 Control Methods for 5S
- 5.1.2 Kanban
- 5.1.3 Poka-Yoke (Mistake Proofing)
- **5.2 Statistical Process Control (SPC)** 
  - 5.2.1 Data Collection for SPC
  - 5.2.2 I-MR Chart
  - 5.2.3 Xbar-R Chart
  - 5.2.4 U Chart
  - 5.2.5 P Chart
  - 5.2.6 NP Chart

5.2.7 X-S chart
5.2.8 CumSum Chart
5.2.9 EWMA Chart
5.2.10 Control Methods
5.2.11 Control Chart Anatomy
5.2.12 Subgroups, Variation, Sampling

5.3 Six Sigma Control Plans
5.3.1 Cost Benefit Analysis
5.3.2 Elements of the Control Plan
5.3.3 Elements of the Response Plan



# 5.1.1 Control Methods for 5S



1096

#### What is 5S?

- 5S is a systematic method to organize, order, clean, and standardize a workplace...and keep it that way!
  - 5S is a methodology of organizing and improving the work environment.
- 5S is summarized in five Japanese words, all starting with the letter S:
  - Seiri (sorting)
  - Seiton (straightening)
  - Seiso (shining)
  - Seiketsu (standardizing)
  - Shisuke (sustaining).
- 5S was originally developed in Japan, and is widely used to optimize the workplace to increase productivity and efficiency.



#### 5S Goals

- Reduced waste
- Reduced cost
- Establish a work environment that is:
  - self-explaining
  - self-ordering
  - self-regulating
  - self improving.
  - Where there is/are **no more**:
    - Wandering and/or searching
    - Waiting or delays
    - Secrets hiding spots for tools
    - Obstacles or detours
    - Extra pieces, parts, materials, etc.
    - Injuries





( 1098

Lean Six Sigma Training - JMP

#### **5S Benefits**

- Reduced changeovers
- Reduced defects
- Reduced waste
- Reduced delays
- Reduced injuries
- Reduced breakdowns
- Reduced complaints
- Reduced red ink
- Higher quality
- Lower costs
- Safer work environment
- Greater associate and equipment capacity



 $\odot$ 


#### 5S Systems Reported Results

<ul> <li>Cut in floor space:</li> </ul>	60%
<ul> <li>Cut in flow distance:</li> </ul>	80%
<ul> <li>Cut in accidents:</li> </ul>	70%
<ul> <li>Cut in rack storage:</li> </ul>	68%
<ul> <li>Cut in number of forklifts:</li> </ul>	45%
<ul> <li>Cut in machine changeover time:</li> </ul>	62%
<ul> <li>Cut in annual physical inventory time:</li> </ul>	50%
<ul> <li>Cut in classroom training requirements:</li> </ul>	55%
<ul> <li>Cut in nonconformance in assembly:</li> </ul>	96%
<ul> <li>Increase in test yields:</li> </ul>	50%
<ul> <li>Late deliveries:</li> </ul>	0%
<ul> <li>Increase in throughput:</li> </ul>	15%



1100

## Sorting (Seiri)

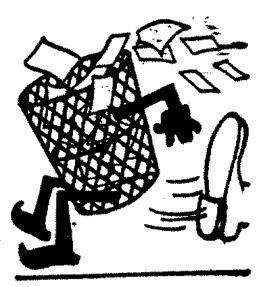

- Go through all tools, parts, equipment, supply, and materials in the workplace.
- Categorize into two major groups: needed and unneeded.
- Eliminate unneeded items from the workplace. Dispose of or recycle those items.
- Keep need items and sort in order of priority. When in doubt...throw it out!



## Straightening (Seiton)



- Straightening in 5S is also called setting in order.
  - · Label each needed item.
  - Store items at their best locations so that the workers can find them easily whenever they needed any item.
  - Reduce the motion and time required to locate and obtain any item whenever it is needed.
  - Promote an efficient work flow path.
  - Use visual aids like the tool board image on this page.



## Shining (Seiso)

- Shining in 5S is also called sweeping.
- Clean the workplace thoroughly.
- Maintain the tidiness of the workplace.
- Make sure every item is located at the specific location where it should be.
- Create the ownership in the team to keep the work area clean and organized.





#### Standardizing (Seiketsu)

- Standardize the workstation and the layout of tools, equipment, and parts.
- Create identical workstations with a consistent way of storing the items at their specific locations so that workers can be moved around to any workstation any time and perform the same task.



#### Sustaining (Shisuke)

- Sustaining in 5S is also called self-discipline.
- Create the culture in the team to follow the first four S's consistently.
- Avoid falling back to the old ways of cluttered and unorganized work environment.
- Keep the momentum of optimizing the workplace.
- Promote innovations of workplace improvement.
- Sustain the first fours S's using:
  - 5S Maps
  - 5S Schedules
  - 5S Job cycle charts
  - Integration of regular work duties
  - 5S Blitz schedules
  - Daily workplace scans.



#### Simplified Summary of 5S

- Sort "when in doubt, move it out."
- Set in Order Organize all necessary tools, parts, and components of production. Use visual ordering techniques wherever possible.
- Shine Clean machines and/or work areas. Set regular cleaning schedules and responsibilities.
- **Standardize** Solidify previous three steps, make 5S a regular part of the work environment and everyday life.
- **Sustain** Audit, manage, and comply with established five-s guidelines for your business or facility





5.1.2 Kanban

#### www.LeanSigmaCorporation.com

#### What is Kanban?

- The Japanese word "Kanban" means "signboard."
- Kanban system is a "pull" production scheduling system to determine when to produce, what to produce, and how much to produce based on the demand.
- It was originally developed by Taiichi Ohno in order to reduce the waste in inventory and increase the speed of responding to the immediate demand.



#### Kanban System

- Kanban system is a demand-driven system.
- The customer demand is the signal to trigger or pull the production.
- Products are made only to meet the immediate demand. When there is no demand, there is no production.
- It is designed to minimize the in-process inventory and to have the right material with the right amount at the right location at the right time.



#### Kanban System

- Principles of the Kanban System:
  - Only produce products with exactly the same amount that customers consume.
  - Only produce products when customers consume.
- The production is driven by the actual demand from the customer side instead of the forecasted demand planned by the staff.



#### Kanban Card

- The Kanban card is the ticket or signal to authorize the production or movement of materials. It is the message of asking for more.
- It is sent from the end customer up to the chain of production.
- Upon receiving of a Kanban card, the production station would start to produce goods.
- The Kanban card can be a physical card or an electronic signal.



#### Kanban System Example

- The simplest example of a Kanban system is the supermarket operation.
- Customers visit the supermarkets and buy what they need.
- The checkout scanners send electronic Kanban cards to the local warehouse asking for more when the items are sold to customers.
- When the warehouse receives the Kanban cards, it starts to replenish the exact goods being sold.
- It the warehouse prepares more than what Kanban cards require, the goods would become obsolete. If it prepares less, the supermarket would not have the goods available when customers need them.



#### Kanban System Benefits

- Minimize in-process inventory
- Free up space occupied by unnecessary inventory
- Prevent overproduction
- Improve responsiveness to dynamic demand
- Avoid the risk of inaccurate demand forecast
- Streamline the production flow
- Visualize the work flow.





#### What is Poka-Yoke?

- The Japanese term "poka-yoke" means "mistake-proofing."
- It is a mechanism to eliminate defects as early as possible in the process.
- It was originally developed by Shigeo Shingo and was initially called "baka-yoke" (fool-proofing).



## Two Types of Poka-Yoke

- Prevention
  - Preventing defects from occurring
  - Removing the possibility that an error could occur
  - Making the occurrence of an error impossible.
- Detection
  - Detecting defects once they occur
  - Highlighting defects to draw workers' attention immediately
  - Correcting defects so that they would not reach the next stage.



#### Three Methods of Poka-Yoke

- Contact Method
  - Use of shape, color, size, or any other physical attributes of the items.
- Constant Number Method
  - Use of a fixed number to make sure a certain number of motions are completed.
- Sequence Method
  - Use of a checklist to make sure all the prescribed process steps are followed in the right order.



#### **Poka-Yoke Devices**

- We are surrounded by poka-yoke devices daily.
  - Prevention Devices
    - Example: the dishwasher does not start to run when the door is open.
  - Detection Devices
    - Example: the car starts to beep when the passengers do not buckle their seatbelts.
- Poka-yoke devices can be in any format that can quickly and effectively prevent or detect mistakes.
  - Visual, electrical, mechanical, procedural, human etc.





#### Steps to Apply Poka-Yoke

- Step 1: Identify the process steps in need of mistake proofing.
- Step 2: Use the 5-why's method to analyze the possible mistakes or failures for the process step.
- Step 3: Determine the type of poka-yoke: prevention or detection.
- Step 4: Determine the method of poka-yoke: contact, constant number, or sequence.
- Step 5: Pilot the poka-yoke approach and make any adjustments if needed.
- Step 6: Implement poka-yoke in the operating process and maintain the performance.



# **5.2 Statistical Process Control**



#### Black Belt Training: Control Phase

#### **5.1 Lean Controls**

- 5.1.1 Control Methods for 5S
- 5.1.2 Kanban
- 5.1.3 Poka-Yoke (Mistake Proofing)

#### **5.2 Statistical Process Control (SPC)**

- 5.2.1 Data Collection for SPC
- 5.2.2 I-MR Chart
- 5.2.3 Xbar-R Chart
- 5.2.4 U Chart
- 5.2.5 P Chart
- 5.2.6 NP Chart

5.2.7 X-S chart
5.2.8 CumSum Chart
5.2.9 EWMA Chart
5.2.10 Control Methods
5.2.11 Control Chart Anatomy
5.2.12 Subgroups, Variation, Sampling

5.3 Six Sigma Control Plans
5.3.1 Cost Benefit Analysis
5.3.2 Elements of the Control Plan
5.3.3 Elements of the Response Plan



# © Lean Sigma Corporation Lean Six Sigma Training - JMP



5.2.1 Data Collection for SPC

www.LeanSigmaCorporation.com

1122

#### What is SPC?

- Statistical process control (SPC) is a statistical method to monitor the performance of a process using control charts in order to keep the process in statistical control.
- Statistical process control can be used to distinguish between special cause variation and common cause variation in the process.
- It presents the voice of the process.



#### **Common Cause Variation**

- Common cause variation (also called chance variation) is the inherent natural variation in any processes.
- It is the random background noise, which cannot be controlled or eliminated from the process.
- Its presence in the process is expected and acceptable due to its relatively small influence on the process.



#### **Special Cause Variation**

- **Special cause variation** (also called assignable cause variation) is the unnatural variation in the process.
- It is the cause of process instability and leads to defects of the products or services.
- It is the signal of unanticipated change (either positive or negative) in the process.
- It is possible to eliminate the special cause variation from the process.



#### **Process Stability**

- A process is **stable** when:
  - There is not any special cause variation involved in the process
  - The process is in statistical control
  - The future performance of the process is predictable within certain limits
  - The changes happening in the process are all due to random inherent variation
  - There are not any trends, unnatural patterns, and outliers in the control chart of the process.



#### **SPC Benefits**

- Statistical process control can be used in different phases of Six Sigma projects to:
  - Understand the stability of a process
  - Detect the special cause variation in the process
  - Identify the statistical difference between two phases
  - Eliminate or apply the unnatural change in the process
  - Improve the quality and productivity.




#### **Control Charts**

- **Control charts** are graphical tools to present and analyze the process performance in statistical process control.
- Control charts are used to detect special cause variation and determine whether the process is in statistical control (stable).
- Variation solutions:
  - Minimize the common cause variation
  - Eliminate the special cause variation when it leads to unanticipated negative changes in the outcome
  - Implement the special cause variation when it leads to unanticipated positive changes in the outcome.



#### **Control Charts Elements**

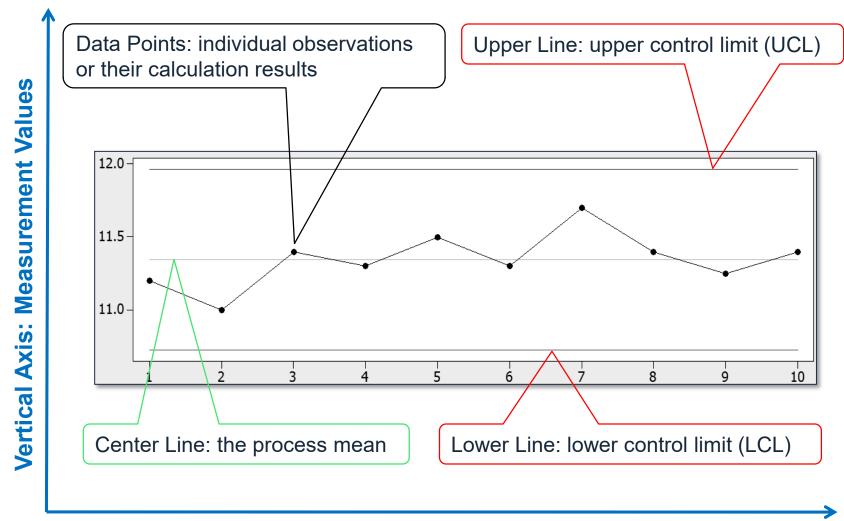

1129

 $\odot$ 



Horizontal axis: Time

#### **Control Charts Elements**

- Control charts can work for both continuous data and discrete or count data.
- Control limits are approximately three sigma away from the process mean.
- A process is in statistical control when all the data points on the control charts fall within the control limits and have random patterns only.
- Otherwise, the process is out of control and we need to investigate the special cause variation in the process.



#### Possible Errors in SPC

• There are two types of possible errors in interpreting controls charts.

		Interpretation	
		Common	Special Cause
		Cause	Variation
Truth	Common Cause Variation		Type I Error (False Positive)
	Special Cause Variation	Type II Error (False Negative)	



#### Possible Errors in SPC

- It is similar to the way of defining the type I and type II errors in hypothesis testing.
- Control charts can be interpreted as a way of testing the hypothesis about the process stability.
  - Null Hypothesis (H<sub>0</sub>): The process is stable (i.e., in statistical control).
  - Alternative Hypothesis (H<sub>A</sub>): The process is unstable (i.e., out of statistical control).



#### Possible Errors in SPC

- Type I Error
  - False positive
  - False alarm
  - Considering true common cause variation as special cause variation
  - Type I errors waste resources spent on investigation.
- Type II Error
  - False negative
  - Miss
  - Considering true special cause variation as common cause variation
  - Type II errors neglect the need to investigate critical changes in the process.



#### **Data Collection Considerations**

- To collect data for plotting control charts, we need to consider:
  - What is the measurement of interest?
  - Are the data discrete or continuous?
  - How many samples do we need?
  - How often do we sample?
  - Where do we sample?
  - What is the sampling strategy?
  - Do we use the raw data collected or transfer them to percentages, proportions, rates, etc.?



## Subgroups and Rational Subgrouping

- When sampling, we randomly select a group of items (i.e., a subgroup) from the population of interest.
- The *subgroup size* is the count of samples in a subgroup. It can be constant or variable.
- Depending on the subgroup sizes, we select different control charts accordingly.
- Rational subgrouping is the basic sampling scheme in SPC.
- The goal of rational subgrouping is to maximize the likelihood of detecting special cause variation. In other words, the control limits should only reflect the variation between subgroups.
- The number of subgroups, subgroup size, and frequency of sampling have great impact on the quality of control charts.



#### Impact of Variation

- The rational subgrouping strategy is designed to minimize the opportunity of having special cause variation *within* subgroups.
- If there is only random variation (background noise) within subgroups, all the special cause variation would be reflected between subgroups. It is easier to detect an out-of-control situation.
- Random variation is inherent and indelible in the process. We are more interested in identifying and taking actions on special cause variation.



#### Frequency of Sampling

- The frequency of sampling in SPC depends on whether we have sufficient data to signal the changes in a process with reasonable time and costs.
- The more frequently we sample, the higher costs it may trigger.
- We need the subject matter experts' knowledge on the nature and characteristics of the process to make good decisions on sampling frequency.







#### I-MR Chart


- The **I-MR chart** (also called individual-moving range chart or IR chart) is a popular control chart for continuous data with subgroup size equal to one.
- The I chart plots an individual observation as a data point.
- The MR chart plots the absolute value of the difference between two consecutive observations in individual charts as a data point.
- If there are *n* data points in the I chart, there are *n* −1 data points in and MR chart with a moving range of 2.
- The I chart is valid only if the MR chart is in control.



• The underlying distribution of the I-MR chart is normal distribution.

## I Chart Equations

- I Chart (Individuals Chart)
  - Data Point:  $X_i$
  - Center Line:  $\sum_{i=1}^{n} x_i$

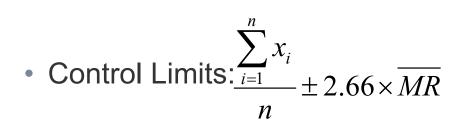

where *n* is the number of observations



 $\odot$ 

#### **MR-Chart Equations**

- MR Chart (Moving Range Chart)
  - Data Point:  $\left| x_{i+1} x_{i} \right|$

• Center Line: 
$$\frac{\Sigma |x_{i+1} - x_i|}{n-1}$$

• Upper Control Limit: 
$$3.267 \times \frac{\Sigma |x_{i+1} - x_i|}{n-1}$$


• Lower Control Limit: 0

where *n* is the number of observations



#### Use JMP to Plot I-MR Charts


- Use JMP to plot an I-MR chart
- Data File: "IR.jmp"
  - 1. Click: Analyze -> Quality & Process -> Control Chart -> IR
  - 2. Select "Measurement" as "Process"
  - 3. Click "OK"
  - 4. Click the red triangle next to "Individual Measurement of Measurement"
  - 5. Select "Tests" -> "All Tests"

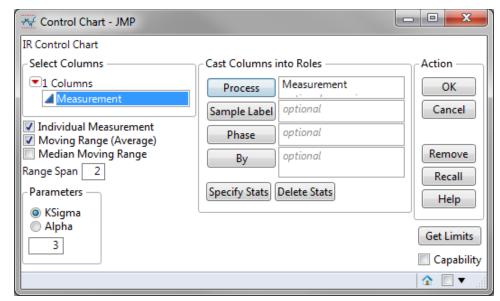



## I-MR Charts Diagnosis

- I Chart (Individuals Chart):
  - Since the MR Chart is out of control, The 'I' chart is invalid. This is because the control limits on the 'I' chart are calculated using the mean of the Moving Range. If the moving range chart is out of control then the control limits on the 'I'chart can't be trusted.
- MR Chart (Moving Range Chart):
  - Two data points fall beyond the upper control limit. It indicates the MR chart is out of control (i.e. the variations between every two contiguous individual samples are not stable over time). We need to further investigate the process, identify the root causes which trigger the outliers, and correct or apply the root causes to bring the process back to control.

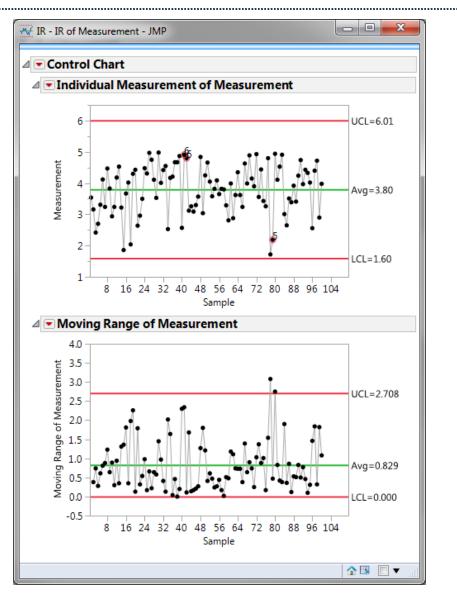



www.LeanSigmaCorporation.com

1144

# 5.2.3 Xbar-R Chart



1145

#### **Xbar-R Chart**

- The **Xbar-R** chart is a control chart for continuous data with a constant subgroup size between two and ten.
- The Xbar chart plots the average of a subgroup as a data point.
- The R chart plots the difference between the highest and lowest values within a subgroup as a data point.
- The Xbar chart monitors the process mean and the R chart monitors the variation within subgroups.
- The Xbar is valid only if the R chart is in control.
- The underlying distribution of the Xbar-R chart is normal distribution.

• Xbar chart

• Data Point: 
$$\overline{X_i} = \frac{\sum_{j=1}^m x_{ij}}{m}$$

• Center Line: 
$$\overline{\overline{X}} = \frac{\sum_{i=1}^{k} \overline{X}_{i}}{k}$$

• Control Limits  $\overline{\overline{X}} \pm A_2 \overline{R}$ 



where *m* is the subgroup size and *k* is the number of subgroups.  $A_2$  is a constant depending on the subgroup size.

#### **R** Chart Equations

- R chart (Rage Chart)
  - Data Point:  $R_i = Max_{ij}(x_{ij}) Min_{j \in [1,m]}(x_{ij})$

k

• Center Line: 
$$\overline{R} = \frac{\sum_{i=1}^{n} R_i}{k}$$

- Upper Control Limit:  $D_4 \times \overline{R}$
- Lower Control Limit:  $D_3 \times \overline{R}$

where *m* is the subgroup size and *k* is the number of subgroups.  $D_3$  and  $D_4$  are constants depending on the subgroup size.



#### Use JMP to Plot Xbar-R Charts


- Data File: "XbarR.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> Xbar
  - 2. Select Measurement in Process
  - 3. Select Subgroup ID in Sample Label
  - 4. Be sure the check Xbar and R check boxes
  - 5. Click OK

😽 Control Chart - JMP						
XBar Control Chart						
Select Columns	Cast Columns into Roles		Action			
2 Columns Measurement	Process	Measurement optional numeric	ОК			
<b>subgroup ID</b>	Sample Label	📕 Subgroup ID	Cancel			
XBar	Phase	optional	Remove			
Š	Ву	optional	Recall			
Parameters —	Sample Size Sample Grouped by Sample Label Sample Size Constant Specify Stats Delete Stats		Help			
<ul> <li>● KSigma</li> <li>● Alpha</li> <li>3</li> </ul>			Get Limits Capability			
			☆ 🗖 🔻 🖽			



#### **Xbar-R Charts Diagnosis**

- Xbar-R Charts:
  - Since the R Chart is in control, the Xbar chart is valid.
  - In both charts, there aren't any data points failing tests for special cause (i.e. all the data points fall between the control limits and spread around the center line with a random pattern).
  - We conclude that the process is in control.

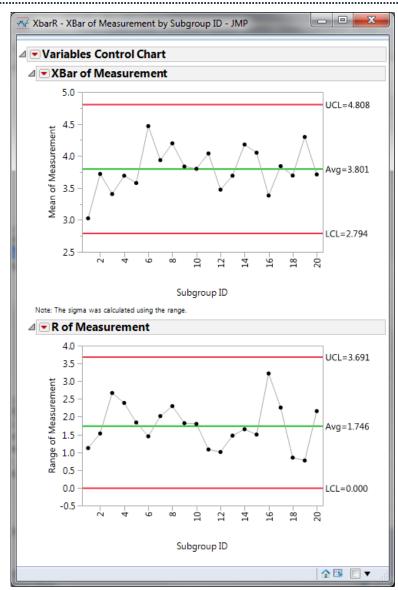



www.LeanSigmaCorporation.com

# 5.2.4 U Chart





#### Defect vs. Defective

- A **defect** of a unit is the unit's characteristic that does not meet the customers' requirements.
- A defective is a unit that is not acceptable to the customers.
- One defective might have multiple defects.
- One unit might have multiple defects but be still usable to the customers.



#### **U** Chart

- The **U chart** is a control chart monitoring the average defects per unit.
- The U chart plots the count of defects per unit of a subgroup as a data point.
- It considers the situation when the subgroup size of inspected units for which the defects would be counted is not constant.
- The underlying distribution of the U chart is Poisson distribution.



• U chart

• Data Point: 
$$u_i = \frac{x_i}{n_i}$$
  
• Center Line:  $\overline{u} = \frac{\sum_{i=1}^k u_i}{k}$ 

• Control Limits: 
$$\overline{u} \pm 3 \times \sqrt{\frac{\overline{u}}{n_i}}$$

where  $n_i$  is the subgroup size for the i<sup>th</sup> subgroup; *k* is the number of subgroups;  $x_i$  is the number of defects in the i<sup>th</sup> subgroup.



1153

 $\odot$ 

## Use JMP to Plot a U Chart

- Data File: "U.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> U
  - 2. Select Count of Defects in Process
  - 3. Select Count of Units Inspected in Unit Size
  - 4. Click Ok


😽 Control Chart - JMP			
U Control Chart			
- Select Columns	Cast Columns i	into Roles	Action
Columns	Process	Count of Defects	ОК
Day		optional numeric	Cancel
Count of Defects			
Count of Units Inspected	Sample Label	optional	
Parameters —	Phase	optional	Remove
Sigma	Ву	optional	Recall
🔘 Alpha			Help
3	Unit Size	Count of Units Inspected	
	Constant Size:		Get Limits
	Specify Stats	Delete Stats	Capability
	[		



1154

## U Chart Diagnosis

- U Chart:
  - Since the sample sizes are not constant over time, the control limits are adjusted to different values accordingly.
  - The 5<sup>th</sup> data point falls beyond the upper control limit. We conclude that the process is out of control.
  - Further investigation is needed to determine the special causes which triggered the unnatural pattern of the process.

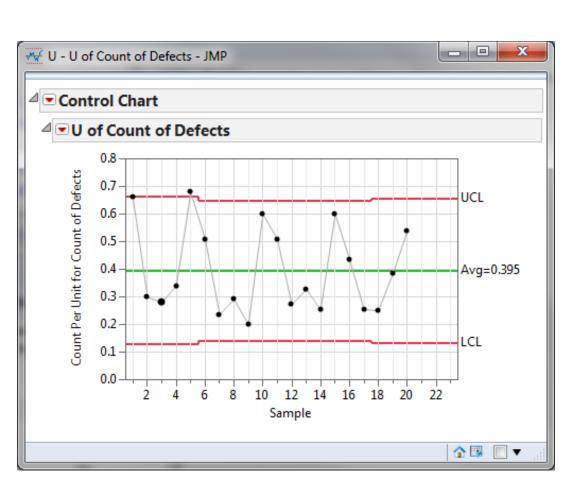





5.2.5 P Chart



www.LeanSigmaCorporation.com

1156 )

#### P Chart

- The **P chart** is a control chart monitoring the percentages of defectives.
- The P chart plots the percentage of defectives in one subgroup as a data point.
- It considers the situation when the subgroup size of inspected units is not constant.
- The underlying distribution of the P chart is binomial distribution.



• P chart

• Data Point: 
$$p_i = \frac{x_i}{n_i}$$
  
• Center Line:  $\overline{p} = \frac{\sum_{i=1}^k x_i}{\sum_{i=1}^k n_i}$ 

• Control Limits: 
$$\overline{p} \pm 3\sqrt{\frac{\overline{p}(1-\overline{p})}{n_i}}$$

where  $n_i$  is the subgroup size for the i<sup>th</sup> subgroup; *k* is the number of subgroups;  $x_i$  is the number of defectives in the i<sup>th</sup> subgroup.



 $\odot$ 

## Use JMP to Plot a P Chart


- Data File: "P.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> P
  - 2. Select Fail in the Process Field
  - 3. Select N in the Sample Size Field
  - 4. Click Ok

Control Chart - JMP	-		. <b>D X</b>
P Control Chart			
- Select Columns	Cast Columns i	nto Roles	Action
<ul> <li>4 Columns</li> <li>Day</li> <li>Fail</li> <li>Pass</li> </ul>	Process	Fail optional numeric	OK Cancel
	Sample Label	optional	Remove
- Parameters	Phase	optional	Recall
KSigma Alpha	Ву	optional	Help
3	Sample Size	Ν	Get Limits
	Constant Size:		Capability
	Specify Stats	Delete Stats	



## P Chart Diagnosis

- P Chart:
  - Since the sample sizes are not constant over time, the control limits are adjusted to different values accordingly.
  - All the data points fall within the control limits and spread randomly around the mean.
  - We conclude that the process is in control.

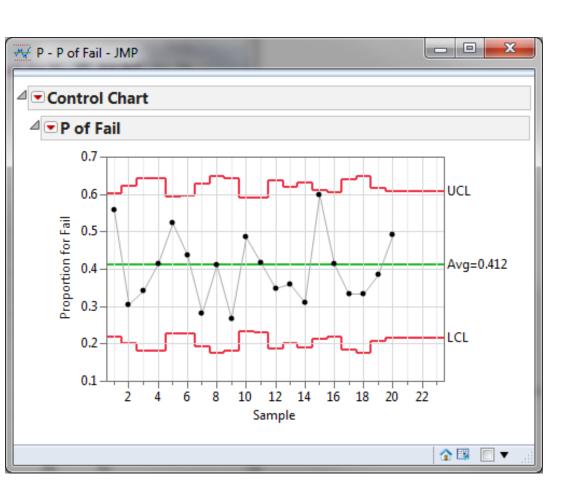



# 5.2.6 NP Chart



#### NP Chart

- The **NP chart** is a control chart monitoring the count of defectives.
- The NP chart plots the number of defectives in one subgroup as a data point.
- The subgroup size of the NP chart is constant.
- The underlying distribution of the NP chart is binomial distribution.



- NP chart
  - Data Point $X_i$

• Center Line: 
$$n\overline{p} = \frac{\sum_{i=1}^{k} x_i}{k}$$

• Control Limits:  $n\overline{p} \pm 3 \times \sqrt{n\overline{p}(1-\overline{p})}$ 

where *n* is the constant subgroup size; *k* is the number of subgroups;  $x_i$  is the number of defectives in the i<sup>th</sup> subgroup.



1163

 $\odot$ 

## Use JMP to Plot an NP Chart

- Data File: "NP.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> NP
  - 2. Select Fail in the Process Field
  - 3. Select N in the Sample Size Field
  - 4. Click Ok

😽 Control Chart - JN	ИР	• • • ×
NP Control Chart		
Select Columns	Cast Columns into Roles —	Action —
4 Columns	Process Fail	ОК
▲Day ▲Fail ▲Pass	optional ni	Cancel
	Sample Label optional	Remove
Parameters KSigma Alpha	Phase optional	Recall
	By optional	Help
3	Sample Size N	Get Limits
	Constant Size: .	Capability
	Specify Stats Delete Stats	
		🛕 🔲 🔻 🔡




www.LeanSigmaCorporation.com

1165

## NP Chart Diagnosis

- NP Chart:
  - After clicking the red arrow next to "NP of Fail" and selecting 'Tests' and also clicking 'All Tests', you can see that four accented data points fall beyond the upper control limit.
  - We conclude that the NP chart is out of control.
  - Further investigation is needed to determine the special causes which triggered the unnatural pattern of the process.

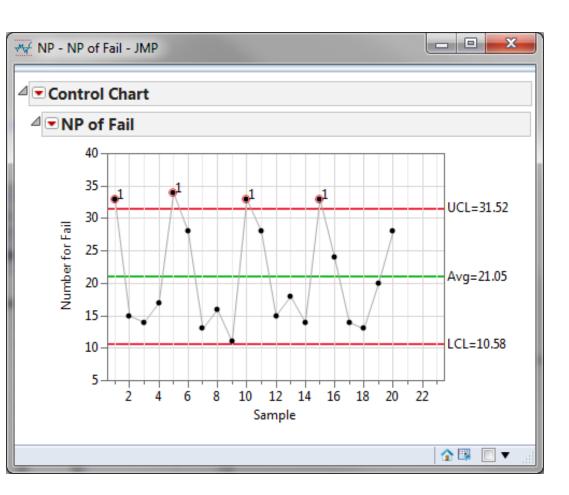







#### X-S Chart

- The **X-S chart** (also called Xbar-S chart) is a control chart for continuous data with a constant subgroup size greater than ten.
- The Xbar chart plots the average of a subgroup as a data point.
- The S chart plots the standard deviation within a subgroup as a data point.
- The Xbar chart monitors the process mean and the S chart monitors the variability within subgroups.
- The Xbar is valid only if the S chart is in control.
- The underlying distribution of the Xbar-S chart is normal distribution.

#### **Xbar Chart Equations**

т

• Xbar Chart

• Data Point: 
$$\overline{X_i} = \frac{\sum_{j=1}^{m} x_{ij}}{m}$$

• Center Line: 
$$\overline{\overline{X}} = \frac{\sum_{i=1}^{k} \overline{X}_{i}}{k}$$

• Control Limits: 
$$\overline{\overline{X}} \pm A_3 \overline{s}$$

where *m* is the subgroup size and *k* is the number of subgroups.  $A_3$  is a constant depending on the subgroup size.



• S chart • Data Point:  $s_i = \sqrt{\frac{\sum_{j=1}^{m} (x_{ij} - \overline{x}_i)^2}{m-1}}$ • Center Line:  $\overline{s} = \frac{\sum_{i=1}^{k} s_i}{k}$ 

- Upper Control Limit:  $B_4 \times s$
- Lower Control Limit:  $B_3 \times s$


where *m* is the subgroup size and *k* is the number of subgroups. B<sub>3</sub> and B<sub>4</sub> are constants depending on the subgroup size.



 $\odot$ 

#### Use JMP to Plot Xbar-S Charts


- Data File: "XbarS.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> XBar
  - 2. Select Measurement in the Process Field
  - 3. Select Subgroup ID in the Sample Label Field
  - 4. Be sure the check the Xbar and S check boxes
  - 5. Click Ok

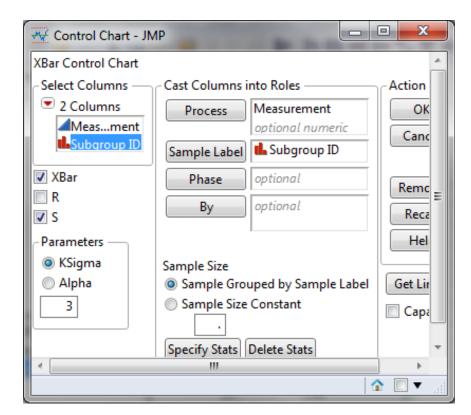



#### **Xbar-S Charts Diagnosis**

- Xbar-S Charts:
  - Since the S Chart is in control, Xbar chart is valid.
  - In both charts, there aren't any data points failing tests for special cause (i.e. all the data points fall between the control limits and spread around the center line with a random pattern).
  - We conclude that the process is in control.

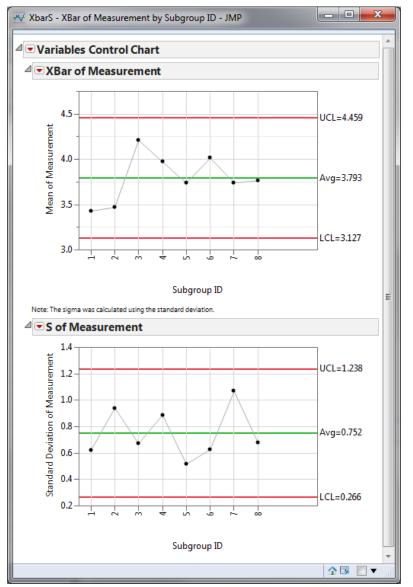



# 5.2.8 CumSum Chart



#### CumSum Chart

- The **CumSum chart** (also called cumulative sum control chart or CUSUM chart) is a control chart of monitoring the cumulative sum of the subgroup mean deviations from the process target.
- It detects the shift of the process mean from the process target over time.
- The underlying distribution of the CumSum chart is normal distribution.
- There are two types of CumSum charts:
  - One two-sided CumSum charts
  - Two one-sided CumSum charts.




#### Two-Sided CumSum

- In two-sided CumSum charts, we use a V-mask to identify out-ofcontrol data points.
- The V-mask is a transparent overlay shape of a horizontal "V" applied on the top of the CumSum chart. Its origin point is placed on the last data point of the CumSum chart and its center line is horizontal.
- If all of the data points stay inside the V-mask, we consider the process is in statistical control.



#### V-Mask

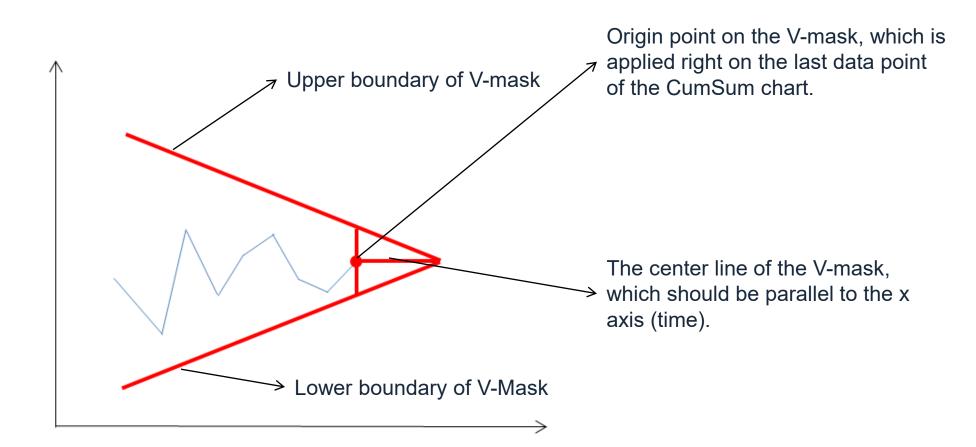

If any data points in the CumSum chart to the left of the origin point are outside the V-mask, the process is considered out of statistical control.



1175

#### **Two-Sided CumSum Equations**

Two-Sided CumSum

• Data Point: 
$$\begin{cases} c_i = c_{i-1} + (x_i - T) & i > 0 \\ c_i = 0 & i = 0 \end{cases}$$

• V-Mask Slope: 
$$k \frac{\sigma}{\sqrt{m}}$$

• V-Mask Width at the Origin Point:
$$2h \frac{\sigma}{\sqrt{m}}$$

where  $\overline{x_i}$  is the mean of the i<sup>th</sup> subgroup; *T* is the process target;  $\sigma$  is the estimation of process standard deviation; *m* is the subgroup size.



1176

#### One-Sided CumSum

- We can also use two one-sided CumSum charts to detect the shift of the process mean from the process target.
- The upper one-sided CumSum detects the upward shifts of the process mean.
- The lower one-sided CumSum detects the downward shifts of the process mean.



One-Sided CumSum

• Data Point: 
$$\begin{cases} c_i = c_{i-1} + (x_i - T) & i > 0 \\ c_i = 0 & i = 0 \end{cases}$$

• Center Line: *T* 

• Upper Control Limit: 
$$c_i^+ = \max\left(0, \overline{x}_i - (T+k) + c_{i-1}^+\right)$$


• Lower Control Limit:  $c_i^- = \max\left(0, (T-k) - \overline{x_i} + c_{i-1}^-\right)$ 

where  $\overline{\chi_i}$  is the mean of the i<sup>th</sup> subgroup; *T* is the process target; *k* is the slope of the lower boundary of the V-mask.



## Use JMP to Plot a CumSum Chart


- Data File: "CumSum.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> CumSum
  - 2. Select Weight in the Process Field
  - 3. Select hour in the Sample Label Field
  - 4. Be sure the check "H" radio button
  - 5. Enter 2 for the H parameter
  - 6. Specify Stats
    - 1. Enter 8.1 for Target
    - 2. Enter 1 for Delta
    - 3. Enter 0.05 for Sigma
  - 7. Click Ok

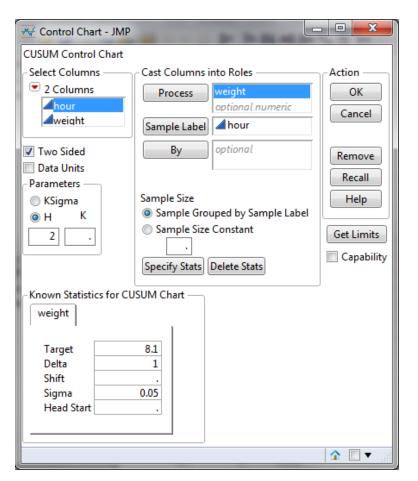



## **CumSum Chart Diagnosis**

- CumSum Chart:
  - The process is in control since all of the data points fall between the two arms of the V-mask.

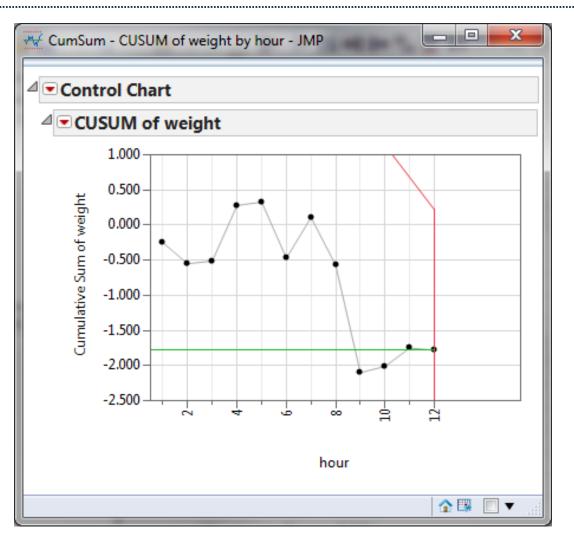



1181 )

# 5.2.9 EWMA Chart



#### **EWMA Chart**

- The EWMA chart (Exponentially-Weighted Moving Average Chart) is a control chart monitoring the exponentially-weighted average of previous and present subgroup means.
- The more recent data get more weight than more historical data.
- It detects the shift of the process mean from the process target over time.
- The underlying distribution of the EWMA chart is normal distribution.



 $\odot$ 

#### **EWMA Chart Equations**

• EWMA Chart

• Data Point: 
$$z_i = \lambda x_i + (1 - \lambda) z_{i-1}$$
 where  $0 < \lambda < 1$ 

• Center Line: X


• Control Limits: 
$$\overline{X} \pm k \cdot \frac{s}{\sqrt{n}} \sqrt{\left(\frac{\lambda}{2-\lambda}\right) \left[1 - (1-\lambda)^{2i}\right]}$$

where  $x_i$  is the mean of the i<sup>th</sup> subgroup;  $\lambda$  and k are user-defined parameters to calculate the EWMA data points and the control limits.



#### Use JMP to Plot a EWMA Chart

- Data File: "EWMA.jmp"
  - 1. Analyze -> Quality & Process -> Control Chart -> EWMA
  - 2. Select Gap in the Process Field
  - 3. Enter 0.5 in the Weight Field
  - 4. Enter 5 as the Sample Size Constant
  - 5. Click OK

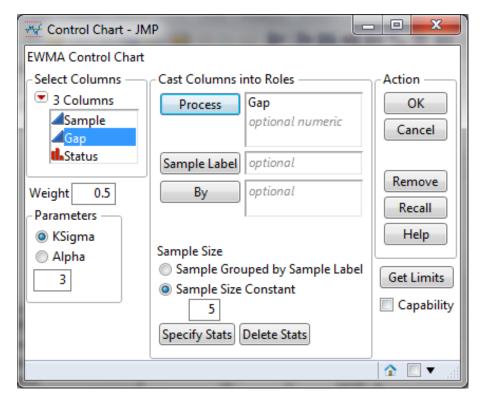




1184

## **EWMA Chart Diagnosis**

- EWMA Chart:
  - One data point falls beyond the upper control limit and we conclude that the process is out of control.
  - Further investigation is needed to discover the root cause for the outlier.

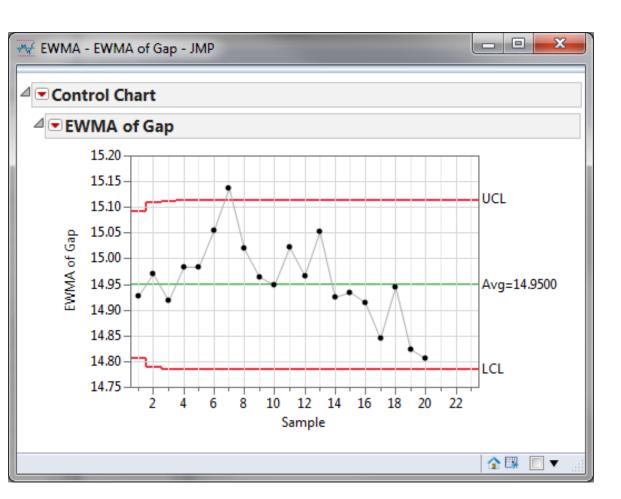



# 5.2.10 Control Methods





## **Control Methods**

- There are many control methods available to keep the process stable and minimize the variation.
- Most common control methods:
  - SPC (statistical process control)
  - 5S method
  - Kanban
  - Poka-Yoke (mistake proofing).



- SPC (Statistical Process Control) is a quantitative control method to monitor the stability of the process performance by identifying the special cause variation in the process.
- It uses control charts to detect the unanticipated changes in the process.
- Which control chart to use depends on:
  - Whether the data are continuous or discrete
  - How large the subgroup size is
  - Whether the subgroup size is constant
  - Whether we are interested in measuring defects or defectives
  - Whether we are interested in detecting the shifts in the process mean.



- 5S is a systematic approach of cleaning and organizing the workplace.
  - Seiri (sorting)
  - Seiton (straightening)
  - Seiso (shining)
  - Seiketsu (standardizing)
  - Shisuke (sustaining)



### Kanban

- A Kanban system is a demand-driven system.
- The customer demand is the signal to trigger or pull the production.
- Products are made only to meet the immediate demand. When there is no demand, there is no production.
- It was designed to reduce the waste in inventory and increase the speed of responding to immediate demand.





- **Poka-yoke** is a mechanism to eliminate the defects as early as possible in the process.
- Contact Method
  - Use of the shape, color, size, or any other physical attributes of the items
- Constant Number Method
  - Use of a fixed number to make sure a certain number of motions are completed
- Sequence Method
  - Use of a checklist to make sure all the prescribed process steps are followed in the right order.







### **Control Chart Calculations Summary**

Chart	Center Line	Control Limits	σχ	
I Chart	$\frac{\sum_{i=1}^{n} x_i}{n}$	$\frac{\sum_{i=1}^{n} X_{i}}{n} \pm 3 \times \frac{\overline{MR}}{d_{z}}$	$\frac{MR}{d_{\tau}}$	
MR Chart	$\overline{MR} = \frac{\sum_{i=1}^{n}  \mathbf{x}_{i,1} - \mathbf{x}_i }{n-1}$	$UCL = D_4 \times \overline{MR}$ $LCL = D_3 \times \overline{MR}$		
Xbar Chart (Xbar-R)	$\overline{\overline{X}} = \frac{\sum_{i=1}^{k} \overline{X}_{i}}{k}$	$\overline{\overline{X}} \pm A_2 \overline{R}$	$\frac{R}{d_{z}}$	
Xbar Chart (Xbar-S)	$\overline{\overline{X}} = \frac{\sum_{i=1}^{k} \overline{X}_{i}}{k}$	$\overline{\overline{X}} \pm A_3 \overline{s}$	<u>-</u> 	
R Chart	$\overline{R} = \frac{\sum_{i=1}^{k} R_i}{k}$	$UCL = D_4 \times \overline{R}$ $LCL = D_3 \times \overline{R}$		
S Chart	$\frac{1}{s} = \frac{\sum_{i=1}^{k} s_i}{k}$	$UCL = B_4 \times \overline{s}$ $LCL = B_3 \times \overline{s}$		
U Chart	$\overline{u} = \frac{\sum_{i=1}^{k} u_i}{k}$	$\overline{u} \pm 3 \times \sqrt{\frac{u}{n_i}}$	$\sqrt{\frac{u}{n_i}}$	
P Chart	$\frac{\sum_{i=1}^{n} x_i}{\sum_{i=1}^{n} x_i}$	$\overline{p} \pm 3 \sqrt{\frac{\overline{p}(1-\overline{p})}{n_i}}$	$\sqrt{\frac{p(1-p)}{n_i}}$	
NP Chart	$\overline{np} = \frac{\sum_{i=1}^{k} x_i}{k}$	$n\overline{p}\pm 3\times\sqrt{n\overline{p}(1-\overline{p})}$	$\sqrt{n\overline{p}(1-\overline{p})}$	



Lean Sigma Corporation Lean Six Sigma Training - JMP

1193

 $\odot$ 

Subgroup Size	A2	A3	B3	B4	c4	d2	D3	D4
2	1.88	2.659	-	3.267	0.7979	1.128	-	3.267
3	1.023	1.954	-	2.568	0.8862	1.693	-	2.574
4	0.729	1.628	-	2.266	0.9213	2.059	-	2.282
5	0.577	1.427	-	2.089	0.94	2.326	-	2.114
6	0.483	1.287	0.03	1.97	0.9515	2.534	-	2.004
7	0.419	1.182	0.118	1.882	0.9594	2.704	0.076	1.924
8	0.373	1.099	0.185	1.815	0.965	2.847	0.136	1.864
9	0.337	1.032	0.239	1.761	0.9693	2.97	0.184	1.816
10	0.308	0.975	0.284	1.716	0.9727	3.078	0.223	1.777
15	0.223	0.789	0.428	1.572	0.9823	3.472	0.347	1.653
25	0.153	0.606	0.565	1.435	0.9896	3.931	0.459	1.541



 $\odot$ 


### **Unnatural Patterns**

- If there are *unnatural patterns* in the control chart of a process, we consider the process out of statistical control.
- Typical unnatural patterns in control charts:
  - Outliers
  - Trending
  - Cycling
  - Auto-correlative
  - Mixture.
- A process is *in control* if all the data points on the control chart are randomly spread out within the control limits.



- Western Electric Rules are the most popular decision rules to detect unnatural patterns in the control charts. They are a group of tests for special causes in a process.
- The area between the upper and lower control limits is separated into six subzones.
  - Zone A: between two and three standard deviations from the center line
  - Zone B: between one and two standard deviations from the center line
  - Zone C: within one standard deviation from the center line.



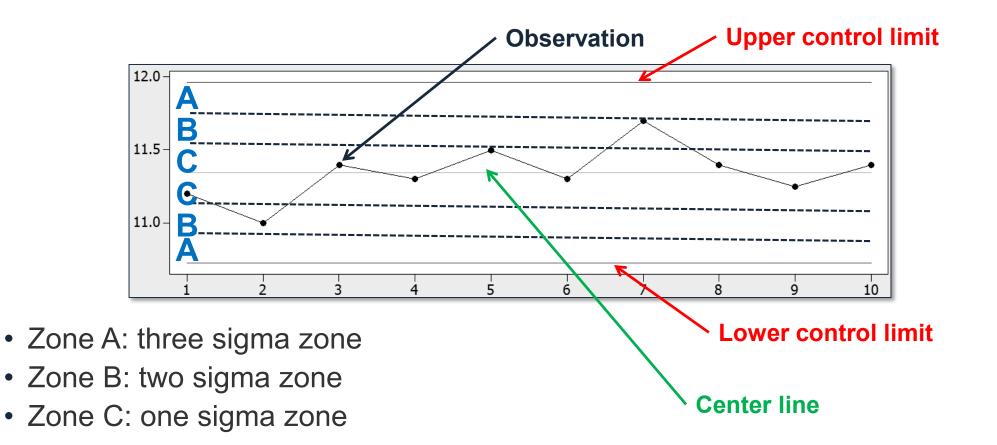


• If a data point falls onto the dividing line of two consecutive zones, the point belongs to the outer zone.



1197

 $\odot$ 


• Test 1: 1 point more than 3 standard deviations from the center line (i.e., 1 point beyond zone A)

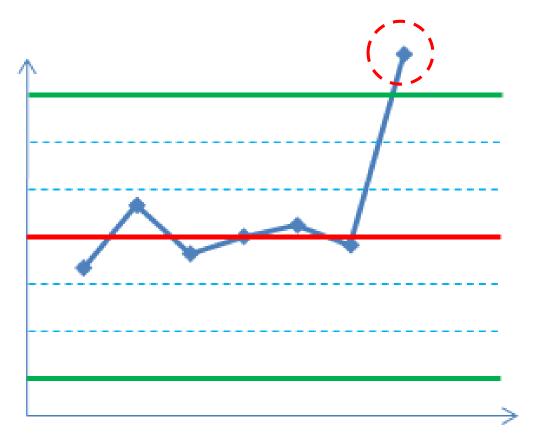







• Test 2: 9 points in a row on the same side of the center line

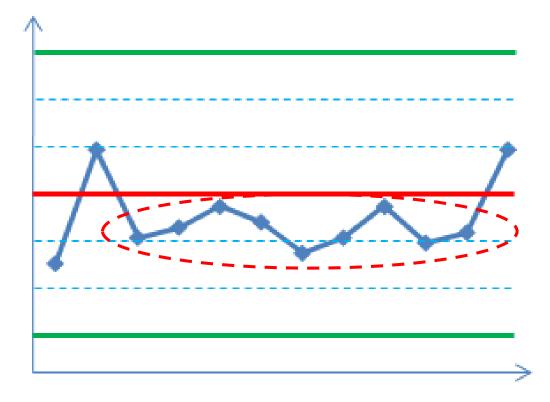



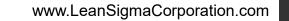


• Test 3: 6 points in a row steadily increasing or steadily decreasing

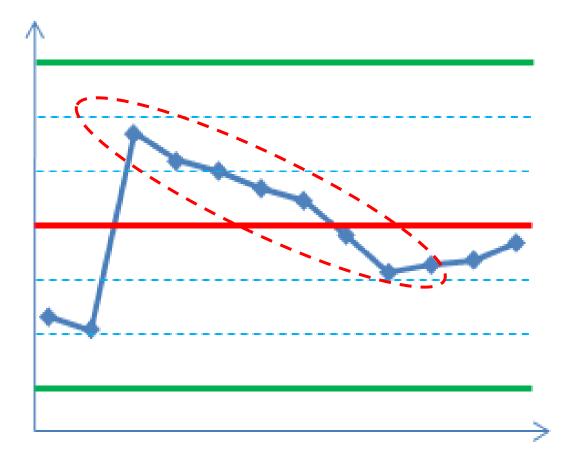




• Test 4: 14 points in a row alternating up and down

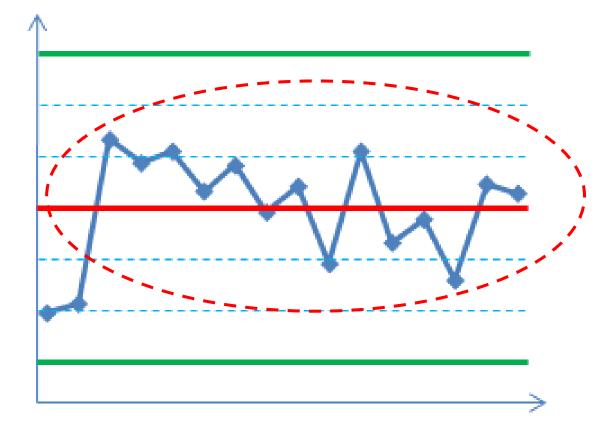



1201


• Test 5: 2 out of 3 points in a row at least 2 standard deviations from the center line (in zone A or beyond) on the same side of the center line

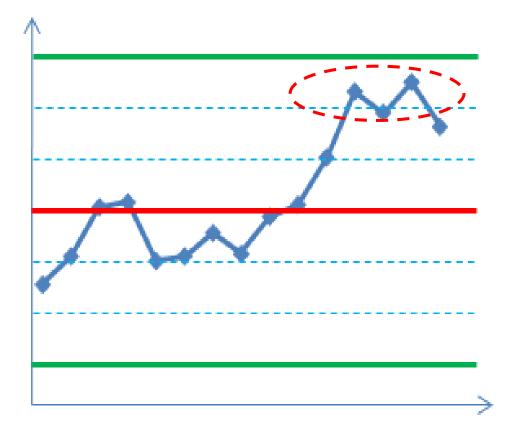






• Test 6: 4 out of 5 points in a row at least 1 standard deviation from the center line (in zone B or beyond) on the same side of the center line

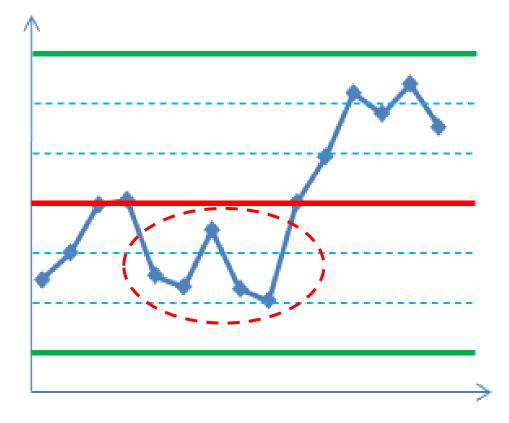




• Test 7: 15 points in a row within 1 standard deviation from the center line (in zone C) on either side of the center line

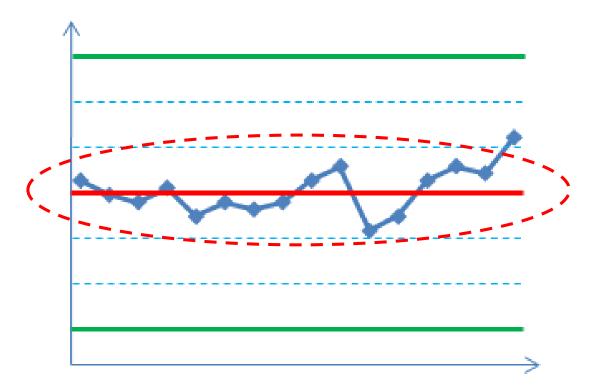



• Test 8: 8 points in a row beyond 1 standard deviation from the center line (beyond zone C) on either side of the center line

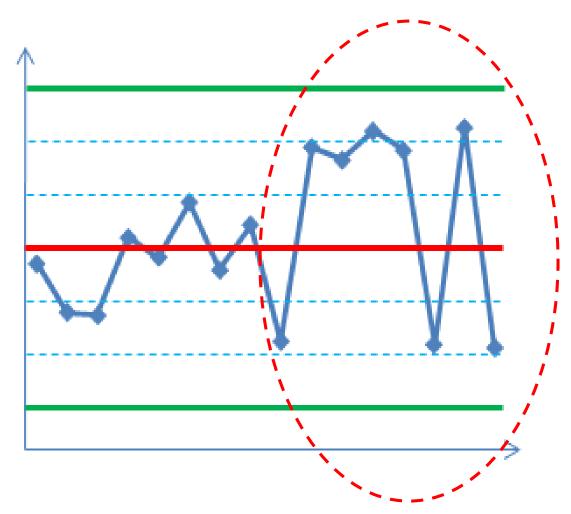



1205

 $\odot$ 

### **Next Steps**

- If no data points fail any tests for special causes, the process is in *statistical control*.
- If any data point fails any tests for special causes, the process is unstable and we will need to investigate the observation thoroughly to discover and take actions on the special causes leading to the changes.
- Process stability is the prerequisite of process capability analysis.





5.2.12 Subgroups & Sampling

www.LeanSigmaCorporation.com

Lean Six Sigma Training - JMP

© Lean Sigma Corporation



- Rational subgrouping is the basic sampling scheme in SPC (Statistical Process Control).
- When sampling, we randomly select a group (i.e., a subgroup) of items from the population of interest.
- The subgroup size is the count of samples in a subgroup. It can be constant or variable.
- Depending on the subgroup sizes, we select different control charts accordingly.



### Impact of Variation

- The rational subgrouping strategy is designed to minimize the opportunity of having special cause variation within subgroups.
- If there is only random variation (background noise) within subgroups, all the special cause variation would be reflected between subgroups. It is easier to detect the out-of-control situation.
- Random variation is inherent and indelible in the process. We are more interested in identifying and taking actions on special cause variation.



### Frequency of Sampling

- The frequency of sampling in SPC depends on whether we have sufficient data to signal the changes in a process with reasonable time and costs.
- The more frequently we sample, the higher the costs sampling may trigger.
- We need the subject matter experts' knowledge on the nature and characteristics of the process to make good decisions on sampling frequency.



# 5.3 Six Sigma Control Plans



### Black Belt Training: Control Phase

### **5.1 Lean Controls**

- 5.1.1 Control Methods for 5S
- 5.1.2 Kanban
- 5.1.3 Poka-Yoke (Mistake Proofing)

#### **5.2 Statistical Process Control (SPC)**

- 5.2.1 Data Collection for SPC
- 5.2.2 I-MR Chart
- 5.2.3 Xbar-R Chart
- 5.2.4 U Chart
- 5.2.5 P Chart
- 5.2.6 NP Chart

5.2.7 X-S chart
5.2.8 CumSum Chart
5.2.9 EWMA Chart
5.2.10 Control Methods
5.2.11 Control Chart Anatomy
5.2.12 Subgroups, Variation, Sampling

### 5.3 Six Sigma Control Plans

5.3.1 Cost Benefit Analysis5.3.2 Elements of the Control Plan5.3.3 Elements of the Response Plan



# 5.3.1 Cost Benefit Analysis



### What is Cost-Benefit Analysis?

- The cost-benefit analysis is a systematic method to assess and compare the financial costs and benefits of multiple scenarios in order to make sound economic decisions.
- A cost-benefit analysis is recommended to be done at the beginning of the project based on estimations of the experts from the finance team in order to determine whether the project is financially feasible.
- It is recommended to update the cost-benefit analysis at each DMAIC phase of the project.



### Why Cost-Benefit Analysis?

- In the Define phase of the project, the cost-benefit analysis helps us understand the financial feasibility of the project.
- In the middle phases of the project, updating and reviewing the costbenefit analysis helps us compare potential solutions and make robust data-driven decisions.
- In the Control phase of the project, the cost-benefit analysis helps us track the project's profitability.



1216

### Return on Investment

• Return on investment (also called ROI, rate of return, or ROR) is the ratio of the net financial benefits (either gain or loss) of a project or investment to the financial costs.

$$ROI = \frac{TotalNetBenefits}{TotalCosts} \times 100\%$$

where

TotalNetBenefits = TotalBenefits - TotalCosts



## Return on Investment (ROI)

- The return on investment is used to evaluate the financial feasibility and profitability of a project or investment.
  - If ROI < 0, the investment is not financially viable.
  - If ROI = 0, the investment has neither gain nor loss.
  - If ROI > 0, the investment has financial gains.
- The higher the ROI, the more profitable the project.



### Net Present Value (NPV)

• The **net present value** (also called NPV, net present worth, or NPW) is the total present value of the cash flows calculated using a discount rate.

$$NPV = \frac{NetCashFlow_t}{\left(1+r\right)^t}$$

Where

*NetCashFlow*<sub>t</sub> is the net cash flow happening at time *t*; *r* is the discount rate; *t* is the time of the cash flow.



### **Cost Estimation**

- Examples of costs triggered by the project:
  - Administration
  - Asset
  - Equipment
  - Material
  - Delivery
  - Real estate
  - Labor
  - Training
  - Consulting.



### **Benefits Estimation**

- Examples of benefits generated by the project:
  - Direct revenue increase
  - Waste reduction
  - Operation cost reduction
  - Quality and productivity improvement
  - Market share increase
  - Cost avoidance
  - Customer satisfaction improvement
  - Associate satisfaction improvement.



www.LeanSigmaCorporation.com

## Challenges in Cost and Benefit Estimation

- Different analysts might come up with different cost and benefit estimations due to their subjectivity in determining:
  - The discount rate
  - The time length of the project and its impact
  - Potential costs of the project
  - The tangible/intangible benefits of the project
  - The specific contribution of the project to the relevant financial gains/loss.



# 5.3.2 Elements of Control Plans



### **Control Plans**

- The control plans ensure that the changes introduced by a Six Sigma project are sustained over time.
- Benefits of the Control phase:
  - Methodical roll-out of changes including standardization of processes and work procedures
  - Ensure compliance with changes through methods like auditing and corrective actions
  - Transfer solutions and learning across the enterprise
  - Plan and communicate standardized work procedures
  - Coordinate ongoing team and individual involvement
  - Standardize data collection and procedures
  - Measure process performance, stability, and capability
  - Plan actions that mitigate possible out-of-control conditions
  - Sustain changes over time.



1223

### What is a Control Plan?

- A **control plan** is a management planning tool to identify, describe, and monitor the process performance metrics in order to meet the customer specifications steadily.
- It proposes the plan of monitoring the stability and capability of inputs and outputs of critical process steps in the Control phase of a project.
- It covers the data collection plan of gathering the process performance measurements.
- Control plans are the most overlooked element of most projects. It is critical that a good solution be solidified with a great control plan!




# **Control Plan Elements**

- Control Plan
  - The clear and concise summary document that details key process steps, CTQs metrics, measurements, and corrective actions.
- Standard Operating Procedures (SOPs)
  - Supporting documentation showing the "who does what, when, and how" in completing the tasks.
- Communication Plan
  - Document outlining messages to be delivered and the target audience.
- Training Plan
  - Document outlining the necessary training for employees to successfully perform new processes and procedures.
- Audit Checklists
  - Document that provides auditors with the audit questions they need to ask.
- Corrective Actions




- The control plan identifies critical process steps that have significant impact on the products or services and the appropriate controls mechanisms.
- The control plan includes measurement systems that monitor and help manage key process step performance.
- Specified limits and targets of the performance metrics are clearly defined and communicated.
- Sampling plans to collect the measurements are declared:
  - How many samples are needed?
  - How often do we need to sample?
  - Where should we sample?

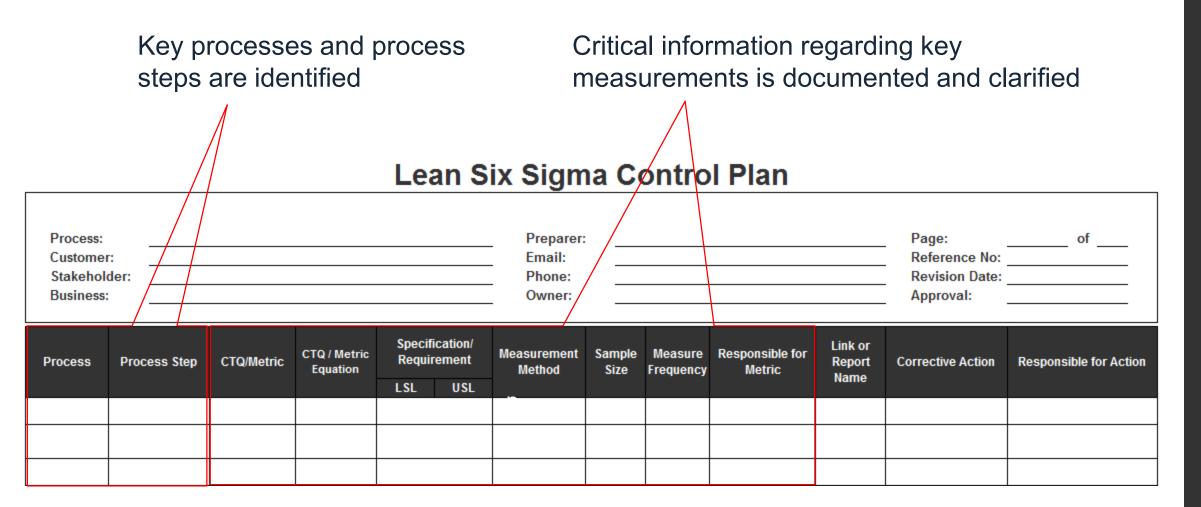



 $\odot$ 

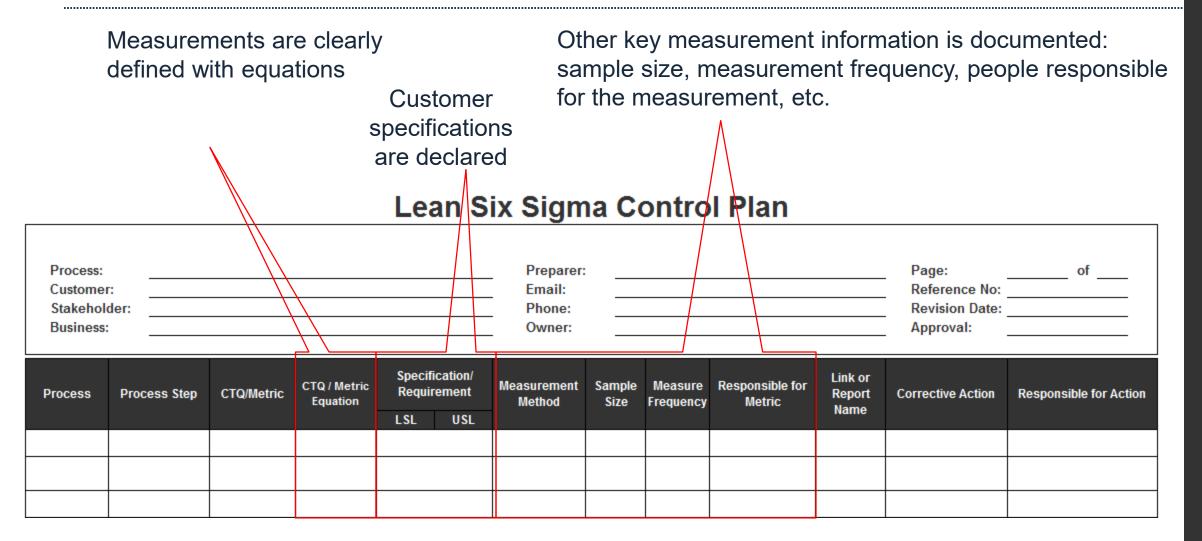



 $\bigcirc$ 

Where will this measurement or report be found? Good control plans provide linking information or other report reference information. Control plans identify the mitigating action or corrective actions required in the event the measurement falls out of spec or control. Responsible parties are also declared.



Process: Customer Stakehole Business:	r: der:				Preparer: Email: Phone: Owner:					Page: Reference No: Revision Date: Approval:	of
Process	Process Step	CTQ/Metric	CTQ / Metric Equation	Specifi Requir LSL	Measurement Method	Sample Size	Measure Frequency	Responsible for Metric	Link or Report Name	Corrective Action	Responsible for Action



 $\odot$ 

# Standard Operating Procedures (SOPs)

- Standard Operating Procedures (SOPs) are documents that focus on process steps, activities, and specific tasks required to complete an operation.
- SOPs should not be much more than two to four pages.
- SOPs should be written to the user's level of required detail and information.
  - The level of detail is dependent on the position's required skills and training
- Good SOPs are auditable, easy to follow, and not difficult to find.
  - Auditable characteristics are: observable actions and countable frequencies. Results should be evident to a third party (*compliance to the SOP must be measurable*).



# **SOP Elements**

- SOPs are intended to impart high value information in concise and well-documented manner.
- SOP Title and Version Number:
  - Provide a title and unique identification number with version information.
- Date:
  - List the original creation date; add all revision dates.
- Purpose:
  - State the reason for the SOP and what it intends to accomplish.
- Scope:
  - Identify all functions, jobs, positions, and/or processes governed or affected by the SOP.



# **SOP Elements**

- Responsibilities:
  - Identify job functions and positions (not people) responsible for carrying out activities listed in the SOP.
- Materials:
  - · List all material inputs: parts, files, data, information, instruments, etc.
- Process Map:
  - Show high level or level two to three process maps or other graphical representations of operating steps.
- Process Metrics:
  - Declare all process metrics and targets or specifications.
- Procedures:
  - List actual steps required to perform the function.
- References:
  - List any documents that support the SOP.



# **SOP** Template

S	tandard Operating	Procedures	
SOP Name/Title:			
Document Storage Loca	ation/Source:	Document No:	
SOP Originator:	Approving Position:	Effective Date:	
Name:	Name:	Last Edited Date:	
Signature:	Signature:	Other:	

### 1. Purpose

"Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### 2. Scope

"Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### 3. Responsibilities (RACI)

Responsible	Accountable	Consulted	Informed
John Doe	Jane Doe	Jack Doe	Jill Doe
Pam Doe	Paul Doe	Phil Doe	Peggy Doe

### 4. Materials


"Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### 5. Related Documents

"Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### 6. Definitions

"Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

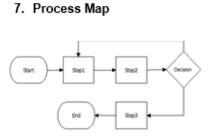

### 8. Procedures

Step	Action	Responsible
1		
2		
3		

### 9. Process Metrics

- "Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut
- "Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### 10. Resources

- "Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut
- "Lorem ipsum dolor sit amet, consectetur adipiscing elit, sed do eiusmod tempor incididunt ut

### www.LeanSigmaCorporation.com

# **Communication Plans**

- **Communication plans** are documents that focus on planning and preparing for the dissemination of information.
- Communication plans organize messages and ensure that the proper audiences receive the correct message at the right time.
- A good communication plan identifies:
  - Audience
  - Key points/message
  - Medium (how the message is to be delivered)
  - Delivery schedule
  - Messenger
  - Dependencies and escalation points
  - Follow-up messages and delivery mediums.
- Communication plans help develop and execute strategies for delivering changes to an organization.



					C	commur	nication	Plan T	emplate
Process/Function Name		Project/Program Name		on Name Project/Program Name Project Lead		Project Sponsor/Champion			
Communication Pu	rpose:								
Target Audience	Key Message	Message Dependencies	Delivery Date	Location	Medium	Follow up Medium	Messenger	Escalation Path	Contact Information
and the second s	La Committee					Constant of the local division of the local			

# **Training Plans**

- **Training plans** are used to manage the delivery of training for new processes and procedures.
- Most GB or BB projects will require changes to processes and/or procedures that must be executed or followed by various employees.
- Training plans should incorporate all SOPs related to performing new or modified tasks.
- Training plans use and support existing SOPs and do not supersede them.
- Training plans should include logistics:
  - One-on-one or classroom
  - Instruction time
  - Location of training materials
  - Master training reference materials
  - Instructors and intended audience
  - Trainee names.



Sponsor		n	Business Division			Project Lead		Process		Project	
Statu	Trainer	Other Requirements	Technology Requirements	Supporting Docs	Training Medium	Key Change/Process	How Many	When	Where	Who	
<u> </u>											



 $\bigcirc$ 

# **Audits**

- What is an **audit**?
  - ISO 9000 defines an Audit as "a systematic and independent examination to determine whether quality activities and related results comply with planned arrangements and whether these arrangements are implemented effectively and are suitable to achieve objectives."
- Audits are used to ensure actions, processes, procedures, and other tasks are performed as expected.



# Audit Guidelines

- Audits should be directed by managers, supervisors, and other accountable positions.
- An audit's purpose must be well-defined and executed by independent unbiased personnel.
- Auditors must:
  - Be qualified to perform their tasks
  - Attend and successfully complete an internal auditing training session
  - Be able to identify whether or not activities are being followed according to the defined SOP
  - Base conclusions on facts and objective evidence
  - Use a well documented audit checklist.
- Audits should confirm compliance or declare non-compliance.



# Audit Checklists

- Auditors should review the SOPs before preparing checklists or ensure that existing checklists properly reference SOPs.
- Audit checklists:
  - Serve as guides for identifying items to be examined
  - Are used in conjunction with understanding of the procedure
  - Ensure a well-defined audit scope
  - Identify needed facts during audits
  - Provide places to record gathered facts.
- Checklists should include:
  - A review of training records
  - A review of maintenance records
  - Questions or observations that focus on expected behaviors
  - Questions should be open-ended where possible
  - Definitive observations yes/no, true/false, present/absent, etc.



# Audit Checklist Template

Target Area:	Statement of Audit Objective:	Auditor:	Audit Date:
Audit Technique	Auditable Item, Observation, Procedure etc.		ual Auditor Circle Rating)
Observation	Have all associates been trained?	YES	NO
Observation	Is training documentation available?	YES	NO
Observation	Is training documentation current?	YES	NO
Observation	Are associates wearing proper safety gear?	YES	NO
Observation	Are SOP's available?	YES	NO
Observation	Are SOP's current?	YES	NO
Observation	Is quality being measured	YES	NO
Observation	Is sampling being conducted in random fashion	YES	NO
Observation	Is sampling meeting it's sample size target?	YES	NO
Observation	Are control charts in control	YES	NO
Observation	Are control charts current?	YES	NO
Observation	Is the process capability index >1.0?	YES	NO
Number of Out of Cor	npliance Observations		
Total Observations			
Audit Yield			#DIV/0!
Corrective Actions Re	equired		
Auditor Comments			

### Audit Checklist





 $\odot$ 

Lean Sigma Corporation

# © Lean Sigma Corporation



5.3.3 Response Plan Elements

1242

# What is a Response Plan?


- A **response plan** should be a component of as many control plan elements as possible.
- Response plans are a management planning tool to describe corrective actions necessary in the event of out-of-control situations.
- There is never any guarantee that processes will always perform as designed. Therefore, it is wise to prepare for occasions when special causes are present.
- Response plans help us mitigate risks and, as already mentioned, should be part of several control plan elements.



# **Response Plan Elements**

- Action triggers
  - When do we need to take actions to correct a problem or issue?
- Action recommendation
  - What activities are required in order to solve the problem in the process? The action recommended can be short-term (quick fix) or long-term (true process improvement).
- Action respondent
  - Who is responsible for taking actions?
- Action date
  - When did the actions happen?
- Action results
  - What actions have been taken?
  - When were actions taken?
  - What are the outcomes of the actions taken?



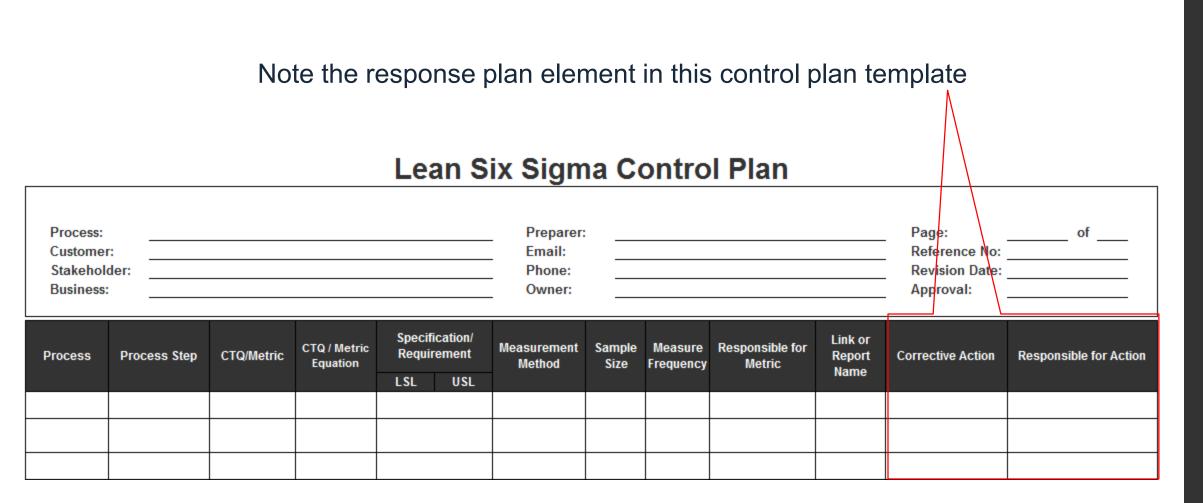



www.LeanSigmaCorporation.com

Process/Function Name Project/Program Name						Communication Plan Template			
Communication Pu	rpose:								
Target Audience	Key Message	Message Dependencies	Delivery Date	Location	Medium	Follow up Medium	Messenger	Escalation Path	Contact Information
-				-					
F									

Note the response plan element in this communication plan template



# **Response Plan Elements**

## Audit Checklist

www.LeanSigmaCorporation.com

Target Area:	Statement of Audit Objective:	Auditor:	Audit Date:
		Individu	al Auditor
Audit Technique	Auditable Item, Observation, Procedure etc.	Rating (C	ircle Rating
Observation	Have all associates been trained?	YES	NO
Observation	Is training documentation available?	YES	NO
Observation	Is training documentation current?	YES	NO
Observation	Are associates wearing proper safety gear?	YES	NO
Observation	Are SOP's available?	YES	NO
Observation	Are SOP's current?	YES	NO
Observation	Is quality being measured	YES	NO
Observation	Is sampling being conducted in random fashion	YES	NO
Observation	Is sampling meeting it's sample size target?	YES	NO
Observation	Are control charts in control	YES	NO
Observation	Are control charts current?	YES	NO
Observation	Is the process capability index >1.0?	YES	NO
Number of Out of Co	mpliance Observations		
Total Observations			
Audit Yield			#DIV/0!
Corrective Actions R	lequired		
Auditor Comments			

# Note the response plan element in this audit checklist



Lean Sigma Corporation Lean Six Sigma Training - JMP

 $\odot$ 



# LEAN SIGMA CORPORATION

Lean Six Sigma Black Belt Training Featuring Examples from JMP 18



1248